

Third Party Audit of ROB's and FOB's of SCR



INSPECTION OF FOB AT NAMPALLY RAILWAY STATION

Final Report
SEPTEMBER | 2020

CONTENTS


	Page no
1. Visual Inspection.....	3
1.1 General Information and Observation	
1.2 Identification of Loads on Bridge	
1.3 Structural System of the Bridge	
1.4 Survey of Signs of Distress, Deformation in Bridges	
1.5 Numerical Model	
2. Vibration Analysis.....	16
2.1 Interpretation Vibration Analysis	
3. Repair and Retrofitting Recommendations.....	18
4. Annexure.....	26
5. Summary.....	40

LIST OF FIGURES

Fig No.		
Fig 1.1	Cables	9
Fig 1.2	Advertising hoardings in FOB	9
Fig 1.3	Provision of protective screen for passengers over FOB	9
Fig 1.4	Column is merged in platform flooring	10
Fig 1.5	Utilities load on roof truss (Ethernet boxes)	10
Fig 1.6	Main and Secondary girder with joint details	11
Fig 1.7	Arrangement of Bracings	11
Fig 1.8	Beam-column joint with Cleat angle.	11
Fig 1.9	Vegetation growth on main girder	12
Fig 1.10	Running of Cables into FOB	12
Fig 1.11	Secondary girders joints have severely deteriorated	12
Fig 1.12	Numerical Modeling of Khairtabad Railway station FOB	13
Fig 1.13	Modal analysis of FOB	13
Fig 1.14	Axial Forces of all Members	14
Fig 1.15	Displacements in truss	14
Fig 1.16	Highlighted members having maximum axial forces	15
Fig 3.1	Bottom view of FOB with pre-cast panels damaged locations	20
Fig 3.2	Damage locations identified in “P1”	21
Fig 3.3	Damage locations identified in “P2”	22
Fig 3.4	Damage locations identified in “P3”	22
Fig 3.5	Damage locations identified in “P3”	23
Fig 3.6	Pre-cast panels protected with cement mortar from bottom “P9”	23
Fig 3.7	Rebar exposure under staircase	24
Fig 3.8	Bottom view of FOB with bottom chord member and floor beam damaged locations	24
Fig 3.9	Bottom view of FOB with bottom chord member, floor beam and bracing connection damaged locations	24
Fig 3.10	Vegetation and debris accumulated on top of bridge	25
Annexure: Repair Methodologies		
Annexure-1a	Debris Accumulation : Cleaning	27
Annexure-1b	Spalling, Honey Comb : Patching	29
Annexure-1c	Minor Correction of Steel element : Touchup Painting	33
Annexure-1d	Spalling, Abnormal Anchorage : Hand Applied Mortar	36

1. VISUAL INSPECTION

Name of the Project	:	VISUAL INSPECTION OF FOB/ PF-2 - PF-6 AT HYDERABAD RAILWAY STATION
Location	:	HYDERABAD RAILWAY STATION 17°23'36.2"N 78°28'02.9"E
Date of Inspection	:	12 th OCTOBER, 2019

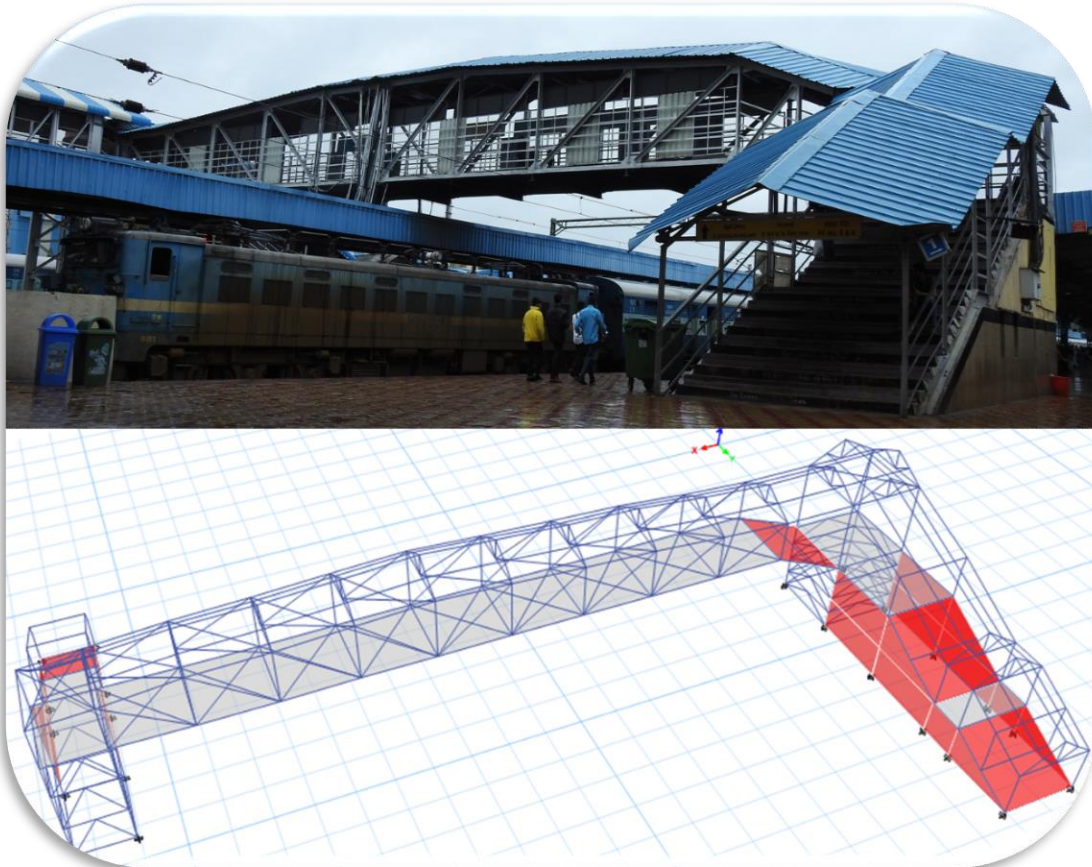


Visual inspection Summary:

- a) Major Corrosion is observed at steel concrete joint(bottom of slab)
- b) Spalling is observed with exposed reinforcement.
- c) Secondary girders joints have severely deteriorated.
- d) Vegetation is observed on Tie members

1.1 GENERAL INFORMATION AND OBSERVATION

a	Name of the Bridge	FOB/ PF-2 - PF-6
b	Location of Bridge Location co-ordinates	Hyderabad Railway Station 17°23'36.2"N 78°28'02.9"E
c	Type of truss Structure	Camel Back Truss
d	Year of Construction,	Approx. 70+ years
e	Description of the main use of the bridge	Pedestrians Crossing
f	Major Materials used in different parts of bridge	Structural Steel(truss, frame), Pre-cast RCC (Slab, Staircase)
g	Width of the Pathway (m)	3.60 m
h	Length of the Pathway (m)	33.0 m (Clear span)
i	No of Railway Lines Crossings	4 tracks
j	Span arrangement (no x Span in meters)	1x 33.0 m
k	Vertical Clearance (from rail top to floor slab bottom)	6.481 m
l	Head Room	3.10 m at mid span, 2.7 m at supports
m	Damages due to accidental hitting, Grazing Marks	No Grazing signs appear
n	History of Repair (if any...)	Yes (Patch works are observed at site)
o	Existing Structural drawings	Not available

Key Plan

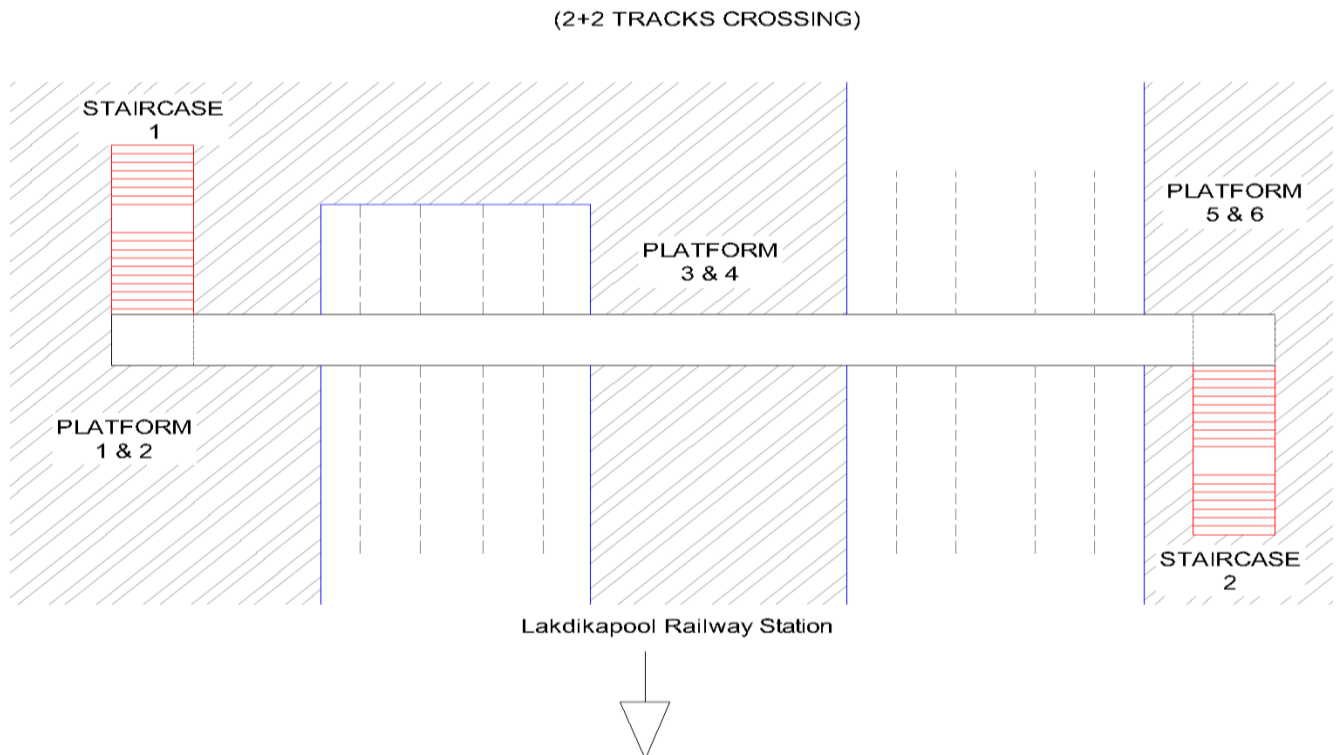

1.2 IDENTIFICATION OF LOADS ON BRIDGE			
		Yes/No	Notes
a	Dead Loads at Roof level		
	a) Pipeline - Utilities	No	Not observed in site
	b) Cables	Yes	Cables are protected with HDPE pipe and Galvanized iron pipes support on Aluminum hangers. (Refer fig :1.1, 1.10)
	c) Roof Truss	Yes	65x65x8 mm angles are used (Refer fig :1.5)
	d) Roof Sheet	Yes	Galvanized sheet is used for roof
	e) load of advertising hoarding	Yes	a. No Advertising boards are provided. b. Rail Wi-Fi units are supported on roof truss (Refer fig :1.5)
	f) load of train/coach display boards	No	No train coach display boards are provided
	g) Additional load of overhead electrical equipment(OHE), Signal	No	No Additional load of overhead electrical equipment(OHE), Signal
b	Dead Loads at Floor level		
	a) Additional wearing coat on Floor	No	Chequered tiles are used for flooring (Refer fig :1.3)
	b) Provision of protective screen for passengers	Yes	Chain link fence made of galvanized wire of 2 mm Gauge and metal sheet is used above OHE line on both sides of pathway is used for protection, mesh is supported by angular sections and flats. (Refer fig :1.3)
	c) Type of Material used for mesh	GI wire mesh	

1.3 STRUCTURAL SYSTEM OF THE BRIDGE			
			Notes
a	Foundation		Not visible at site (Refer fig :1.4)
b	Tresels details		Concrete pedestals are merged in walls and covered with platform flooring refer fig.1.4
	Reinforcement Details of Pedestal		
	Column – Pedestal Connection Details		
	a) No of Bolts and size	Not appear during visual inspection	
	b) Thickness of Base Plate	Not appear during visual inspection	

c	Roof Truss		
	Element of roof truss section	King post Angular truss	King post angular truss with 65x65x8 mm section is used. Supported on Main tie members using welded joints (Refer fig :1.5).
	Size of roof truss	3.60 X 0.8 m	
	Connection of Roof elements	Using Gusset plate and Bolts	
d	Steel Girder/Truss		
	Type/Shape of Girder Section	Angular section	a. Main tie members 100x100x12 mm Double angular section b. 65 x 65 x 8 mm double angular are used as bracing members c. 10 mm thick gusset plate is used for welded joint (Refer fig :1.7)
	Height of Girder/ Truss (H)	3.10 m at mid span 2.7m at supports	
	Girder/Truss Support Condition	Rigid Connection	
	Type/Shape of Secondary Girder /Bracings	Double Channel and Angular section	ISMC 150 Double Channel are used as secondary girders supported with 65 x 65 x 8 mm angular sections to transfer load from slab to roof truss. Secondary girders are connected with tie member using bolts and bracing are connected to tie members using welding (Refer fig :1.6)
	No of Secondary Girders/bracings for span	8 no's	
	Arrangement of Bracings	Diagonal	
	Type of Beam-Column Joint (shape of gusset plate if any)	Cleat angles	
e	COLUMN		
	Type/Shape of Column section	I – Section	FOB is supported on vertical column of Four - ISMB 300. (Refer fig :1.4)
	No of Columns/support	4 no's	
	Dimensions of Column	300x150 mm	
	BEAM-Column joint (bolted, welded, riveted)	Bolted	
f	FLOOR SLAB OF THE PATHWAY		
	Material of Slab	Precast RCC	Pre-cast Reinforced concrete slab panels are used for floor slab of 125 mm thick, RCC slab panels are resting on angular tie members supported on secondary girder and bracing from bottom. Chequered tile flooring is laid on the top of the slab panels
	Thickness of Slab	125 mm	
	Condition of Slab from Bottom	Spalling and reinforcement exposure observed in precast slab panels	
	Condition of Slab from Top	Precast RCC slab panels are not visible,	
	Condition of sheeting – MS sheet at bottom	Not provided.	
g	Staircase Details		
	Number of staircases	2 No's	Staircase steps are observed as Precast RCC slab panels of size 300 x 100 mm used. Steps are supported on ISMC 300 channel using cleat angles. Staircase landing of 2 m
	Number of steps from PF – 2	37 no's	
	Number of steps from PF – 5	37 no's	

	Material used for steps	RCC slab panel	wide is supported on vertical and horizontal channels members.
h	Staircase Railing		
	Type of Parapet Railing	Steel railing	Staircase is provided with railing on both sides of one-meter height using 65 x 65 x 6 mm angular and 50 x 6 mm M.S flats are used.
	Height of Railing	1 m	

1.4 SIGNS OF DISTRESS, DEFORMATION IN BRIDGES

A

- ✓ Spalling and reinforcement exposed in precast RCC slab panels and joints.
- ✓ Corrosion is observed in Tie angular sections, Gusset plates and bracing along steel – concrete joint on both sides of FOB
- ✓ Leaching is observed between slab panels joints.



Spalling and leaching effect observed at bottom of slab panels

B

- ✓ Major Corrosion is observed along the length of steel concrete joint on both sides
- ✓ Inclined bracing and gusset plates are also corroded near base slab



Major Corrosion observed at main girders along the span

SIGNS OF DISTRESS, DEFORMATION IN BRIDGES			
	Defects	Location	
	Cracking in steel members		No cracks are observed in Steel during visual inspection
	Cracking in RCC components	Slab Panels	Major cracks are observed in Pre-casted RCC slab panels
	Water seepage		No water seepage is observed
	Spalling	At Mid span	Spalling is observed in some precast RCC members.
	Rust straining	Beam – Column Joints	Slight rusting is observed at all the joints of FOB at floor level
	Extent Of Corrosion	In Tie member	a. Distressing is observed in bottom Tie members along steel column joints b. Spacers in between secondary girders are completely distressed
	Corrosion in Gusset plate	near base slab	Rusting is observed in Gusset plates
	Corrosion in welded structures	near base slab	Corrosion is observed
	Corrosion at steel-Concrete joint		Major corrosion is observed at steel concrete joint.
	Condition of Painting of steel structure		Painting is affected only at distressed places.

***Rust:** Rust is a part of corrosion and is a chemical process which results in the formation of red or orange coating on the surface of metals.

***Corrosion:** it is the process of deterioration of materials as a results of chemical, electrochemical or other reactions



Fig 1.1: Cables



Fig 1.2: Advertising hoardings in FOB



Fig 1.3: Provision of protective screen for passengers over FOB



Fig 1.4: Column is merged in platform flooring



Fig 1.5: Utilities load on roof truss (Ethernet boxes)



Fig 1.6: Main and Secondary girder with joint details



Fig 1.7: Arrangement of Bracings

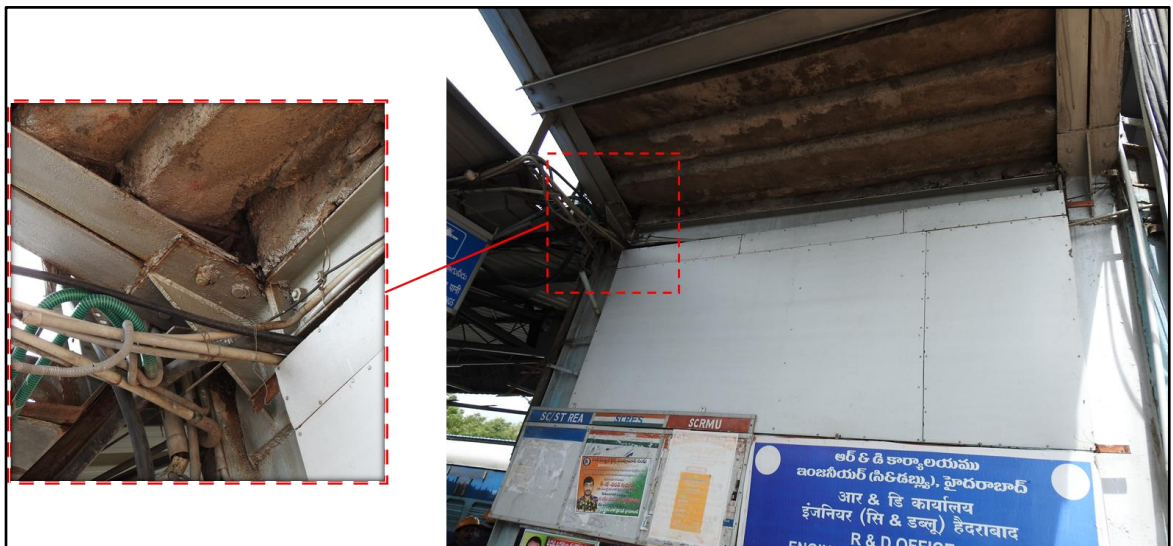


Fig 1.8: Beam-column joint with Cleat angle.

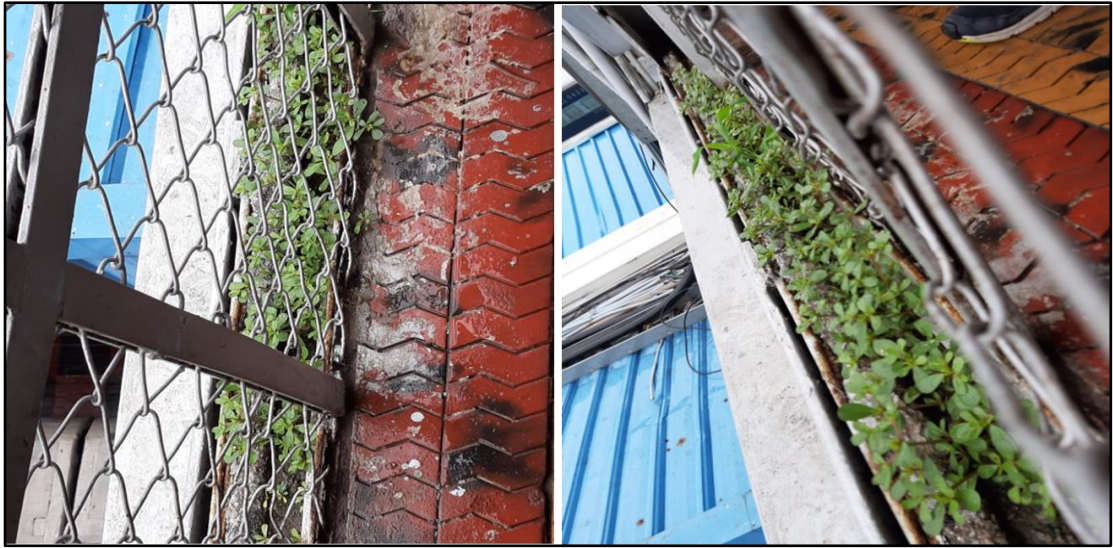


Fig 1.9: Vegetation growth on main girder

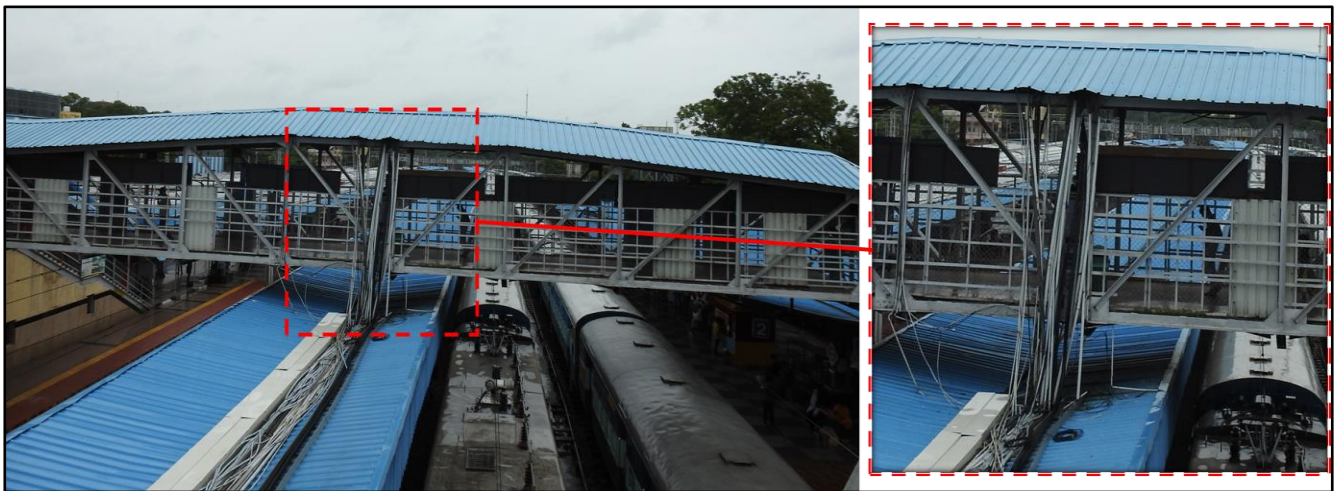


Fig 1.10: Running of Cables into FOB



Fig 1.11: Secondary girders joints have severely deteriorated

1.5 Numerical Model

- Three-dimensional numerical model has been developed from the dimensions obtained by visual inspection and loads considered for foot over bridge is 5kN/m^2 . Obtained model and results are shown below.

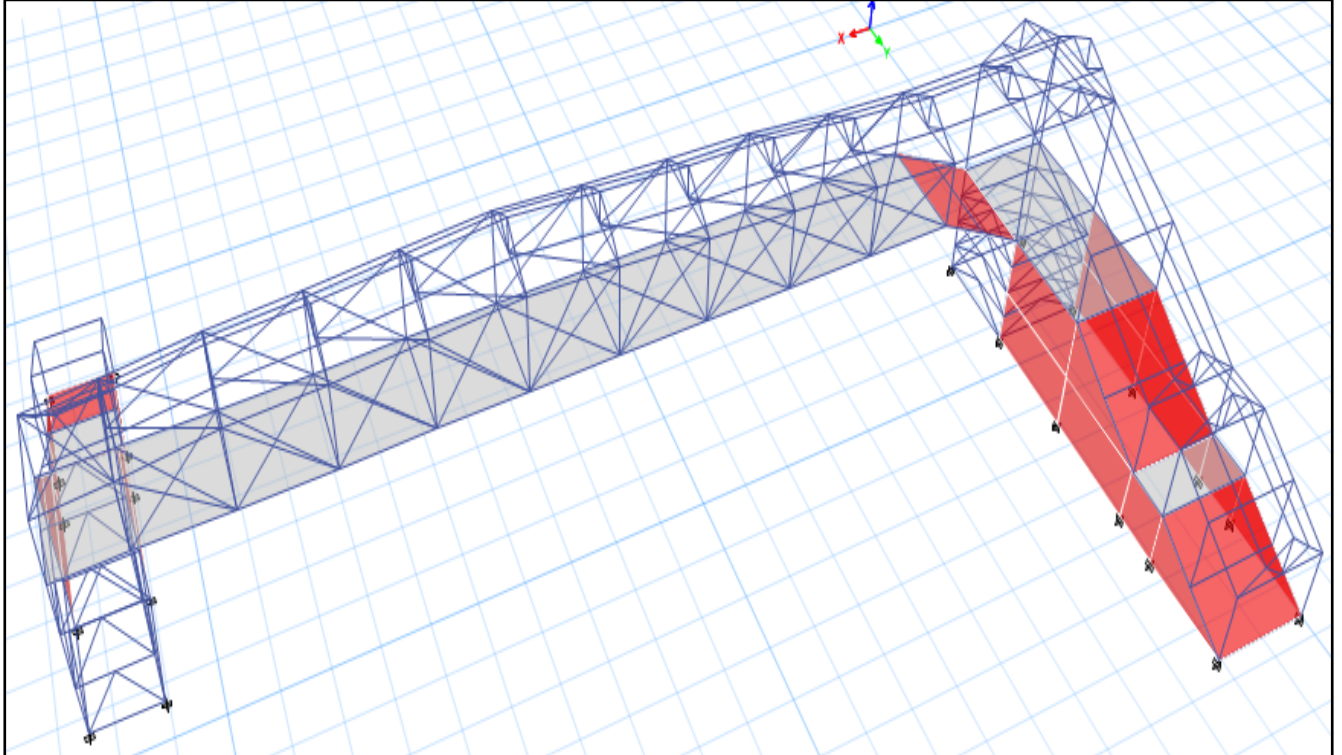


Fig: 1.12 Numerical Modeling of Khairtabad Railway station FOB (Developed from the Visual inspection)

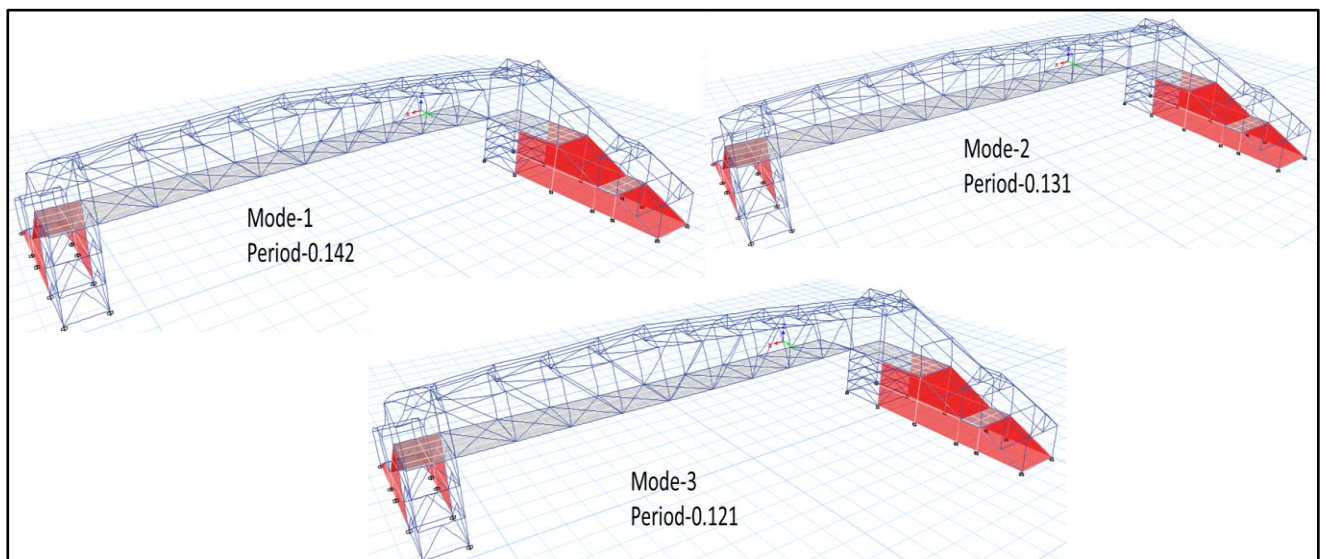


Fig 1.13 Modal analysis of FOB

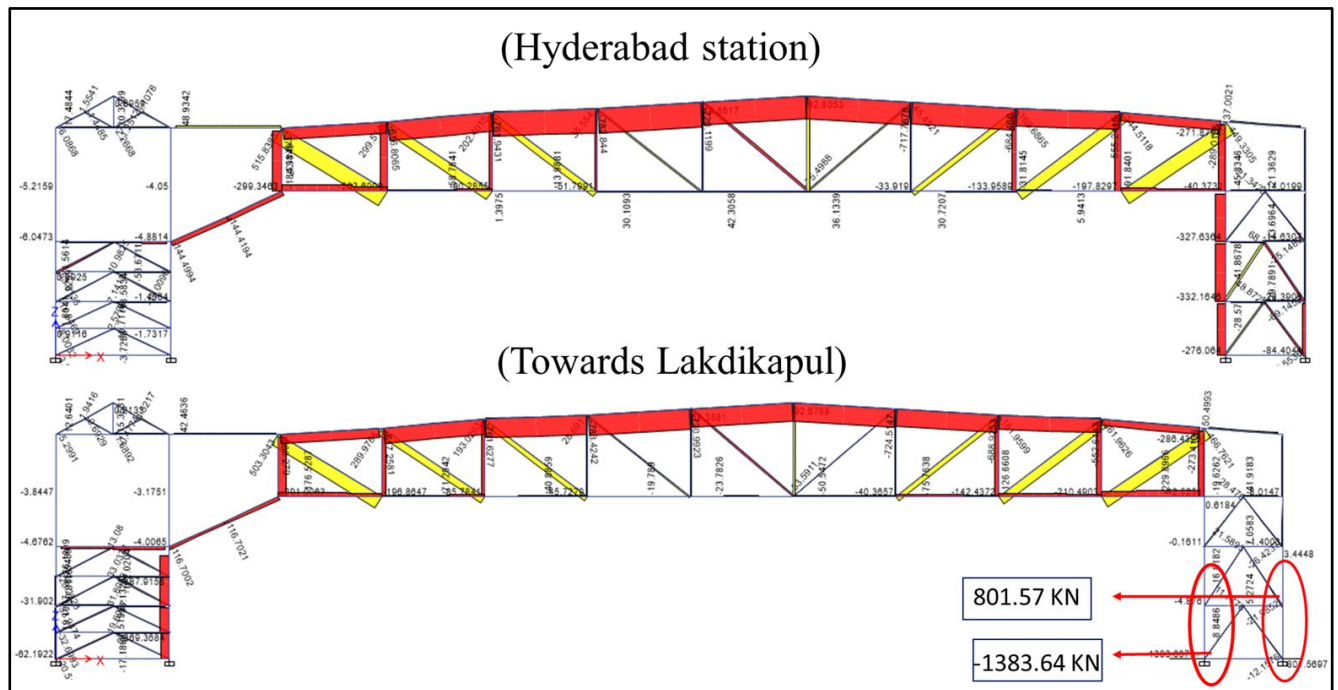


Fig: 1.14 Axial Forces of all Members

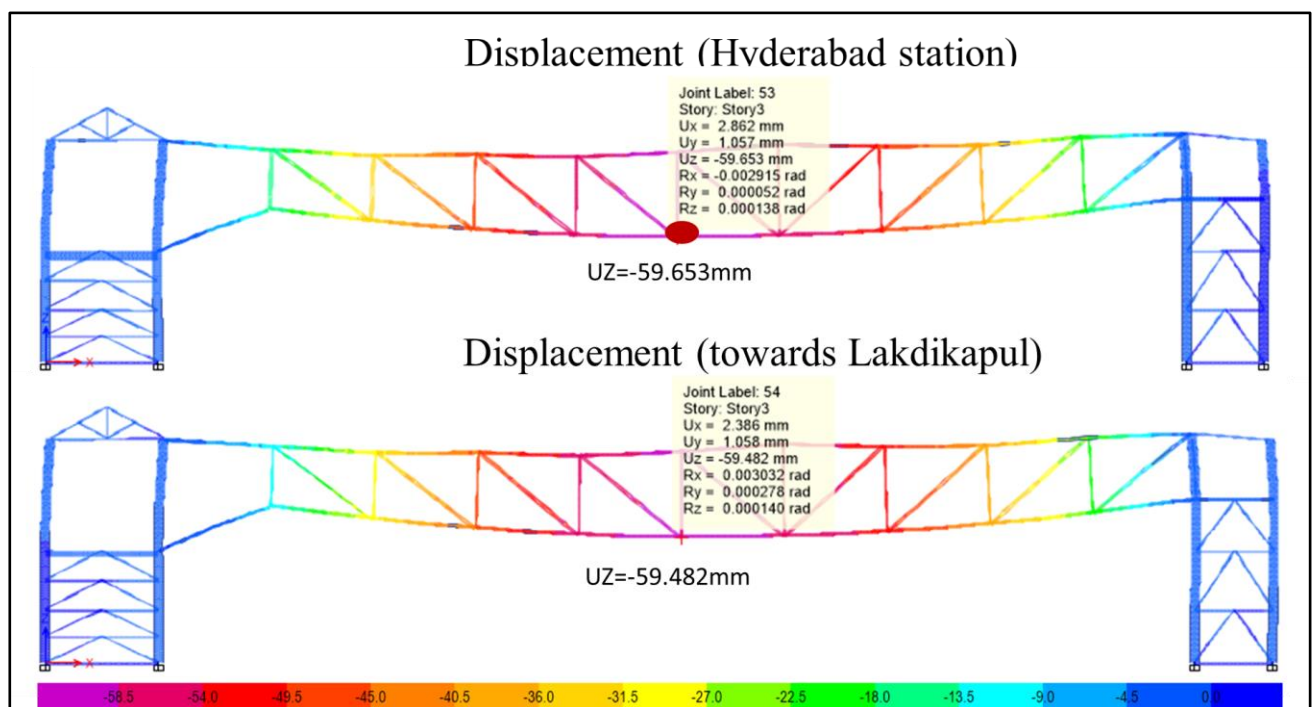


Fig: 1.15 Displacements in truss


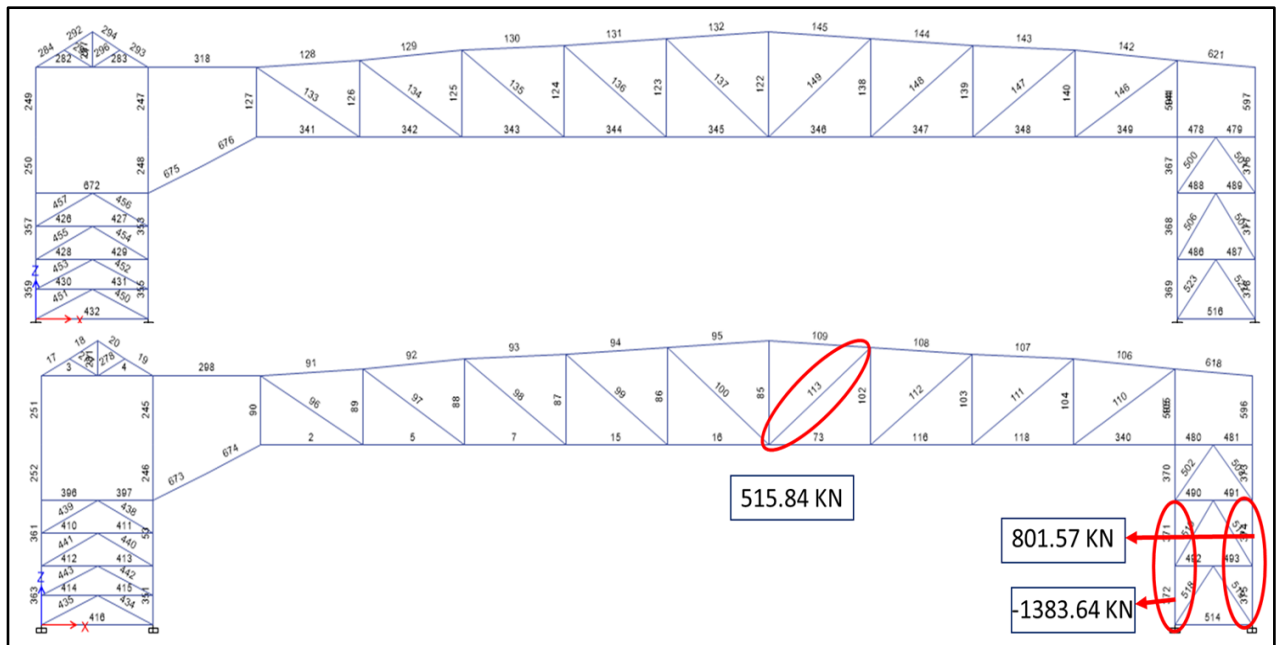


Fig:1.16 Highlighted members having maximum axial forces
(Members shown are with their respective element numbers)

2. Vibration analysis

2.1 Interpretation of vibratio analysis

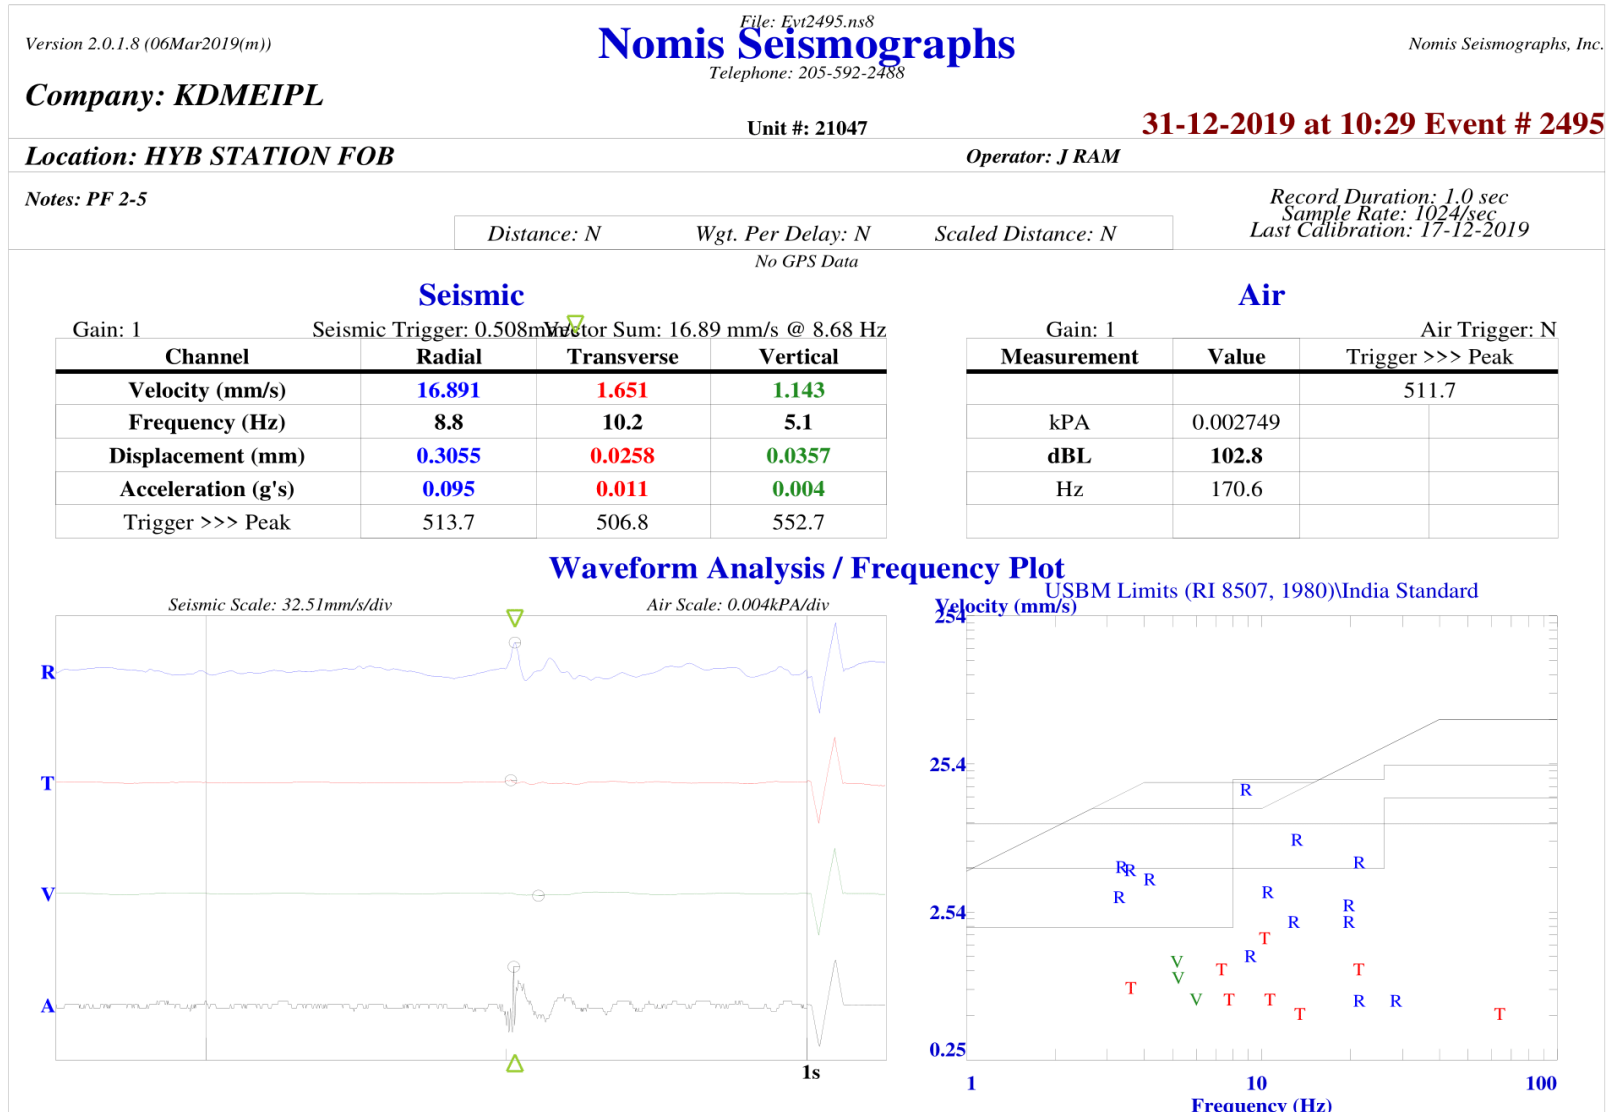

The permissible amplitudes of vibration are generally specified during analysis and design of the structure. Below fig. suggested by Richart may be adopted during design or operation of the structure

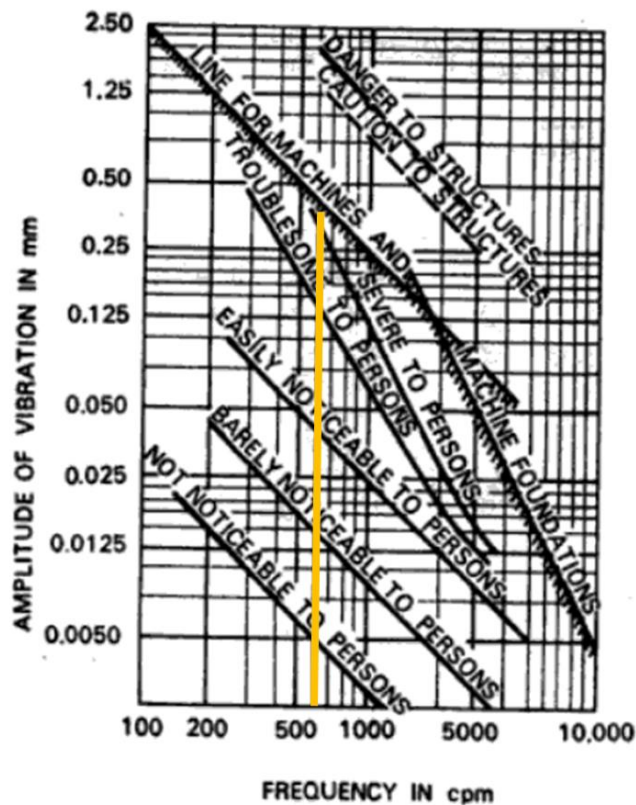


Fig. 1.4: Allowable Limits for Vertical Vibration Amplitudes (After Richart, F. E., Jr. *et al.*, *Vibration of Soils and Foundations*, Prentice-Hall Inc., New Jersey, USA, 1970; with permission).

Based on the vibration analysis carried out the structure is undergoing more vibrations than permissible. (Frequency observed is 540 cpm and maximum amplitude observed during the test time of complete 3hrs is 0.305 mm)

3. Repair and Retrofitting Recommendations

3.1 Repairs/Maintenance

a. Cleaning

- **Methodology for cleaning:** Generally foreign material are deposited or accumulated on bridge deck and in several bridge components which can deteriorate the bridge if proper action is not taken, so we support cleaning.
- **Debris removal:** The surface areas of a FOB should be cleaned and washed by brushing with fresh water or using high-pressure water blasting, including Deck slab top, sides along steel concrete joint on either side of deck, Supporting Railing and connecting staircase.
- **Vegetation removal:** Vegetation growth shall be removed from the components of the FOB, and near the FOB. *(Photographs of the same can be see in **fig3.10:**)*

b. Patchwork (spalling, honey comb, voids)

Reinforced cement concrete Slab at Deck level and some precast panels in staircase are observed with exposed rebar in many locations. *(Photographs of the same can be see in **fig:32.3.3**)*

Methodology for patching: Hand applied Mortar (Patching) repair is performed to restore small areas where sound concrete is damaged by spalling, scaling and/or impact. This method of repair is generally applied using trowel and require minimum or formworks. The patch thickness is limited to a maximum of 100 mm depth of hollow surface. Hand applied Mortar repair is classified into two types considering defective area and surface. Hand applied Mortar

- a) **Type - A** is applicable to surfaces without exposed rebar is having defective widths of up to 300mm and depths of up to 50 mm.
- b) **Type - B** is for surfaces with exposed rebar, with defective widths between 300 mm and 600 mm, and up to 100 mm depths.

Hand applied Mortar repairs may be composed of Polymer cement mortars or non-shrinkage cement mortars depending on the type of patching, location and extent of damage. To keep good bond ability to the existing concrete.

c. Corrosion:

Based on Steel Surface area effected by corrosion on steel member are classified into three grades as follows

- i. **Grade 1-** Mild Corrosion: 10 – 20 % of Surface area is affected with and peeled-off coating film is partially visible.
- ii. **Grade 2-** Moderate Corrosion: 20 – 30 % of Surface area is affected with corrosion and coating film is almost visible but partially deteriorated due to corrosion.

- iii. **Grade 3-** Severe Corrosion: 30% and more of Surface, area is affected by Corrosion and coating film is almost gone.

Methodology for Corrosion:

- If the paint condition is identified as Grade-1, aluminum paint shall be applied with a similar shade.
- Where condition of paint is evaluated as Grade-2 special anticorrosion paint shall be applied to restrict corrosion from progressing further.
- When the condition of the member is observed to be in Grade – 3, which might have occurred due to environmental conditions or age of the structure. In such cases section loss is calculated by using caliper where it is accessible and UPV at one accessible location. The first step in dealing with corrosion is to measure the section loss in the member. The member may be measured using calipers or other appropriate methods for totally exposed sections.
 - a. Section Loss < 15% - Clean the Surface and Apply the anticorrosion protective coat.
 - b. Section Loss 15% - 40% Repair the member as per design.
 - c. Section Loss > 40% - Replace the member

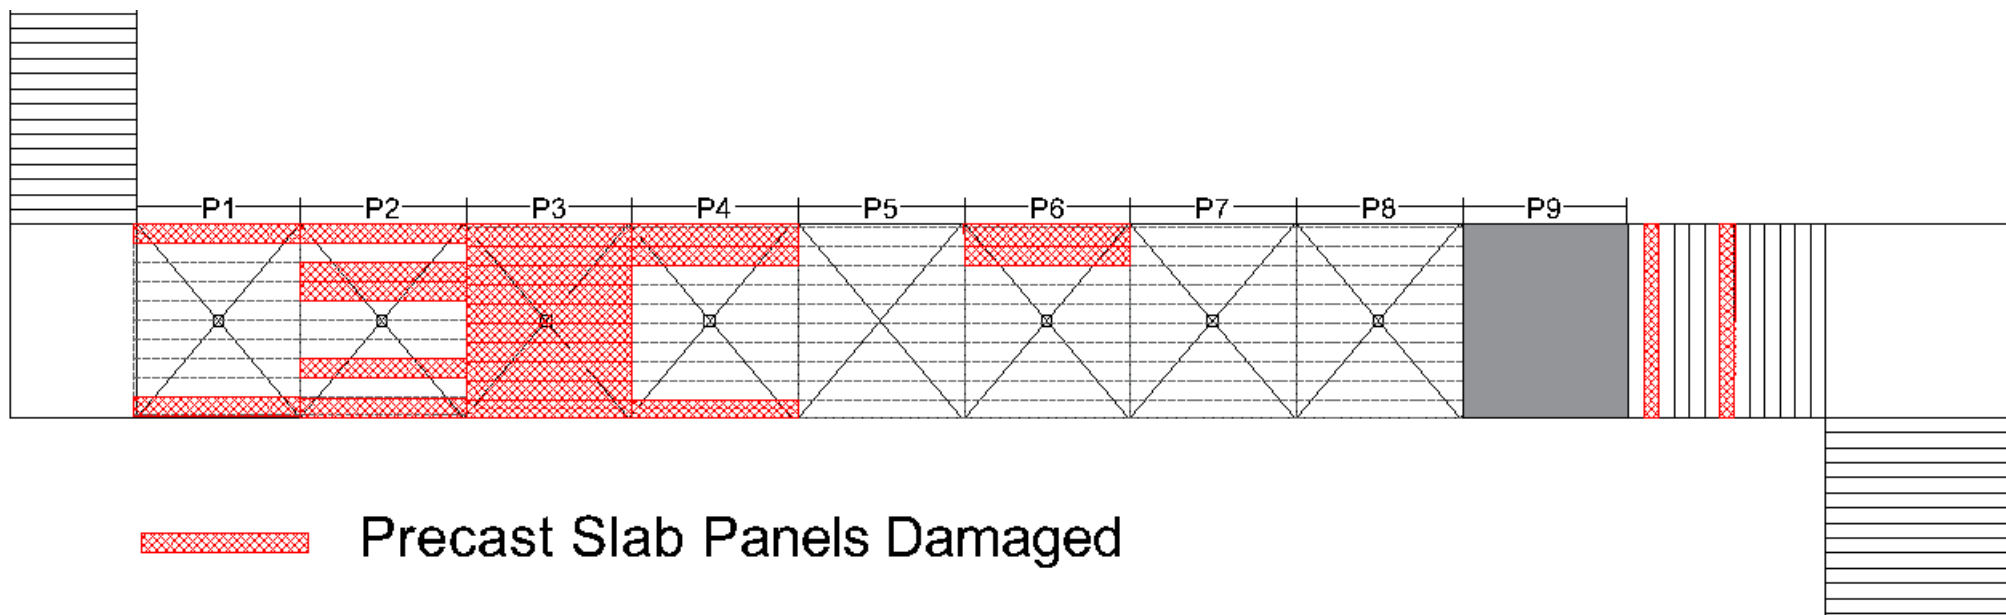


Fig 3.1: Bottom view of FOB with pre-cast panels damaged locations

Span recommendations

- FOB pre-cast slab panels on the above said locations and the following observations are made, excessive spalling, rebar corrosion and cracks in pre-cast slab panels majority of the cracks were noticed at the steel concrete joints. Cracks and reinforcement exposure is observed in almost in all pre-cast slab panels of FOB as shown in below figures. All the pre-cast slab are to be replaced with new pre-cast slab panels. (Locations are marked in figures below).
- Algae formation and vegetation is observed along steel concrete joint on outer surface at deck level. Staircase 2 precast slab panels are deteriorated reinforced is exposed in flights and staircase RCC landing slab at deck level. (Photographs of the same can be see in **fig 3.2-3.10**)

Table 2.1: Grading of corrosion in span 1

Span 1	Mild Corrosion	Moderate Corrosion	Sever Corrosion	Remark
Floor Beams/ Cross Girders		✓		
Bottom Chord		✓		
Top Chord	✓			
Bottom Lateral Bracings				
Diagonals	✓		✓	
Vertical	✓			
Gusset Plates			✓	
Bolts			✓	



Fig 3.2: Damage locations identified in “P1”

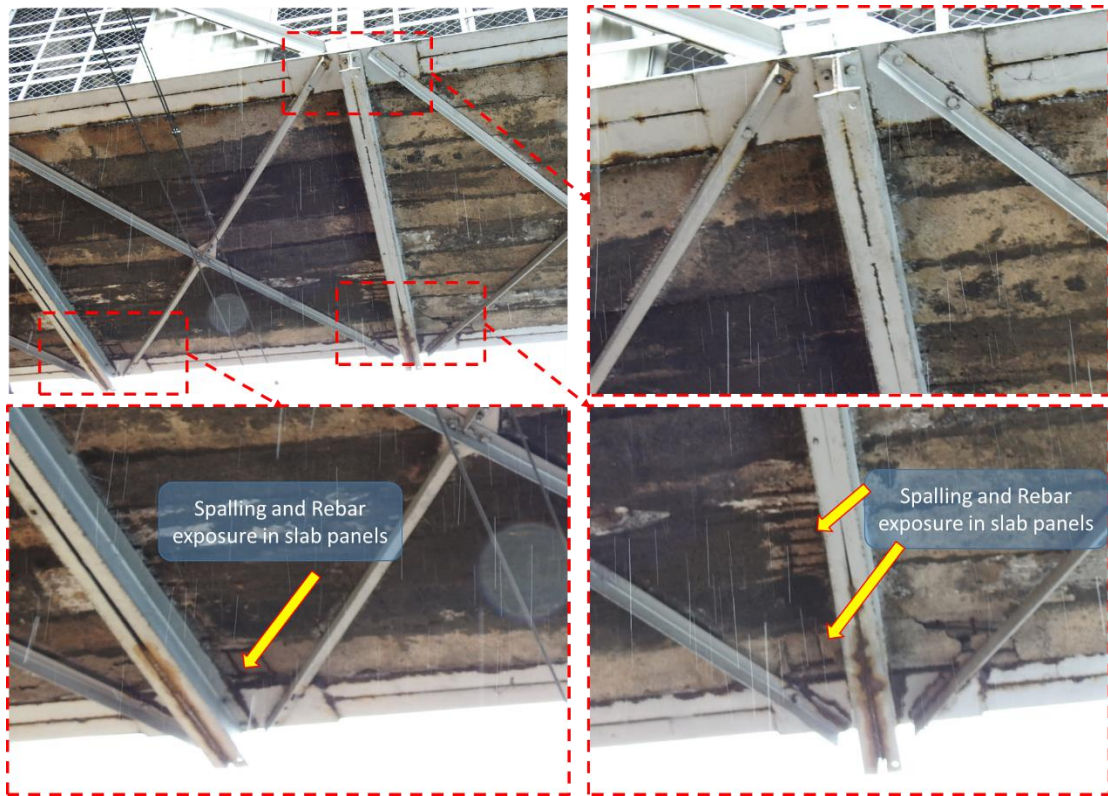


Fig 3.3: Damage locations identified in “P2”



Fig 3.4: Damage locations identified in “P3”



Fig 3.5: Damage locations identified in “P4”



Fig 3.6: pre-cast panels protected with cement mortar from bottom “P9”



Fig 3.7: Rebar exposure under staircase

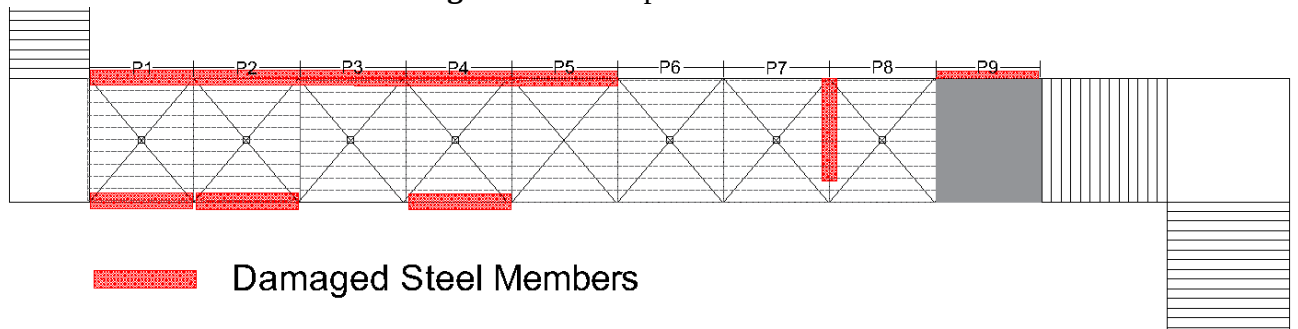


Fig 3.8: Bottom view of FOB with bottom chord member and floor beam damaged locations

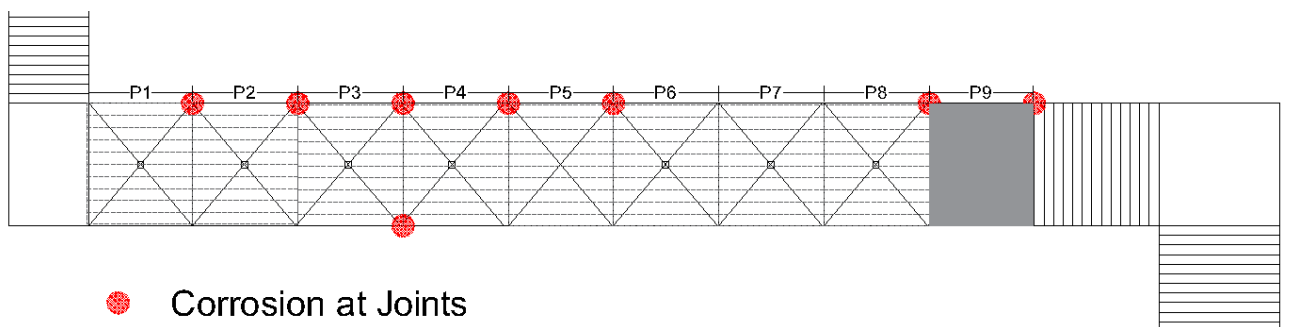


Fig 3.9: Bottom view of FOB with bottom chord member, floor beam and bracing connection damaged locations

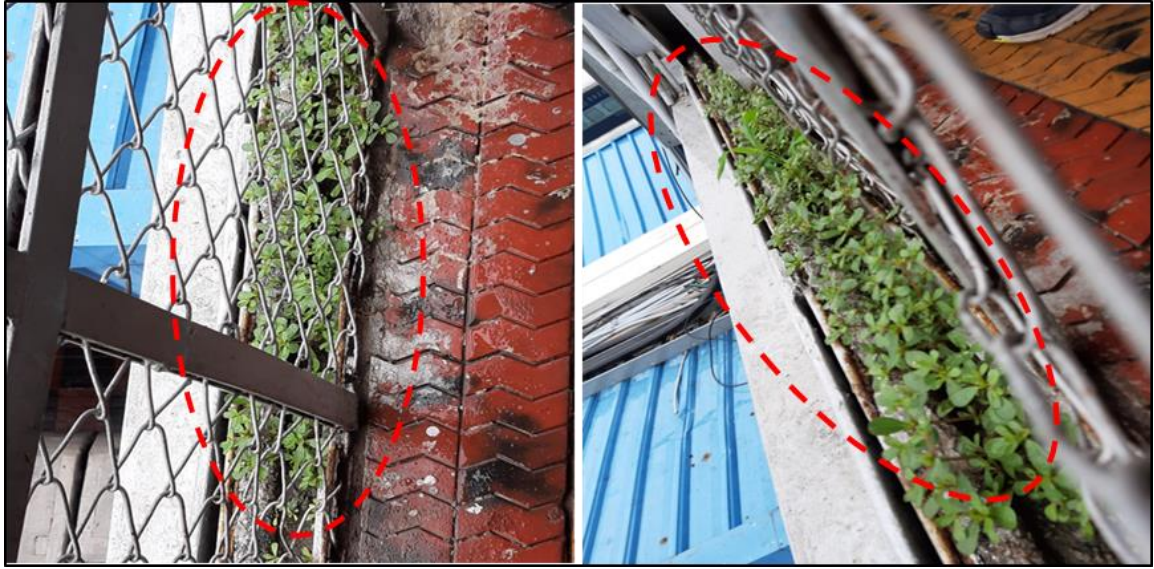


Fig 3.10: Vegetation and debris accumulated on top of bridge

ANNEXURE

Annexure-1a: Repair methods

Defects/Deficiency	Debris accumulation
Remedial Measures	Cleaning

During the Bridge service life, several components of bridges get unclean due to deposition of foreign materials. Materials that collect on the deck surface flow with the rain water towards the drainage spouts which may choke the outlets and affect drainage. Also the materials that collect on the deck and carried by the rain water towards edges of the gangway and accumulate in the gaps or on the steel members. Such debris accumulation can cause acceleration of the corrosion in metal since debris tend to hold water. Also growth of vegetation such as grass, shrubs and other plants on the components of bridges is very common. But, they should be thoroughly cleaned of accumulated dust, debris and other foreign materials at regular intervals. This is to prevent deterioration of the bridge, which will therefore preserve the bridge components in their intended conditions resulting in increased service life of the bridge as well as provide safety and comfort to the users.

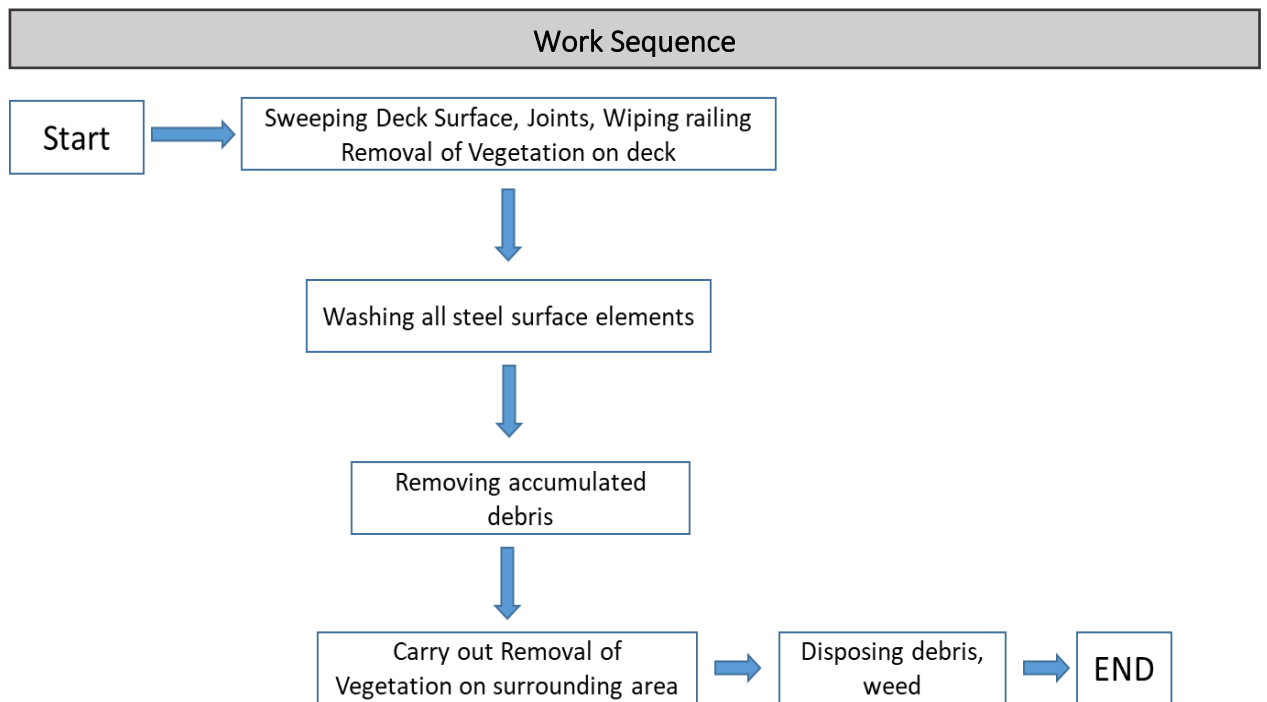


Figure:1.1 Work sequence of removal of vegetation and accumulated debris

1. Material Requirement

Requirement and Specification

Water to be used for cleaning of the bridge components shall be clean and free from unwanted foreign materials such as sediments, salt contaminants, chemicals, grease, oil, rubbish and other substances which are harmful to the bridge components.

All necessary tests shall be performed on water samples at laboratories to be specified by the Engineer, and test certificates shall be provided as required.

2. Work Requirement

1) General

All accumulated foreign materials shall be removed from gangway, its sides and check at beam flanges, gusset plates, truss joints, deck drain systems, and other locations specified and as directed by the Engineer, prior to cleaning with water pressure. Removal shall be performed using hand brooms, hand shovels, scrapers, vacuum cleaners or other methods acceptable to the Engineer. The removed materials shall be collected and disposed at an approved waste area in accordance with railway regulations. At no time shall these materials be allowed to be disposed within the vicinity of the bridge or on the tracks.

2) High pressure water

Salt contaminants, dirt, and other detrimental foreign matters shall be removed without damaging or peeling the paint from any structural steel. If high-pressure water is used, the maximum water pressure shall not be so high that any paint is damaged. The cleaning operation shall be discontinued if the foreign materials have not been easily removed or if cleaning operation is causing damage to existing paint coating. In this situation, the high-pressure water shall be adjusted to clean the surface without damaging the paint coating.

All deck drains or gangways and its accessories shall be flushed with high-pressure water after the accumulated foreign material has been properly removed. Drain systems may have to be disassembled to remove large blockages of accumulated foreign material. Should this be necessary, these shall be returned to their original configuration immediately after cleaning. Drainage systems shall drain properly after cleaning.

The Contractor shall flush out the interior surfaces of all truss members using high-pressure water. This flushing shall continue until such time that clear water is being draining out. The exterior surfaces of all truss members, miscellaneous structural steel connecting the truss members, and floor beam-ends projecting outwardly from the row of exterior stringers shall be thoroughly washed down using high-pressure water.

The Contractor shall obtain approval of the source of water used. They shall use fresh water, which is free of sediments and salt contaminants, and be responsible for all expenses involved in securing the approved water.

3) Power block

During this activity power block is mandatory and has to be carried in the presence of BRI.

Annexure-1b: Repair methods

Defects/Deficiency	Spalling, Honey comb
Remedial Measures	Patching

Spalling of concrete requiring patching, which is usually caused by corrosion of steel reinforcement. Honeycomb is the effect of inadequate compaction of concrete while being cast. Patching is a temporary repair measure unless all the chloride-contaminated concrete is removed before the concrete deck or stair case is patched. If only the spalled and delaminated concrete is removed, the corrosion process continues and additional spalling can soon appear.

Studies of deck-sealing practice suggest that while sealing or overlaying of chloride contaminated concrete cannot stop the process of corrosion and deterioration of steel and concrete, it can slow the process, which may be acceptable depending upon the schedule of future major rehabilitation. Further, moving passengers increases the impact loading, which can result in increased damage.

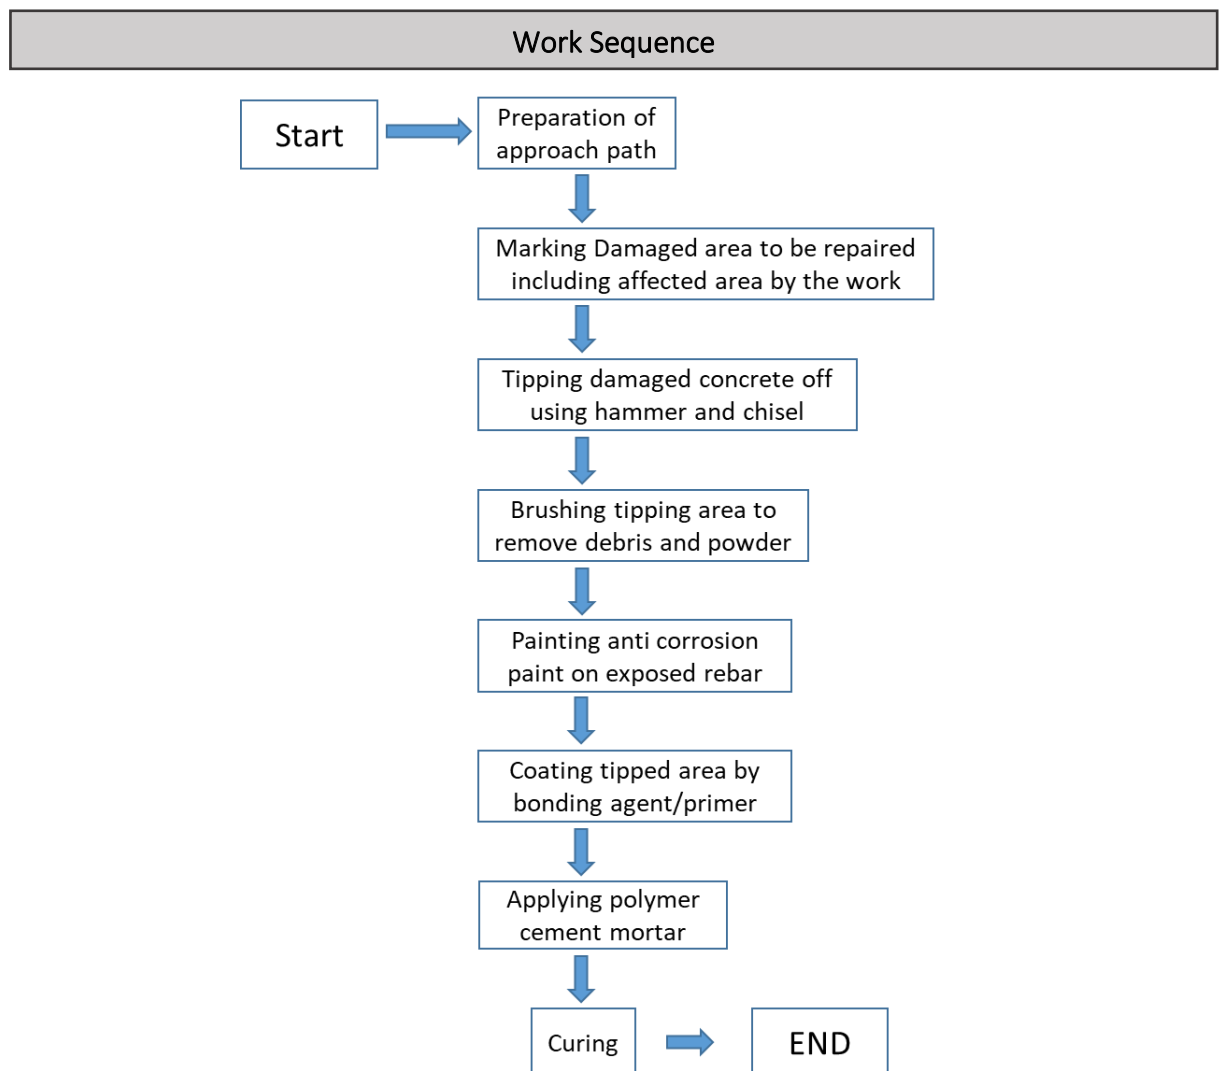


Figure: 1.2 Work sequence of Epoxy Coating

Required equipment / Tool and material

Material List –

- Polymer Cement Mortar
- Portland Cement
- Epoxy Bonding
- Zinc rich primer

Tool/Equipment List –

- Chisel
- Portable Generator
- Wire Brush

Requirement and Specification

Material Specifications

1) Polymer Cement

Polymer cement mortar shall conform to the requirements of the specifications shown in Table 1.1 or equivalent ASTM Specifications.

Table:1.1 Specification of Polymer Cement for Patching

Property	Test Method	Specification
Initial setting time	-	above 60 minutes
Shrinkage	ASTM D2566	below 0.05 %
Thermal expansion	ASTM C531	2.0×10^{-5} mm/mm/ ° C
Slant shear bond to concrete	ASTM C882	Concrete failure above 15 N/mm ²
Compressive strength	ASTM D695M	above 20 N/mm ²

2) Epoxy bonding agent

The epoxy-bonding agent to concrete surface shall conform to the requirements of the specification indicated in Table 1.2 (Anti-corrosion zinc rich primer shall be applied to exposed rebar).

Table 1.2 Specification of Epoxy Bonding Agent to Concrete Surface

Property	Test Method	Specification
Compressive strength	ASTM D695M	70 N/mm ²
Flexural strength	ASTM D790M	40 N/mm ²
Tensile strength	ASTM D638M	30 N/mm ²
Tensile shear bond to steel	ASTM 1002	15 N/mm ²
Slant shear bond to mortar	ASTM C882	15 N/mm ²
Bond Strength of Cured Concrete to Fresh Concrete	ASTM D7274	15 N/mm ²

- 3) **Zinc Rich Primer:** The zinc rich primer to rebar shall be in accordance with the requirements of the specifications in Table 1.3

Table 1.3 Specification of Zinc Rich Primer for Rebar

Property	Test Method	Units	Specification
Gloss @ 60°Angle	ASTM D 523	-	Flat
Adhesion	ASTM D 3359	-	Minimum 3A
Salt Spray Resistance	ASTM D3-37	-	Excellent
%Zinc by Weight in Dried Film Test		%	87.5±2

Work requirement

1) **General**

Patching repair works using Portland cement mortar shall be carried out in accordance with provisions of relevant standards and manufacturer's specifications. Patching, as a minor repair work, should be carried out using an appropriate means to access the repair area, before the defect worsens. Patching repair work method using polymer cement mortar shall be carried out as follows:

2) **Marking of patching area**

Evaluate surface area to be patched using hammer for hollow sounding delaminated area (or by using instruments to detect unsound concrete). Mark the area to be patch-repaired with paint or marker. Ensure complete coverage of the damage.

3) **Tipping damaged concrete off**

Using a small sledge hammer and chisel, remove all damaged concrete at the edges and corners of area to be repaired. Use a wire brush to remove loose debris. Care should be taken to ensure that no reinforcement is damaged. **Surface** shall be cut to expose the reinforcement and to reach the sound concrete substrate, without breaking the concrete behind the reinforcement. If rebar is exposed, anticorrosion agent coating should be applied on the bar surface prior to patching. All works shall be subjected to the approval of the designated Engineer. **Patch areas** that are within 600 mm of each other should be combined into a single large patch. If necessary, provide formwork around the damaged concrete to straighten the edges of the damaged section.

4) **Coating tipping area**

Concrete surfaces to receive repair mortar shall be prepared by mechanical scrubbing to remove loose materials, surface laitance, organic contaminants and moss. The clean and dust free surface shall then be coated by a bonding primer. Care shall be taken to ensure that vibration associated with the repair works does not cause delamination of existing adjacent plaster or concrete.

5) **Applying bonding agent and anti-corrosion paint**

Apply bonding agent to the damaged area in order for the patch material to adhere. Additionally, concrete nails/bids may be set to reinforce the repair. If rebar is

exposed, anticorrosion coating should be applied on the bar surface prior to patching.

6) **Patching mortar**

Prepare the mortar mix in a bucket using equipment approved by the Engineer. Use a trowel to spread fresh mortar over the area, covering the concrete nails driven halfway in the old concrete. Smoothen and level the mortar with a trowel. Polymer cement mortar is suitable for both vertical and horizontal surface applications, with a thin coating of up to 15 mm.

7) **Finishing**

As may be required, the mortar surface can be smoothened using a trowel or broom finished. The texture of the finish of the final repair mortar layer shall match the finish of the existing surface. The repair mortar application shall be built up to the original surface profile in layers not exceeding 20 mm with the final layer not exceeding 15 mm, unless otherwise recommended by the manufacturer and approved by the Engineer. The Engineer may approve repair mortar application thickness of up to 50 mm for lightweight mortars, provided the mortar manufacturer furnishes technical data to justify a layer thickness of greater than 20 mm.

8) **Curing**

All types of concrete repair with repair mortar need thorough and continuous curing to develop strength and impermeability. Curing also minimizes drying shrinkage while bond strength is developing. Curing of the repair mortar shall be in accordance with the manufacturer's instructions related to the polymer modified additive. Where curing agents are specified by the manufacturer, they shall be applied immediately after the surfaces have been scarified for the next repair mortar layer, or troweled to a finish.

Annexure-1c: Repair methods

Defects/Deficiency	Minor corrosion of steel element
Remedial Measures	Touchup painting

Due to thin paint coverage on steel surfaces or formation of pin-holes in paint, the steel surface may get exposed to atmosphere resulting in initiation of corrosion. Touch up painting at the early stages prevents progress of corrosion. Work included in this section comprises field touchup painting on steel members at localized areas including surface preparation and other associated works. This section covers only painting on relatively small affected areas which can be carried out with the use of small power tools / hand tools. Painting of larger areas requiring sand blast cleaning should be carried out in accordance with the specifications covered under major repairs.

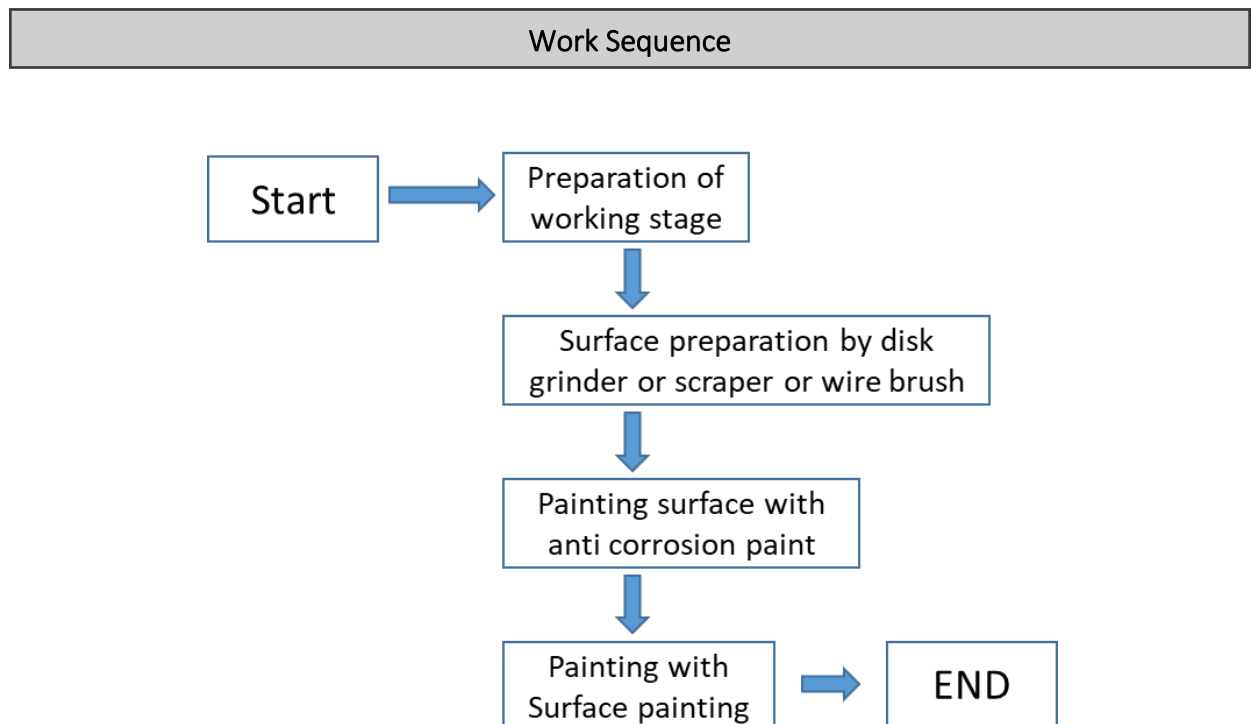


Figure: 1.2 Work sequence of Painting with anti-corrosion paint

Required Equipment / Tool and Material

i. Materials

- Aluminum paint / special anticorrosion paint as required
- Thinner
- Epoxy resin filler

ii. Tools/Equipment

- Scaffolding, inspection vehicle
- Portable generator (3 kVA)
- High pressure water blaster (8.0Mpa, 10.0 liters/min.)
- Sandpaper, portable power disk grinder
- Paint brush, roller

Requirement and Specifications

i. Material

Aluminum paint material shall be in accordance with the manufacturer's specifications and as approved by the Engineer.

For special anticorrosion paint, the materials shall satisfy the test requirements indicated in the relevant ASTM specifications as follows:

Table 1.4 Specification of Aluminum paint

Test	Test reference	Specification
Adhesive test	ASTM D7234	7days 1.0 N/mm ² , 28days 1.5 N/mm ²
Elongation	ASTM C190	7days 0.40 % , 28days 0.40 %
Saltwater test	ASTM D6943	No defection

ii. Work requirement

1) Scaffolding

Scaffolding shall be installed for close access to the corrosion-affected surfaces of the steel members to be repaired. Standard scaffoldings may be used however mobile scaffolding/inspection vehicle may be found suitable as it allows for free movement in most cases and provides access with convenience to various parts of a bridge.

2) Preparation of Steel Surface

Surface preparation shall conform to the paint manufacturer's specifications. Hand or power tools shall be applied for cleaning the surface. Groves and ridges formed on the affected surface shall be removed with power grinder. Where appropriate, as an alternative, epoxy resin filler may be used to fill the surface to a smooth and even finish. Where depth of roughness is within 0.5 mm, paint adequacy and durability can be achieved without application of multiple coats of surface leveling paints. Thickness of each coat shall not exceed the limiting value recommended in the paint

manufacturer's specifications. Application of aluminum paint material shall be in accordance with the manufacturer's specifications and as approved by the Engineer.

3) Application of Touchup Paint

Paint shall be applied with brush or roller. The paint shall be applied in such a way that a uniform and smooth surface is formed without wrinkles, runs, streaks, sags, or any other defects. Components of the paint shall be mixed in accordance with the manufacturer's instructions and the application shall also conform to such instructions and specifications. Paint shall be applied immediately after the surface preparation, preferably within 4 hours. Total dry film thickness for special anticorrosive paint shall be 500 μm (equivalent 1.5kg/m²) consisting of two layers of coating as follows: -

Layer-1: 250 μm and Layer-2: 250 μm

Anticorrosion paint shall be applied in accordance with the stipulations of paint manufacturer's specifications. Minimum total film thickness for aluminum paint shall be not less than 125 μm . Roval paint is recommended for galvanized member touchup painting. Total dry film thickness for Roval paint shall be 80 μm (equivalent 0.5kg/m²) consisting of two layers of coating as follows: -

Layer-1: 40 μm and Layer-2: 40 μm

Roval paint shall be applied in accordance with the stipulations of paint manufacturer's specifications.

Annexure-1d: Repair methods

Defects/Deficiency	Spalling, Abnormal Anchorage
Remedial Measures	Hand applied Mortar (A) & (B)

Hand applied Mortar (Patching) repair is performed to restore small areas where sound concrete is damaged by spalling, scaling and/or impact. This method of repair is generally applied using trowel and require minimum or formworks. The patch thickness is limited to a maximum of 100 mm depth of hollow surface.

Hand applied Mortar repair is classified into two types considering defective area and surface. Hand applied Mortar (A) is for defects without exposed rebars while Hand applied Mortar (B) is applied to surfaces with exposed rebars. Hand applied Mortar repairs may be composed of Polymer cement mortars or non-shrinkage cement mortars depending on the type of patching, location and extent of damage.

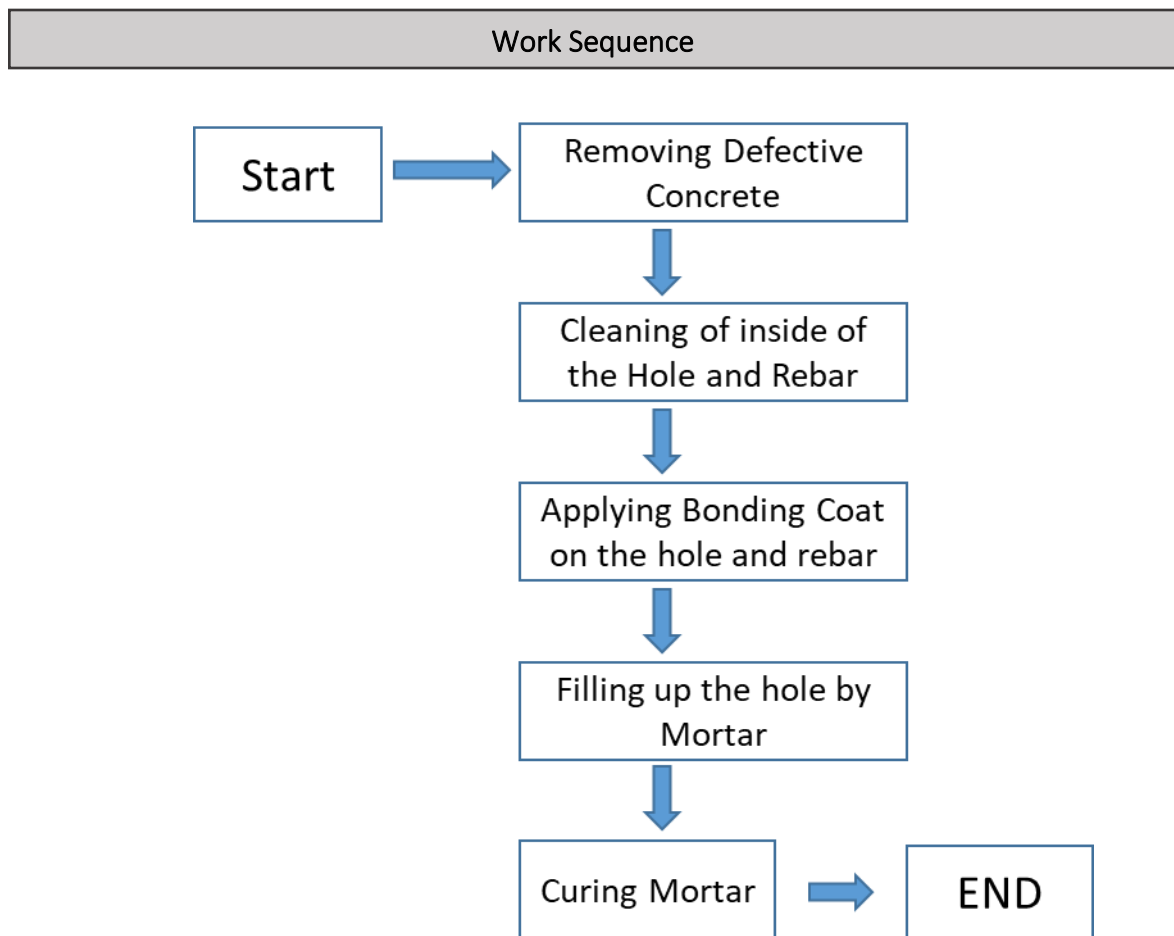


Figure: 1.3 Work sequence of Hand applied mortar

Required tools / Equipment and Material

1) Tools/Equipment

For Hand applied Mortar (A) and Hand applied Mortar (B): -

- Power Disc Grinder
- Portable Generator
- Brush

2) Material

Hand applied Mortar (A): -

- Polymer Cement
- Epoxy Bonding Coat

Hand applied Mortar (B) –

- Polymer Cement
- Epoxy Bonding Coat
- Zinc Rich Primer

Requirements and Specifications

i. Material

1) Polymer Cement

Polymer cement mortar shall conform to the requirements of the specifications shown in Table 1.5 or equivalent ASTM Specifications.

Table 1.5 Specifications of Polymer Cement

Property	Test Method	Units	Specification
Thermal Expansion	ASTM C531	mm/mm°C	2.0×10^{-5}
Slant Shear Bond to Concrete	ASTM C882	N/mm ²	1.5 /above
Compressive Strength (7days x 20)°C	ASTM C579	N/mm ²	20 /above

2) Corrosion Protective Coating

The Protective Coating of rebar shall conform with the requirements of the specifications in Table 1.6.

Table 1.6 Specifications of Corrosion Protective Coating to Rebar

Property	Test Method	Units	Specification
Compressive Strength	ASTM D695M	N/mm ²	75
Flexural Strength	ASTM D790M	N/mm ²	40
Tensile Strength	ASTM D638M	N/mm ²	30
Tensile Shear Bond to Steel	ASTM D1002	N/mm ²	10
Slant Shear Bond to Mortar	ASTM C882	N/mm ²	15

3) Zinc Rich Primer

The zinc rich primer to rebar shall be in accordance with the requirements of the specifications in Table 1.7.

Table 1.7 Specifications of Zinc Rich Primer to Rebar

Property	Test Method	Units	Specification
Gloss @ 60 Angle	ASTM D 523	-	Flat
Adhesion	ASTM D 3359	-	Minimum 3A
Salt Spray Resistance	ASTM D3-37	-	Excellent
%Zinc by Weight in Dried Film Test	-	%	87.5 ±2

ii. Work requirement

The Contractor shall submit the Methodology (Procedures) to the Engineer-in-Charge for his review and approval before commencement of the work.

1) Remove of defective concrete

Remove all defective, unsound and contaminated concrete and prepare the edges for the patch area based on the visual inspection. If local corrosion in reinforcement with section loss is found, which would require additional bars, remove only the damaged concrete including the length needed to bond the new reinforcement.

Concrete within marked out areas shall be removed using light mechanical breakers or hammer and chisel, the exposed reinforcement shall be cut and the sound of concrete substrate shall be determined to the satisfaction of the Engineer-in-Charge, without breaking out behind the reinforcement.

2) Cleaning of Concrete and Rebar

Remove loose particles and dust using high pressure water or vacuum cleaner. Concrete surfaces to be bonded must be free from dirt, oil, grease, asphalt etc. Corrosion must be removed before placing the new concrete. If deterioration is due to chloride contamination or if the reinforcement is covered with loose corrosion elements having pits, use water abrasive blasting until all the rust is removed

The concrete surfaces selected for repair shall be prepared by mechanical scrubbing to remove loose materials, surface laitance, organic contaminants and moss, and then coated by bonding primer. Utmost care shall be taken to ensure that vibration generated during the process does not cause delamination of adjacent render or concrete.

3) Additional concrete breakout

Where the breakout indicates that the exposed reinforcement is further corroded or the surrounding concrete is not sound, an enlarged area shall be agreed to be broken to the satisfaction of the Engineer-in-Charge. The Contractor shall test the concrete for extent of carbonation at the reinforcement depth. The depth of breakout in clearly defined areas can be increased based on written instructions from the Engineer-in-Charge, in order to remove all carbonated concrete. The additional concrete breakout shall not extend more than 20 mm behind the bottom layer main reinforcement. During breakout, utmost care shall be undertaken to minimize damage to the existing reinforcement.

4) Additional or replacement rebar

The Contractor shall report to the Engineer any rebar which has 10% or more section loss as a result of corrosion. Additional or replacement rebar shall be provided as instructed by the Engineer. Replacement rebar shall be cleaned to the same standard as the existing rebar. This replacement rebar shall be lapped on the side of the existing bars and be spot welded on one side. It shall be fixed along its length at suitable intervals to prevent sagging. The corroded rebars shall be cleaned and applied with zinc rich primer to prevent further corrosion. The Contractor shall obtain Engineer's approval for the rebar coating prior to proceeding with repair mortar application.

5) Bonding coating to concrete and rebar

Epoxy bonding coats are applied to dry and clean concrete surfaces in order to bond firmly. Specially formulated resins are also available for damp surfaces. Apply the selected bonding coat to steel bars as shown in the photo; with a brush working vigorously to ensure that they are evenly covered all around.

6) Filling up repair material

The mortar should be placed in layers of about 20 mm thickness. Compact each layer thoroughly over the entire surface using a wooden trowel or hammer. Generally, there should be no time delays between the placing and compacting of layers. The patching to the surrounding concrete is performed using a form material, and then hammered using a mallet, wood float or steel trowel. The mortar shall be mixed using equipment (normally a force action mixer) approved by the Engineer. The mixing liquid shall be added to the dry components and thoroughly mixed to achieve a uniform consistency, unless otherwise approved by the Engineer. The mortar shall then be applied to the bonding agent using hand packing and trowel to the satisfaction of the Engineer-in-Charge. The textured finish of the final repair mortar layer shall match the finish on the existing interior surface. The repair mortar application shall be built up to the original surface profile in layers not exceeding 20 mm and the final layer shall not exceed 15 mm, unless otherwise recommended by the manufacturer and approved by the Engineer-in-Charge. The Engineer may approve repair mortar application thickness of up to 50 mm for lightweight mortars, provided the repair mortar manufacturer can furnish a technical data to justify a layer thickness of greater than 20 mm.

7) Curing

All types of cement repairs need thorough and continuous curing to develop strength and impermeability, and to minimize drying shrinkage while bond strength is developing. Curing of the repair mortar shall be in accordance with the polymer modified additive manufacturer's instructions. Where curing agents are specified by the manufacturer, they shall be applied immediately after the surfaces have been scarified for the next repair mortar layer or troweled to a finish.

Summary

- **Visual inspection of Nampally railway station fob has been conducted on 12th October 2019, following observations were made**
 - i. Major Corrosion is observed at steel concrete joint (bottom of slab)
 - ii. Spalling is observed with exposed reinforcement.
 - iii. Secondary girders joints have severely deteriorated.
 - iv. Vegetation is observed on Tie members
- **Based on visual inspections and its interpretations following recommendations were made:**
 - a) Cleaning of debris and vegetation immediately to avoid deterioration of concrete and steel members.
 - b) Anti-corrosion treatment for Grade-1 and Grade-2 highlighted corrosive members.
 - c) Replacement of damaged members or severely corroded members and joints
 - d) Patch work for exposed reinforcement in main landing at staircase 1 and staircase 2.

Note: Provided step wise procedure for each recommendation are detailed out in annexure based on requirements