

## Third Party Audit of ROB's and FOB's of SCR



### INSPECTION OF FOB AT RAGHAVAPURAM RAILWAY STATION

**Final Report**  
SEPTEMBER | 2020

# CONTENTS

|                                                        | Page no:  |
|--------------------------------------------------------|-----------|
| <b>1. Visual Inspection.....</b>                       | <b>3</b>  |
| 1.1 General Information and Observation                |           |
| 1.2 Identification of Additional load Loads on Bridge  |           |
| 1.3 Structural System of the Bridge                    |           |
| 1.4 Signs of Distress /Deformation in Bridges          |           |
| <b>2. Repair and Retrofitting Recommendations.....</b> | <b>12</b> |
| <b>3. Annexure.....</b>                                | <b>30</b> |
| <b>4. Summary.....</b>                                 | <b>44</b> |

## LIST OF FIGURES

| Fig No.          |                                                                     |    |
|------------------|---------------------------------------------------------------------|----|
| <b>Fig 1.1:</b>  | Cables, Flooring and Protective Screen                              | 8  |
| <b>Fig 1.2:</b>  | Trestles Details                                                    | 9  |
| <b>Fig 1.3:</b>  | Main Chord Members, Floor Beams, Vertical and Diagonal Bracings     | 9  |
| <b>Fig 1.4:</b>  | Bottom View Slab Panels                                             | 10 |
| <b>Fig 1.5:</b>  | Staircase Details                                                   | 10 |
| <b>Fig 1.6:</b>  | Accidental Damage Observed at Stanchions                            | 10 |
| <b>Fig 1.7:</b>  | Corrosion and vegetation                                            | 11 |
| <b>Fig 2.1:</b>  | Location of Deterioration in Span 1                                 | 14 |
| <b>Fig 2.2:</b>  | Location of Deterioration in Staircase-1 from Bottom                | 15 |
| <b>Fig 2.3:</b>  | Deterioration of Bottom Chord Vegetation at Deck Level              | 16 |
| <b>Fig 2.4:</b>  | Location of Deterioration in Staircase-2 from Bottom                | 16 |
| <b>Fig 2.5:</b>  | Location of Deterioration in Span-2                                 | 17 |
| <b>Fig 2.6:</b>  | Deterioration Location of Steel Member at Slab Deck Level in Span-2 | 18 |
| <b>Fig 2.7:</b>  | Some Locations of Missing Bolts and Nuts in Span-2                  | 19 |
| <b>Fig 2.8:</b>  | Location of Deterioration in Span-3                                 | 20 |
| <b>Fig 2.9:</b>  | Sever Corrosion of Floor Beams in Span-3                            | 21 |
| <b>Fig 2.10:</b> | Locations of Deterioration of Bolted Connection in Span-3           | 22 |
| <b>Fig 2.11:</b> | Locations of Deterioration in Span-4                                | 23 |
| <b>Fig 2.12:</b> | Locations of Corrosion and Vegetation in Span-4                     | 24 |
| <b>Fig 2.13:</b> | Locations of Deterioration in Span-5                                | 25 |
| <b>Fig 2.14:</b> | Vegetation Observed Near Bottom Chord Member                        | 26 |
| <b>Fig 2.15:</b> | Locations of Deterioration in Span-6                                | 27 |
| <b>Fig 2.16:</b> | Vegetation and Slight Corrosion at Floor Beam                       | 28 |
| <b>Fig 2.17:</b> | Deformed Column Due to Accidental Hitting                           | 29 |
| <b>Fig 2.18:</b> | Vegetation Is Observed on Pathway of Gangway                        | 29 |

## Annexure: Repair Methodologies

|                    |                                                     |    |
|--------------------|-----------------------------------------------------|----|
| <b>Annexure-1a</b> | Debris Accumulation: Cleaning                       | 31 |
| <b>Annexure-1b</b> | Spalling, Honey Comb: Patching                      | 33 |
| <b>Annexure-1c</b> | Minor Correction of Steel element: Touchup Painting | 37 |
| <b>Annexure-1d</b> | Spalling, Abnormal Anchorage: Hand Applied Mortar   | 40 |

## 1. Visual Inspection

|                              |          |                                                                                   |
|------------------------------|----------|-----------------------------------------------------------------------------------|
| <b>Name of the Project</b>   | <b>:</b> | VISUAL INSPECTION OF FOB/ PF-1 – CIRCULATING AREA AT RAGHAVAPURAM RAILWAY STATION |
| <b>Location</b>              | <b>:</b> | RAGHAVAPURAM RAILWAY STATION                                                      |
| <b>Location Co-ordinates</b> | <b>:</b> | 18°40'53.5"N 79°24'41.2"E                                                         |
| <b>Date of Inspection</b>    | <b>:</b> | 26 <sup>th</sup> OCTOBER, 2019                                                    |




### **Visual inspection Summary:**

- a) Corrosion is observed between the main chord member (Double angle section) and gusset plate joints connecting floor beam.
- b) Corrosion observed in floor beams and bottom main chord members at 3rd, 4th and 5th span of FOB.
- c) Vegetation is also observed along the span of FOB apart from moderate corrosion.
- d) Accidental damage of stanchions at the bottom.

| 1.1 GENERAL INFORMATION AND OBSERVATION |                                                     |                                                                                                                          |
|-----------------------------------------|-----------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------|
| a                                       | Name of the Bridge                                  | FOB/ PF-1 – circulating area                                                                                             |
| b                                       | Location<br>Location co-ordinates                   | Raghavapuram Railway Station<br>18°40'53.5"N 79°24'41.2"E                                                                |
| c                                       | Type of truss Structure                             | N – type truss                                                                                                           |
| d                                       | Year of Construction, Maintenance History           | -NA-                                                                                                                     |
| e                                       | Description of the main use of the bridge           | Pedestrians Crossing                                                                                                     |
| f                                       | Type of Materials used in different parts of bridge | Structural Steel, RCC Slab                                                                                               |
| g                                       | Width of the Pathway (m)                            | 2.35 m                                                                                                                   |
| h                                       | Length of the Pathway (m)                           | 78.4 m                                                                                                                   |
| i                                       | No of Railway Lines Crossings                       | <b>7 tracks</b><br>Span 1 = 1 tracks<br>Span 2 = 1 tracks<br>Span 3 = 2 tracks<br>Span 4 = 1 tracks<br>Span 5 = 2 tracks |
| j                                       | Span arrangement (no x Span in meters)              | 1x9.5 m + 1x7.75 m+ 1 x14.95 m + 1x10.39 m+1x19.3 m+1x4.97 m = <b>66.86 m (Clear span)</b>                               |
| k                                       | Vertical Clearance (from rail top to girder bottom) | 6.453 m                                                                                                                  |
| l                                       | Head Room                                           | Not available                                                                                                            |
| m                                       | Damages due to accidental hitting, Grazing Marks    | Yes (Damage due to accidental hitting)<br>(Refer <b>fig :6</b> )                                                         |
| n                                       | History of Repair (if any...)                       | No Patch work are observed                                                                                               |
| o                                       | Existing Structural Drawings                        | -NA-                                                                                                                     |

Key Plan

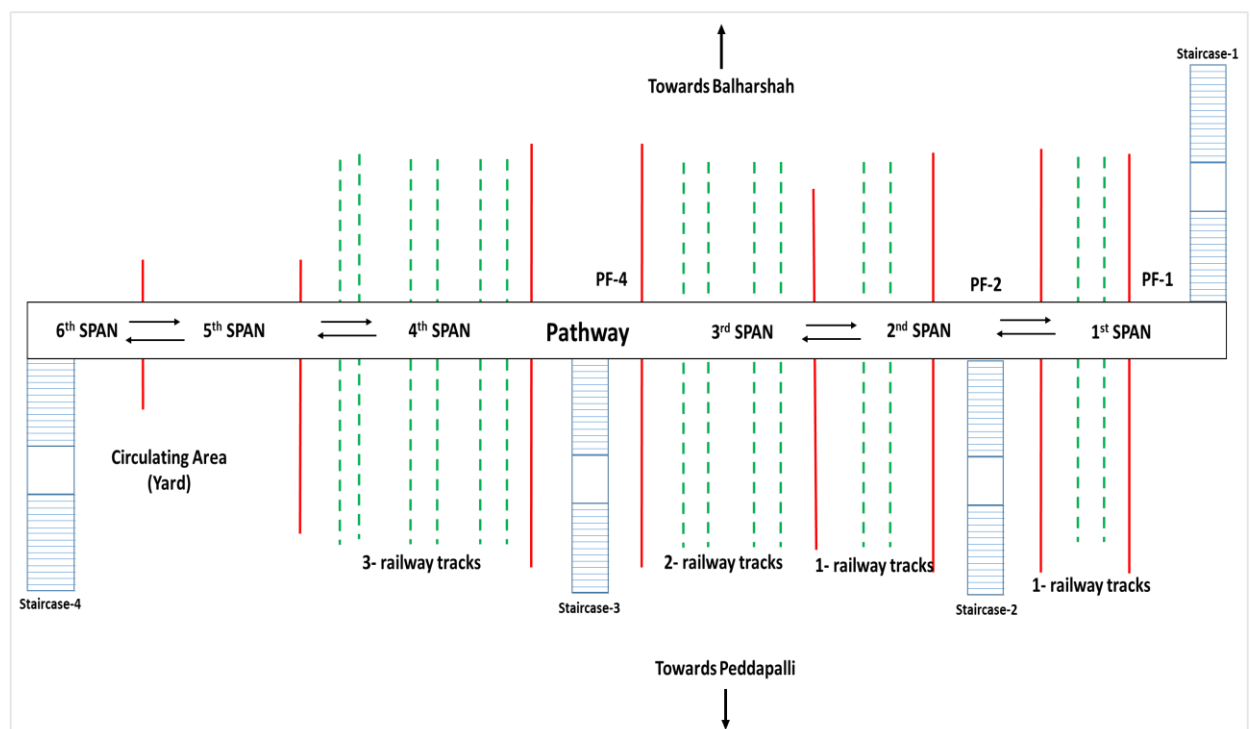

| 1. 2 IDENTIFICATION OF ADDITIONAL LOADS ON BRIDGE |                                                                   |                      |                                                                                                                                                                                                                              |
|---------------------------------------------------|-------------------------------------------------------------------|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                                                   |                                                                   | Yes/No               | Photo ID                                                                                                                                                                                                                     |
| <b>a</b>                                          | <b>Dead Loads at Roof level</b>                                   |                      |                                                                                                                                                                                                                              |
|                                                   | a) Pipeline – Utilities                                           | No                   | No pipelines are observed at roof level. Two GI pipes of 2-inch dia with cables running on the floor.<br><br>a. Cables are protected with 2-inch Gi pipe.<br>b. No advertising boards are provided. (Refer <b>fig :1.1</b> ) |
|                                                   | b) Cables                                                         | Yes                  |                                                                                                                                                                                                                              |
|                                                   | c) Roof Truss                                                     | No                   |                                                                                                                                                                                                                              |
|                                                   | d) Roof Sheet                                                     | No                   |                                                                                                                                                                                                                              |
|                                                   | e) load of advertising hoarding                                   | No                   |                                                                                                                                                                                                                              |
|                                                   | f) load of train/coach display boards                             | No                   | No train display boards are provided                                                                                                                                                                                         |
|                                                   | g) Additional load of overhead electrical equipment (OHE), Signal | No                   | No Additional load of overhead electrical equipment (OHE), Signal                                                                                                                                                            |
| <b>b</b>                                          | <b>Dead Loads at Floor level</b>                                  |                      |                                                                                                                                                                                                                              |
|                                                   | a) Additional wearing coat on Floor                               | No                   | Only Chequered tiles are used for flooring (Refer <b>fig :1.1</b> )                                                                                                                                                          |
|                                                   | b) Provision of protective screen for passengers                  | Yes                  | Chain link fence made of galvanized wire of 2 mm gauge and 2mm galvanized sheet is used above OHE line on both side of gangway is used for protection (Refer <b>fig :1.1</b> )                                               |
|                                                   | c) Type of Material used for mesh                                 | Galvanized wire mesh |                                                                                                                                                                                                                              |

| 1.3 STRUCTURAL SYSTEM OF THE BRIDGE |                                      |                                                                                              |                                                                                                                                                                                                                                                                                                                                                             |
|-------------------------------------|--------------------------------------|----------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                                     |                                      |                                                                                              | Photo ID                                                                                                                                                                                                                                                                                                                                                    |
| <b>a</b>                            | <b>Foundation details</b>            |                                                                                              | Not visible at site                                                                                                                                                                                                                                                                                                                                         |
| <b>b</b>                            | <b>Trestles</b>                      |                                                                                              |                                                                                                                                                                                                                                                                                                                                                             |
|                                     | Column – Trestles Connection Details |                                                                                              | Concrete encasement is observed below vertical supports. (Refer <b>fig :1.2</b> )                                                                                                                                                                                                                                                                           |
|                                     | No of Bolts and size                 | Not visible, filled with concrete                                                            |                                                                                                                                                                                                                                                                                                                                                             |
|                                     | Thickness of Base Plate              | Not visible, filled with concrete                                                            |                                                                                                                                                                                                                                                                                                                                                             |
| <b>c</b>                            | <b>Roof Truss</b>                    |                                                                                              |                                                                                                                                                                                                                                                                                                                                                             |
|                                     | Element of roof truss section        |                                                                                              | No roof truss available                                                                                                                                                                                                                                                                                                                                     |
|                                     | Size of roof truss                   |                                                                                              |                                                                                                                                                                                                                                                                                                                                                             |
|                                     | Connection of Roof elements          |                                                                                              |                                                                                                                                                                                                                                                                                                                                                             |
| <b>d</b>                            | <b>Steel Truss</b>                   |                                                                                              |                                                                                                                                                                                                                                                                                                                                                             |
|                                     | Type/Shape of Girder Section         | Double angle section                                                                         | a. Main top and bottom Chord members are ISA 75 x 75 x 8 mm Double angle section.<br>b. ISA 75 x 75 x 8 mm double angle section are used as vertical members and ISA 75 x 75 x 8 mm diagonal bracing members.<br>c. 12 mm thick gusset plate is used for welded joint.<br>d. ISA 100 x 100 x10 mm are used as Floor beams supported with ISA 75 x 75 x 8 mm |
|                                     | Height of Girder/ Truss (H)          | 1.63m                                                                                        |                                                                                                                                                                                                                                                                                                                                                             |
|                                     | Truss Support Condition              | Ridged connection                                                                            |                                                                                                                                                                                                                                                                                                                                                             |
|                                     | Type/Shape of Floor beams /Bracings  | Double angle section                                                                         |                                                                                                                                                                                                                                                                                                                                                             |
|                                     | No of Floor beams/bracings for span  | 1 <sup>st</sup> span :7 no's<br>2 <sup>nd</sup> span: 5 no's<br>3 <sup>rd</sup> span :9 no's |                                                                                                                                                                                                                                                                                                                                                             |

|          |                                                          |                                                                                              |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|----------|----------------------------------------------------------|----------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|          |                                                          | 4 <sup>th</sup> span: 7no's<br>5 <sup>th</sup> span: 11 no's<br>6 <sup>th</sup> span: 3 no's | bracing connected to gusset plate to transfer load from slab to top main chord members. (Refer <b>fig :1.3</b> )                                                                                                                                                                                                                                                                                                                                                                              |
|          | Arrangement of Bracings                                  | Diagonal                                                                                     |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Type of Beam-Column Joint (shape of gusset plate if any) | Cleat angles                                                                                 |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
| <b>e</b> | <b>COLUMN</b>                                            |                                                                                              |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Type/Shape of Column section                             | I – Section                                                                                  | a. FOB is supported on vertical column of Four - ISMB 300 with bracings of IAS 75 x 75 x 8 mm angle section.<br>b. Staircase landing is supported ISMB 200. (Refer <b>fig :1.2</b> )                                                                                                                                                                                                                                                                                                          |
|          | No of Columns per support                                | 4                                                                                            |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Dimensions of Column                                     | 300x150 mm                                                                                   |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | BEAM-Column joint (bolted, welded, riveted)              | Bolted                                                                                       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
| <b>f</b> | <b>Floor of the Gangway</b>                              |                                                                                              |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Material of Slab                                         | Pre-cast panels and cast in situ slab                                                        | a. For 1 <sup>st</sup> span RCC slab cast in situ supported on sacrificial plate.<br>b. For 2 <sup>nd</sup> to 6 <sup>th</sup> span pre-cast reinforced concrete slab panels are used for floor slab of 100mm thick, RCC slab panels are resting on floor beams.<br>c. Chequered tile flooring is laid on the top of the slab panels (Refer <b>fig : 1.1 and 1.4</b> )                                                                                                                        |
|          | Thickness of Slab                                        | 100 mm                                                                                       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Condition of Slab from Bottom                            | Leaching effect                                                                              |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Condition of Slab from Top                               | RCC slab is not visible, Covered with Chequered tiles                                        |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
| <b>g</b> | <b>Staircase Details</b>                                 |                                                                                              |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Number of staircases                                     | 4 No's                                                                                       | a. Staircase steps are observed as cast in situ slab. Steps size of 300 x 100 mm are supported on ISMC 200 channel using sacrificial plate only at PF-1. Staircase landing of 2.54 m wide is supported on ISMC 250.<br>b. Staircase steps are observed as Precast slab panels. Steps size of 300 x 100 mm are supported on ISMC 200 channel using ISA 75 x 75 x 8 mm angle section connected to ISMC 150. Staircase landing of 2.54 m wide is supported on ISMC 250. (Refer <b>fig :1.5</b> ) |
|          | Number of steps from at PF-1                             | 37 no's                                                                                      |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Number of steps from PF – 2                              | 41 no's                                                                                      |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Number of steps from PF – 4                              | 40 no's                                                                                      |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Number of steps at 6 <sup>th</sup> span Circulating area | 38 no's                                                                                      |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Material used for steps                                  | Precast slab panels and cast in situ slab                                                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
| <b>h</b> | <b>Staircase Railing</b>                                 |                                                                                              |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|          | Type of Parapet Railing                                  | Steel railing                                                                                | a. Staircase is provided with railing on both sides of one-meter height using ISA 75 x 75 x 10 mm angle section and 50 x 6 mm M.S flats are used. (Refer <b>fig :1.5</b> )                                                                                                                                                                                                                                                                                                                    |
|          | Height of Railing                                        | 1 m                                                                                          |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |

#### 1.4 SIGNS OF DISTRESS/DEFORMATION IN BRIDGES

**a**


- ✓ Corrosion is observed in bottom of main chord member ( Double angle section) and gusset plate joints connecting floor beam



Reinforcement exposed and leaching of slab panels

**b**

- ✓ Corrosion is observed in the floor beams and in the bottom chord members of 3<sup>rd</sup>, 4<sup>th</sup> and 5<sup>th</sup> span in FOB

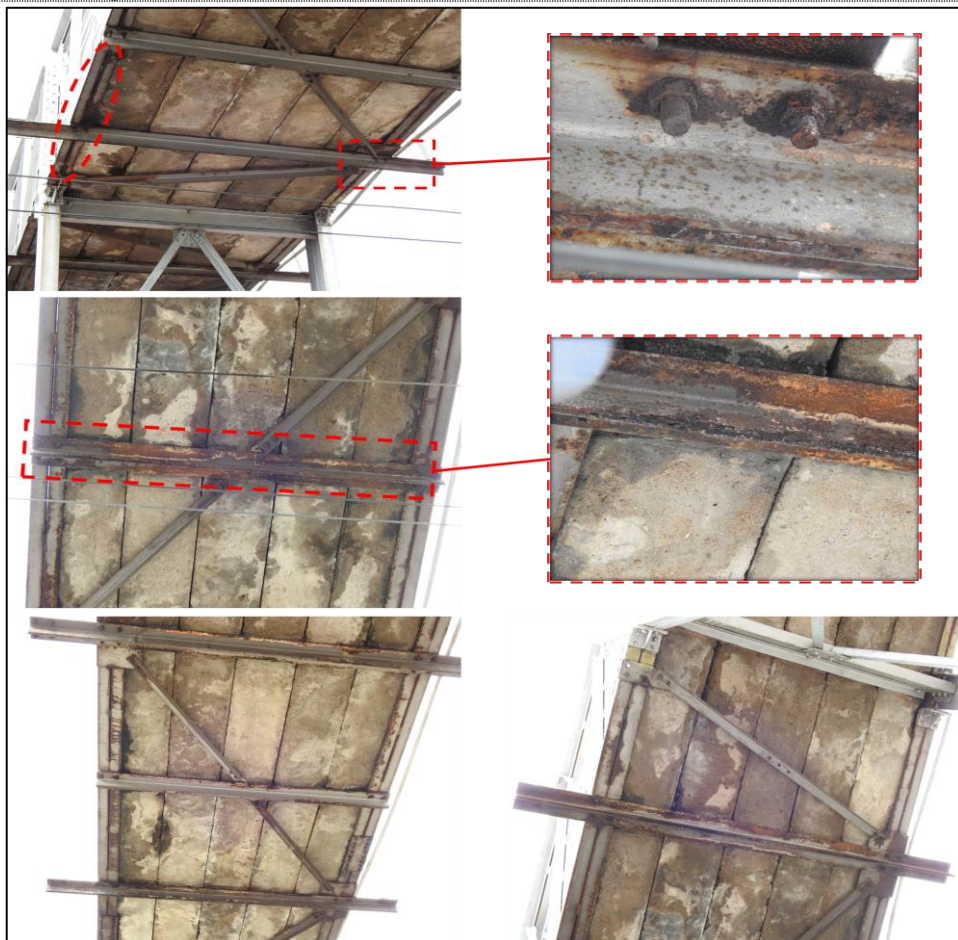

Corrosion of floor beams

| SIGNS OF DISTRESS/DEFORMATION IN BRIDGES |                                                  |                                                                                                                                                    |  |
|------------------------------------------|--------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|--|
| Defects                                  | Location                                         | Comments                                                                                                                                           |  |
| Cracking in steel members                |                                                  | No cracks are observed in Steel during visual inspection                                                                                           |  |
| Cracking in RCC components               |                                                  | No cracks are observed in Pre-casted RCC slab panels                                                                                               |  |
| Water seepage                            |                                                  | No water seepage is observed                                                                                                                       |  |
| Spalling                                 |                                                  | No spalling is observed                                                                                                                            |  |
| Rust straining                           | Bottom main Chord members and floor beams joints | Rusting and corrosion is observed at joints of floor beam gusset plate connecting bottom main chord is observed. (Refer <b>Part 1.4 –a and b</b> ) |  |
| Extent Of Corrosion                      |                                                  |                                                                                                                                                    |  |
| Rusting in Gusset plate                  |                                                  | Rusting is observed in Gusset plates (Refer <b>Part 1.4 -b</b> )                                                                                   |  |
| Corrosion at steel-Concrete joint        |                                                  | Corrosion is observed at steel concrete joint. (Refer <b>fig :1.7</b> )                                                                            |  |
| Condition of Painting of steel structure |                                                  | Painting is affected only at distressed places.                                                                                                    |  |

**\*Rust:** Rust is a part of corrosion and is a chemical process which results in the formation of red or orange coating on the surface of metals.

**\*Corrosion:** it is the process of deterioration of materials as a result of chemical, electrochemical or other reactions.



**Fig 1.1:** Cables, Flooring and protective screen



**Fig 1.2:** Trestles details



**Fig 1.3:** Main chord members, Floor beams, vertical and diagonal bracings



**Fig 1.4:** Bottom view of span 1, 3 and 5



**Fig 1.5:** Staircase details



**Fig 1.6:** Accidental damage observed at stanchions



***Fig 1.7:*** Corrosion and vegetation

## 2. Repair and Retrofitting Recommendations

### 2.1 Repairs/Maintenance

#### a. Cleaning

- **Methodology for cleaning:** Generally foreign material are deposited or accumulated on bridge deck and in several bridge components which can deteriorate the bridge if proper action is not taken, so we support cleaning.
- **Debris removal:** The surface areas of a FOB should be cleaned and washed by brushing with fresh water or using high-pressure water blasting, including Deck slab top, sides along steel concrete joint on either side of deck, Supporting Railing and connecting staircase.
- **Vegetation removal:** Vegetation growth shall be removed from the components of the FOB, and near the FOB. *(Photographs of the same can be see in **fig: 2.2-2.4**)*

#### b. Patchwork (spalling, honey comb, voids)

Reinforced cement concrete Slab at Deck level and some precast panels in staircase are observed with exposed rebar in many locations. *(Photographs of the same can be see in **fig 2.4**)*

**Methodology for patching:** Hand applied Mortar (Patching) repair is performed to restore small areas where sound concrete is damaged by spalling, scaling and/or impact. This method of repair is generally applied using trowel and require minimum or formworks. The patch thickness is limited to a maximum of 100 mm depth of hollow surface. Hand applied Mortar repair is classified into two types considering defective area and surface. Hand applied Mortar

- a) **Type - A** is applicable to surfaces without exposed rebar is having defective widths of up to 300mm and depths of up to 50 mm.
- b) **Type - B** is for surfaces with exposed rebar, with defective widths between 300 mm and 600 mm, and up to 100 mm depths.

Hand applied Mortar repairs may be composed of Polymer cement mortars or non-shrinkage cement mortars depending on the type of patching, location and extent of damage. To keep good bond ability to the existing concrete.

#### c. Corrosion:

Based on Steel Surface area effected by corrosion on steel member are classified into three grades as follows

- i. **Grade 1-** Mild Corrosion: 10 – 20 % of Surface area is affected with and peeled-off coating film is partially visible.
- ii. **Grade 2-** Moderate Corrosion: 20 – 30 % of Surface area is affected with corrosion and coating film is almost visible but partially deteriorated due to corrosion.
- iii. **Grade 3-** Severe Corrosion: 30% and more of Surface, area is affected by Corrosion and coating film is almost gone.

**Methodology for Corrosion:**

- If the paint condition is identified as Grade-1, aluminum paint shall be applied with a similar shade.
- Where condition of paint is evaluated as Grade-2 special anticorrosion paint shall be applied to restrict corrosion from progressing further.
- When the condition of the member is observed to be in Grade – 3, which might have occurred due to environmental conditions or age of the structure. In such cases section loss is calculated by using caliper where it is accessible and UPV at one accessible location. The first step in dealing with corrosion is to measure the section loss in the member. The member may be measured using calipers or other appropriate methods for totally exposed sections.
  - a. Section Loss < 15% - Clean the Surface and Apply the anticorrosion protective coat.
  - b. Section Loss 15% - 40% Repair the member as per design.
  - c. Section Loss > 40% - Replace the member.

## Span-1

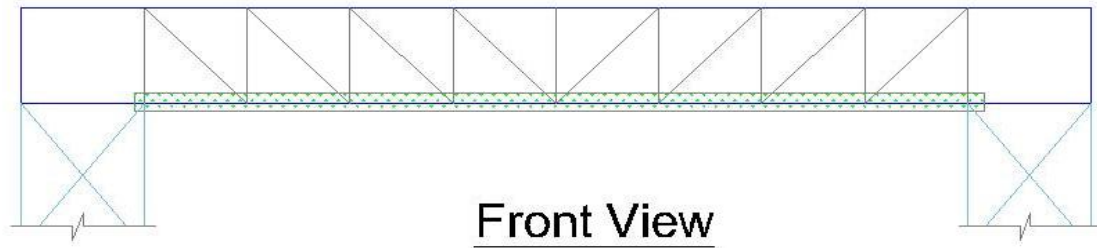
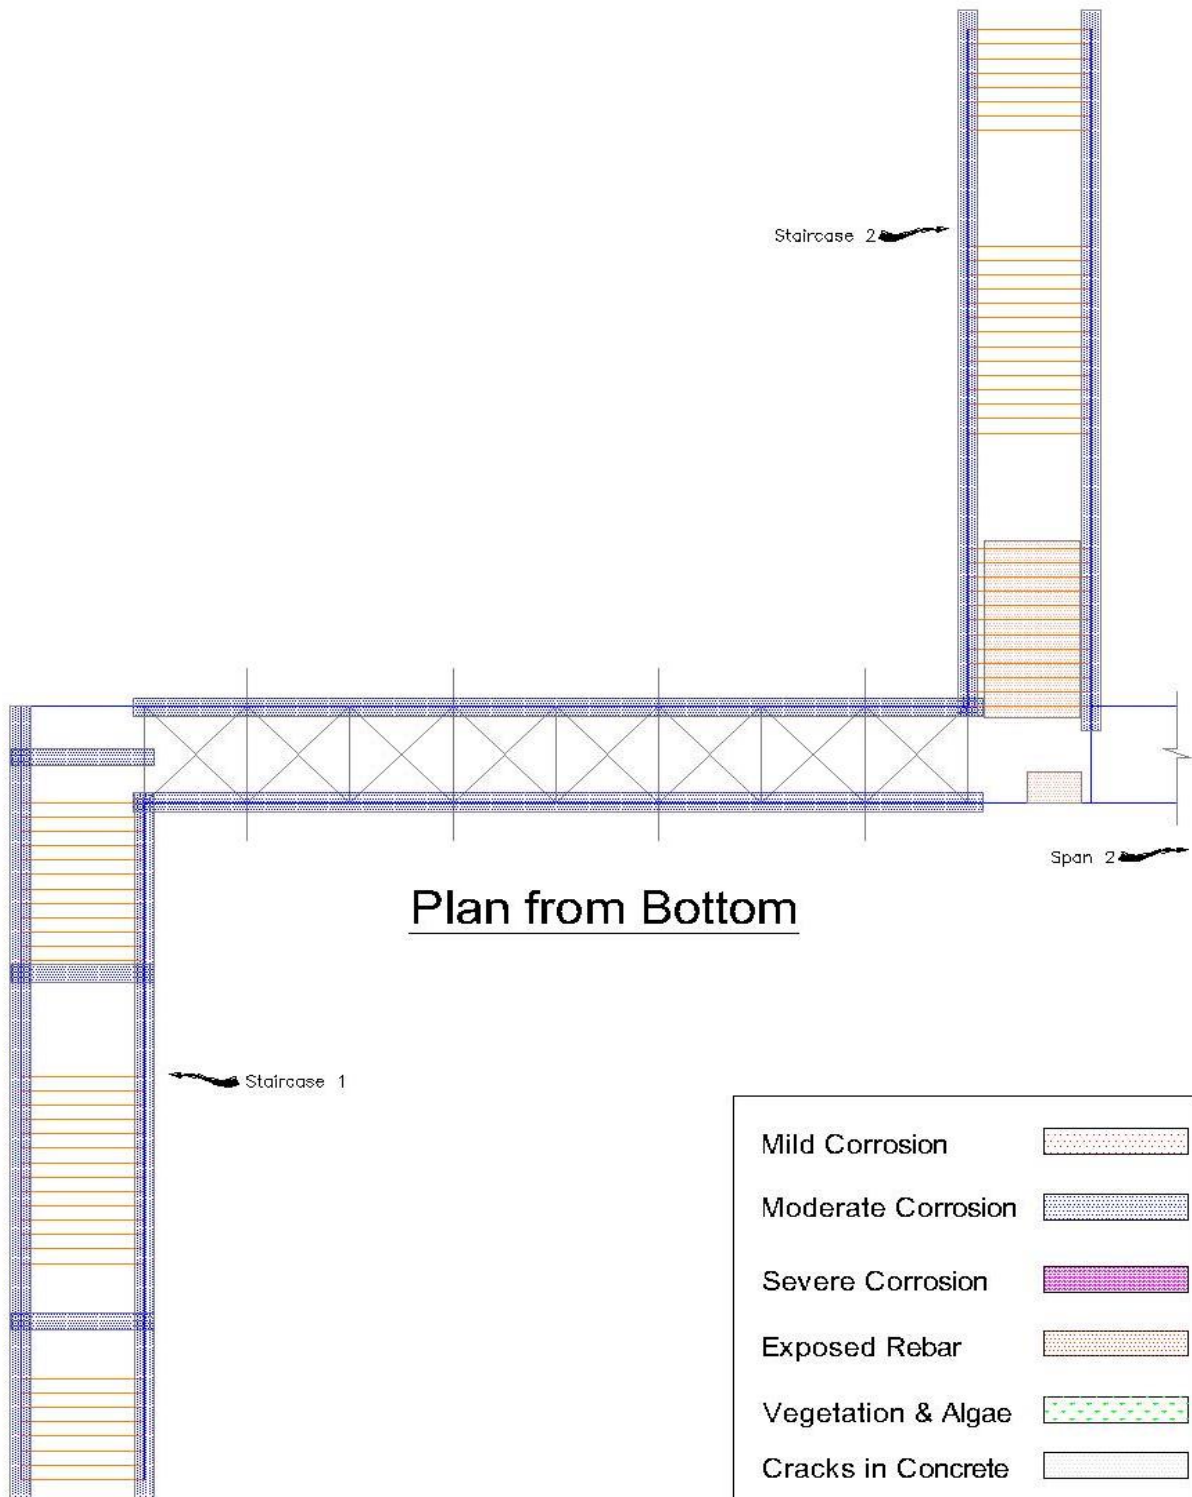


**Fig 2.1:** Locations of Deteriorations in Span 1

### Span one recommendations

- Structural members are in fair condition, displaying mild corrosion for top chord members, verticals, diagonals, and gusset plates, moderate corrosion for bottom chord members, and staircase stringer beam along steel concrete joint and on the Sacrificial plate is also corroded (locations are marked in figures below).
- Algae formation and vegetation is observed along steel concrete joint on outer surface at deck level and on staircase 2 mid landing.

Staircase 2 precast slab panels are deteriorated reinforced is exposed in flights and staircase RCC landing slab at deck level. (Photographs of the same can be seen in **fig 2.2-2.4**)

**Table 2.1:** Grading of corrosion in span 1

| Span 1                     | Mild Corrosion | Moderate Corrosion | Sever Corrosion | Remark                       |
|----------------------------|----------------|--------------------|-----------------|------------------------------|
| Floor Beams/ Cross Girders | ✓              |                    |                 | Nuts are missing for 2 bolts |
| Bottom Chord               |                | ✓                  |                 |                              |
| Top Chord                  | ✓              |                    |                 |                              |
| Bottom Lateral Bracings    | ✓              |                    |                 |                              |
| Diagonals                  | ✓              |                    |                 |                              |
| Vertical                   | ✓              |                    |                 |                              |
| Gusset Plates              | ✓              |                    |                 |                              |
| Sacrificial plate          |                | ✓                  |                 |                              |
| Bolts                      | ✓              |                    |                 |                              |



**Fig 2.2:** Locations of deteriorations in Staircase 1 from bottom

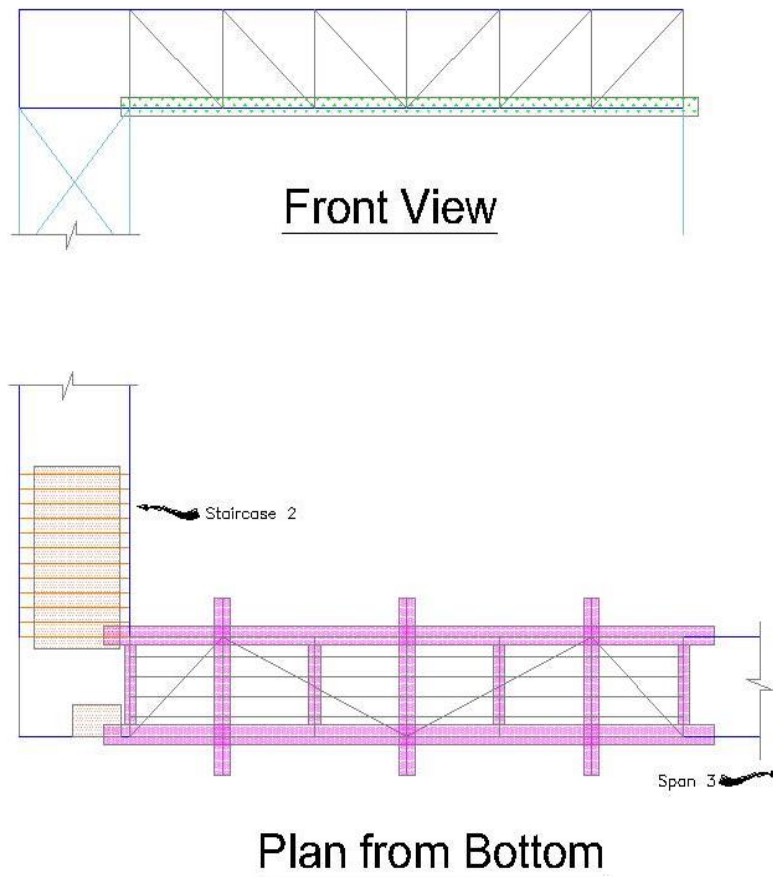


**Fig 2.3:** Deteriorations of bottom chord and Vegetation at deck level



**Fig 2.4:** Locations of Deteriorations in Staircase 2 from bottom

## Span-2



|                    |  |
|--------------------|--|
| Mild Corrosion     |  |
| Moderate Corrosion |  |
| Severe Corrosion   |  |
| Exposed Rebar      |  |
| Vegetation & Algae |  |
| Cracks in Concrete |  |

**Fig 2.5:** Locations of Deteriorations in Span 2

### Span two recommendations

- Structural members are in fair condition, displaying mild to severe corrosion.
  - Algae formation and vegetation is observed along steel concrete joint on outer surface at deck level along the span.
- Bolts and nuts are missing in some locations. (Photographs of the same can be see in **fig 2.6, 2.7**)

**Table 2.2:** Grading of corrosion in span 2

| Span 2                        | Mild Corrosion | Moderate Corrosion | Sever Corrosion | Remarks                                            |
|-------------------------------|----------------|--------------------|-----------------|----------------------------------------------------|
| Floor Beams/<br>Cross Girders |                |                    | ✓               |                                                    |
| Bottom Chord                  |                |                    | ✓               |                                                    |
| Bottom Lateral<br>Bracings    |                | ✓                  |                 |                                                    |
| Top Chord                     | ✓              |                    |                 |                                                    |
| Diagonals                     | ✓              |                    |                 |                                                    |
| Verticals                     | ✓              |                    |                 |                                                    |
| Gusset Plates                 |                |                    | ✓               |                                                    |
| Bolts                         |                |                    | ✓               | Bolts and nuts<br>are missing in<br>some locations |

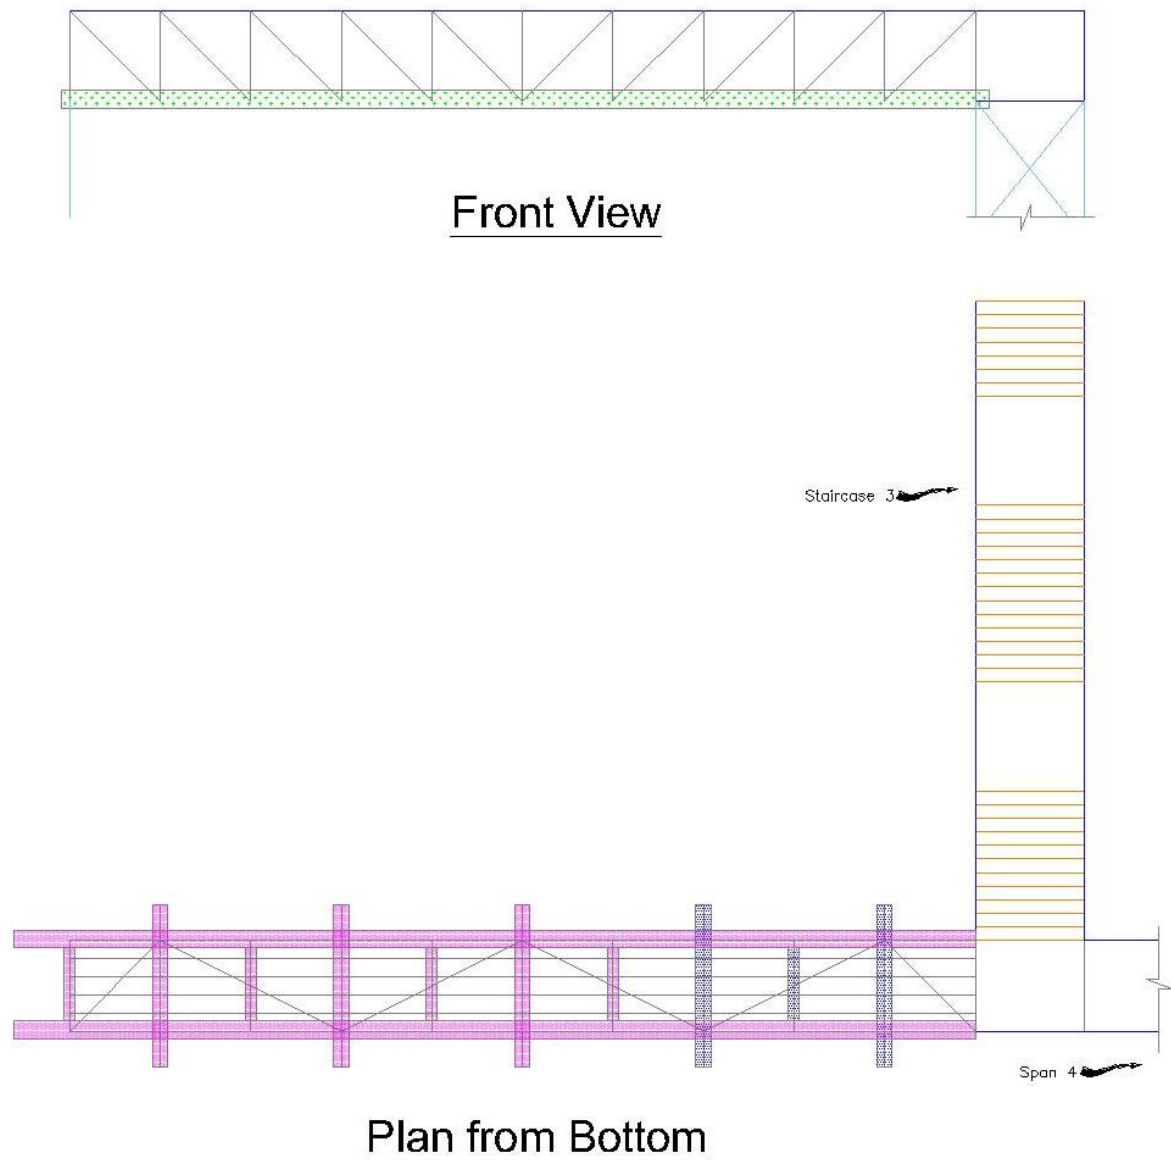


**Fig 2.6:** Deterioration locations of steel members at slab deck level in span 2



**Fig 2.7:** Some locations of Missing bolts and nuts in span 2

## Span-3



|                    |  |
|--------------------|--|
| Mild Corrosion     |  |
| Moderate Corrosion |  |
| Severe Corrosion   |  |
| Exposed Rebar      |  |
| Vegetation & Algae |  |
| Cracks in Concrete |  |

**Fig 2.8:** Locations of Deteriorations in Span 3 and staircase 3

### Span 3 recommendations

- Mild corrosion to sever corrosion for all structural members in FOB.
- Algae formation and vegetation is observed along steel concrete joint on outer surface at deck level and on staircase 3 mid landing. (Photographs of the same can be see in **fig:2.9, 2.10**)

**Table 2.3:** Grading of corrosion in span 3

| Span 3                        | Mild Corrosion | Moderate Corrosion | Sever Corrosion | Remarks |
|-------------------------------|----------------|--------------------|-----------------|---------|
| Floor Beams/<br>Cross Girders |                |                    | ✓               |         |
| Bottom Chord                  |                |                    | ✓               |         |
| Bottom Lateral<br>Bracings    |                |                    | ✓               |         |
| Top Chord                     | ✓              |                    |                 |         |
| Diagonals                     | ✓              |                    |                 |         |
| Verticals                     | ✓              |                    |                 |         |
| Gusset Plates                 |                |                    | ✓               |         |
| Bolts                         |                |                    | ✓               |         |


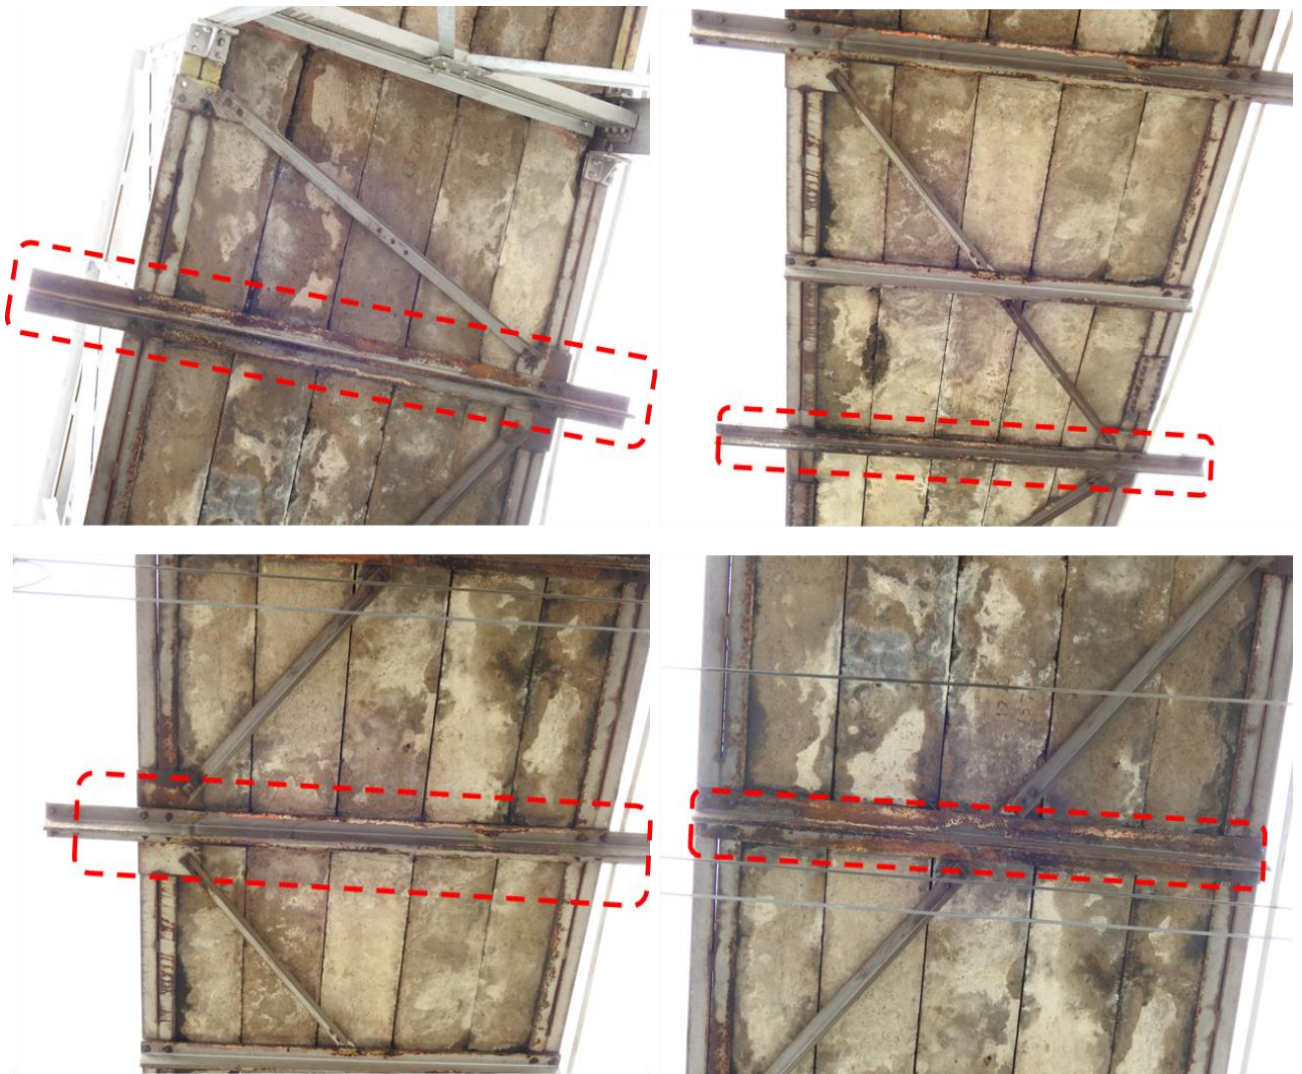


**Fig 2.9:** sever corrosion of floor beam in span 3



***Fig 2.10:*** Locations of deterioration of bolted connections in span 3

## Span-4

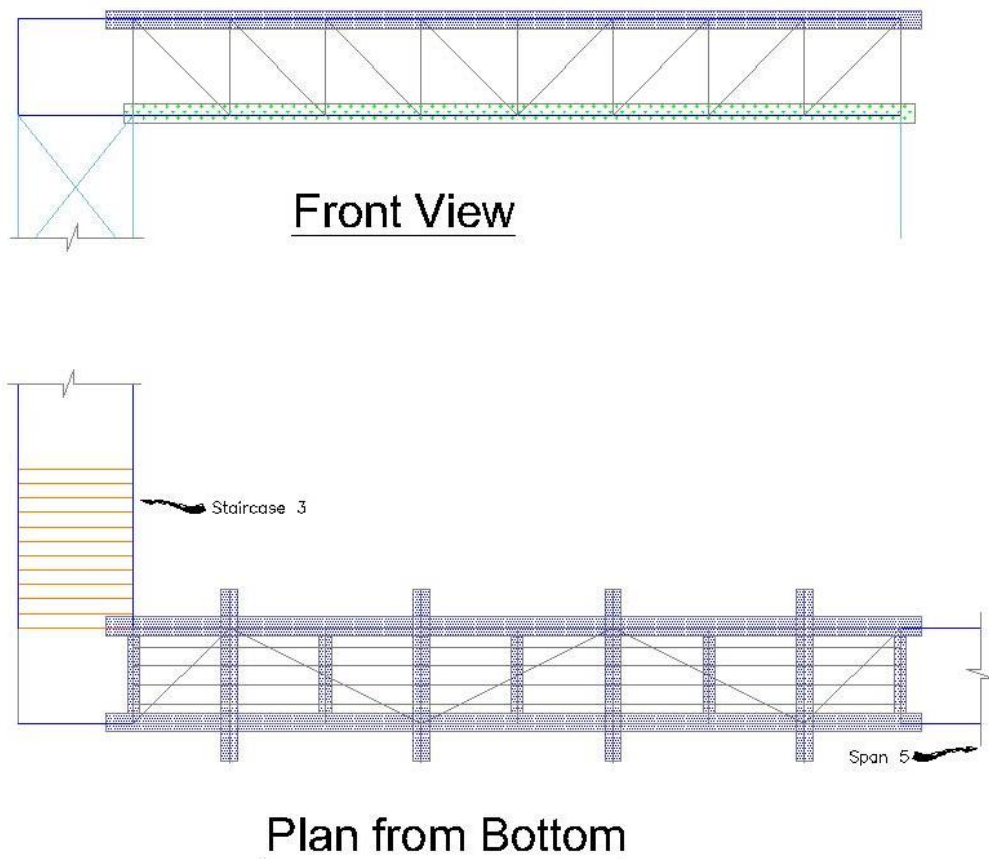

|                    |  |
|--------------------|--|
| Mild Corrosion     |  |
| Moderate Corrosion |  |
| Severe Corrosion   |  |
| Exposed Rebar      |  |
| Vegetation & Algae |  |
| Cracks in Concrete |  |

**Fig 2.11:** Locations of Deteriorations in Span 4

### Span 4 recommendations

- Mild corrosion to sever corrosion for all structural members in FOB.
- Algae formation and vegetation is observed along steel concrete joint on outer surface at deck level (*Photographs of the same can be see in **fig 2.12***)
- Floor beams and gusset plate are painted with red oxide paint.



**Table 2.4:** Grading of corrosion in span 4

| Span 4                     | Mild Corrosion | Moderate Corrosion | Sever Corrosion | No Corrosion |
|----------------------------|----------------|--------------------|-----------------|--------------|
| Floor Beams/ Cross Girders |                | ✓                  |                 |              |
| Bottom Chord               |                | ✓                  |                 |              |
| Bottom Lateral Bracings    |                | ✓                  |                 |              |
| Top Chord                  |                | ✓                  |                 |              |
| Diagonals                  | ✓              |                    |                 |              |
| Verticals                  | ✓              |                    |                 |              |
| Gusset Plates              |                | ✓                  |                 |              |
| Bolts                      |                | ✓                  |                 |              |



**Fig 2.12:** Locations of corrosion and vegetation in span 4

## Span-5

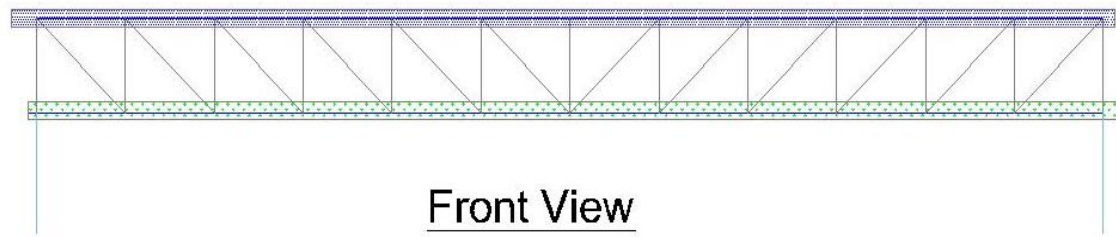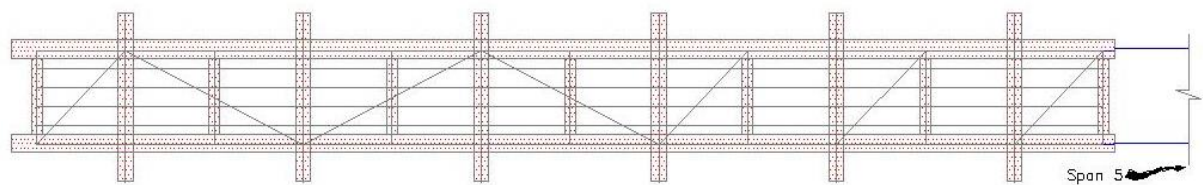

Plan from Bottom

|                    |  |
|--------------------|--|
| Mild Corrosion     |  |
| Moderate Corrosion |  |
| Severe Corrosion   |  |
| Exposed Rebar      |  |
| Vegetation & Algae |  |
| Cracks in Concrete |  |

**Fig 2.13:** Locations of Deteriorations in Span 5

### Span 5 recommendations

- Algae formation and vegetation is observed along steel concrete joint on outer surface at deck level (*Photographs of the same can be see in **fig 2.12***)

**Table 2.5:** Grading of corrosion in span 5

| Span 5                     | Mild Corrosion | Moderate Corrosion | Sever Corrosion | No Corrosion |
|----------------------------|----------------|--------------------|-----------------|--------------|
| Floor Beams/ Cross Girders | ✓              |                    |                 |              |
| Bottom Chord               | ✓              |                    |                 |              |
| Bottom Lateral Bracings    | ✓              |                    |                 |              |
| Top Chord                  |                | ✓                  |                 |              |
| Diagonals                  | ✓              |                    |                 |              |
| Verticals                  | ✓              |                    |                 |              |
| Gusset Plates              | ✓              |                    |                 |              |
| Bolts                      | ✓              |                    |                 |              |



**Fig 2.14:** vegetation observed near bottom chord member

## Span-6

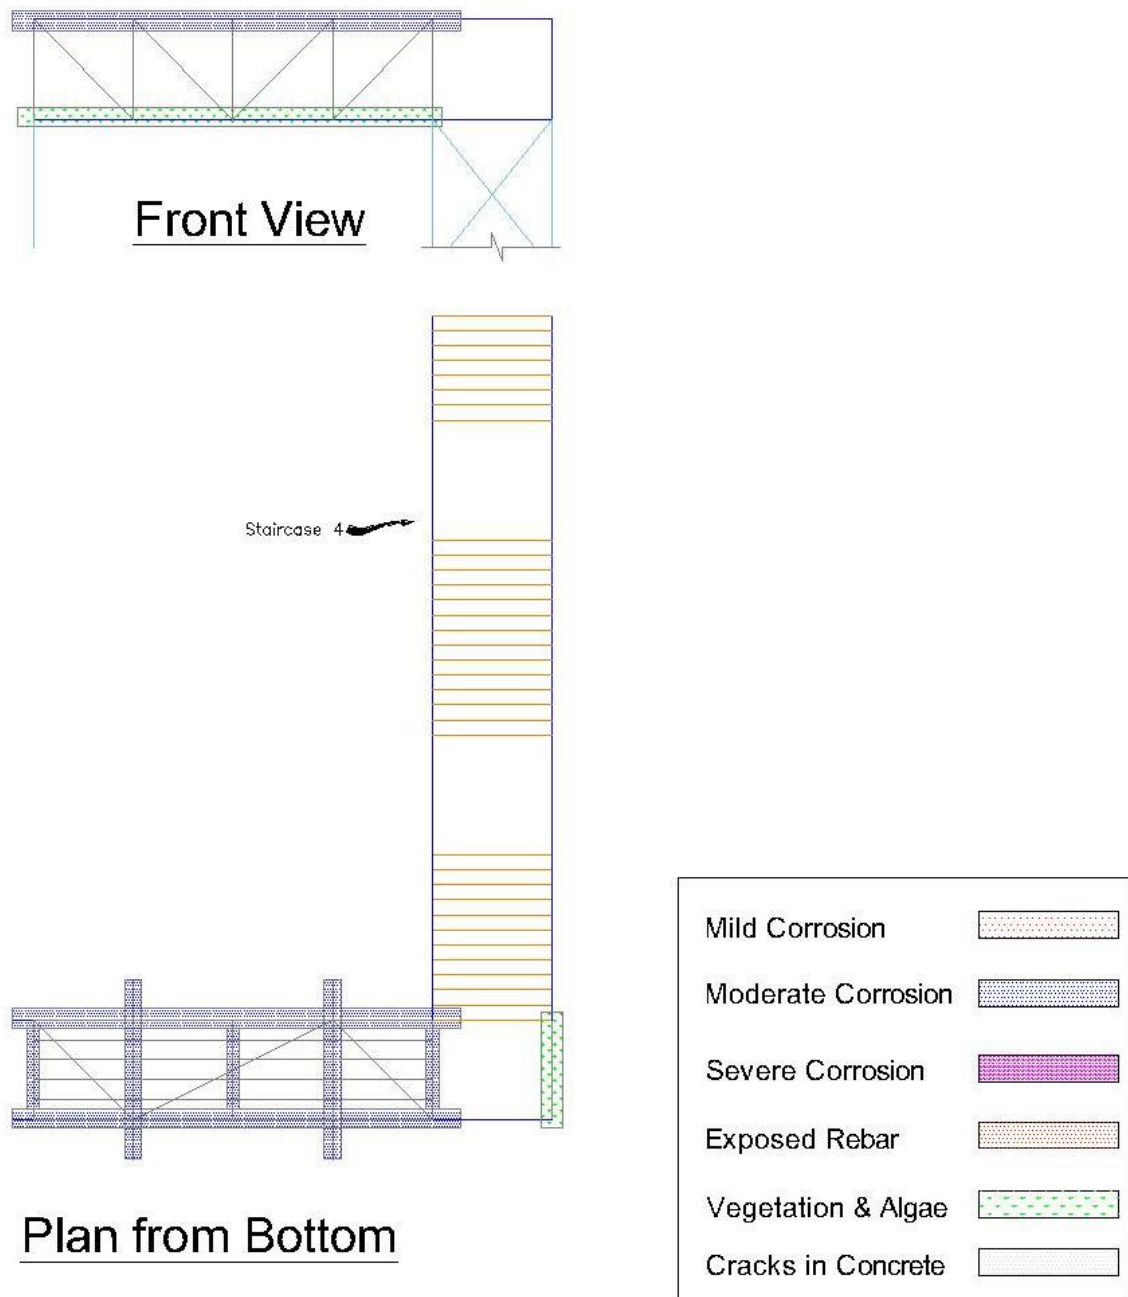


**Fig 2.15:** Locations of Deteriorations in Span 6

### Span 6 recommendations

- Algae formation and vegetation is observed along steel concrete joint on outer surface of deck level (*Photographs of the same can be see in **fig 2.16-2.18**.*

**Table 2.6:** Grading of corrosion in span 6

| Span 6                     | Mild Corrosion | Moderate Corrosion | Sever Corrosion | No Corrosion |
|----------------------------|----------------|--------------------|-----------------|--------------|
| Floor Beams/ Cross Girders |                | ✓                  |                 |              |
| Bottom Chord               |                | ✓                  |                 |              |
| Bottom Lateral Bracings    | ✓              |                    |                 |              |
| Top Chord                  |                | ✓                  |                 |              |
| Diagonals                  | ✓              |                    |                 |              |
| Verticals                  | ✓              |                    |                 |              |
| Gusset Plates              | ✓              |                    |                 |              |
| Bolts                      | ✓              |                    |                 |              |



**Fig 2.16:** vegetation and slight corrosion at floor beam



**Fig 2.17:** Deformed column due to accidental hitting



**Fig 2.18:** vegetation is observed on pathway of gangway

# ANNEXURE

## Annexure-1a: Repair methods

|                           |                            |
|---------------------------|----------------------------|
| <b>Defects/Deficiency</b> | <b>Debris accumulation</b> |
| <b>Remedial Measures</b>  | <b>Cleaning</b>            |

During the Bridge service life, several components of bridges get unclean due to deposition of foreign materials. Materials that collect on the deck surface flow with the rain water towards the drainage spouts which may choke the outlets and affect drainage. Also the materials that collect on the deck and carried by the rain water towards edges of the gangway and accumulate in the gaps or on the steel members. Such debris accumulation can cause acceleration of the corrosion in metal since debris tend to hold water. Also growth of vegetation such as grass, shrubs and other plants on the components of bridges is very common. But, they should be thoroughly cleaned of accumulated dust, debris and other foreign materials at regular intervals. This is to prevent deterioration of the bridge, which will therefore preserve the bridge components in their intended conditions resulting in increased service life of the bridge as well as provide safety and comfort to the users.

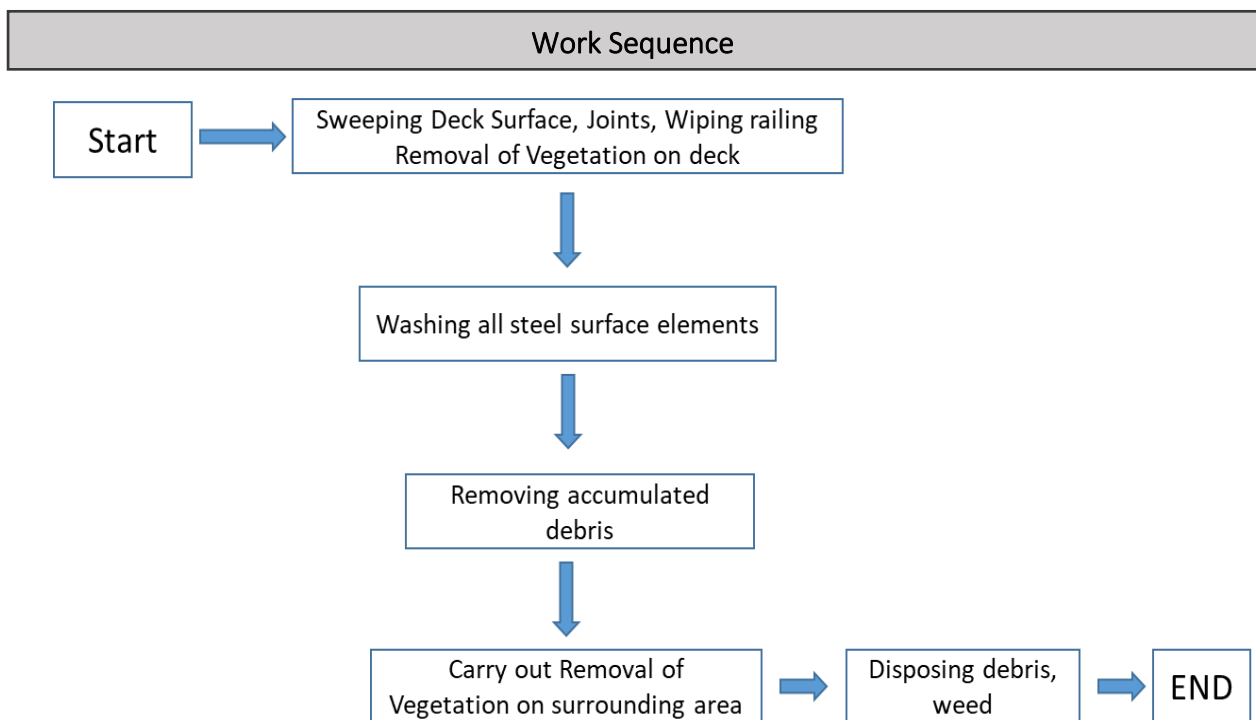


**Figure:1.1** Work sequence of removal of vegetation and accumulated debris

### Requirement and Specification

#### 1. Material Requirement

Water to be used for cleaning of the bridge components shall be clean and free from unwanted foreign materials such as sediments, salt contaminants, chemicals, grease, oil, rubbish and other substances which are harmful to the bridge components.

All necessary tests shall be performed on water samples at laboratories to be specified by the Engineer, and test certificates shall be provided as required.

## **2. Work Requirement**

### **1) General**

All accumulated foreign materials shall be removed from gangway, its sides and check at beam flanges, gusset plates, truss joints, deck drain systems, and other locations specified and as directed by the Engineer, prior to cleaning with water pressure. Removal shall be performed using hand brooms, hand shovels, scrapers, vacuum cleaners or other methods acceptable to the Engineer. The removed materials shall be collected and disposed at an approved waste area in accordance with railway regulations. At no time shall these materials be allowed to be disposed within the vicinity of the bridge or on the tracks.

### **2) High pressure water**

Salt contaminants, dirt, and other detrimental foreign matters shall be removed without damaging or peeling the paint from any structural steel. If high-pressure water is used, the maximum water pressure shall not be so high that any paint is damaged. The cleaning operation shall be discontinued if the foreign materials have not been easily removed or if cleaning operation is causing damage to existing paint coating. In this situation, the high-pressure water shall be adjusted to clean the surface without damaging the paint coating.

All deck drains or gangways and its accessories shall be flushed with high-pressure water after the accumulated foreign material has been properly removed. Drain systems may have to be disassembled to remove large blockages of accumulated foreign material. Should this be necessary, these shall be returned to their original configuration immediately after cleaning. Drainage systems shall drain properly after cleaning.

The Contractor shall flush out the interior surfaces of all truss members using high-pressure water. This flushing shall continue until such time that clear water is being draining out. The exterior surfaces of all truss members, miscellaneous structural steel connecting the truss members, and floor beam-ends projecting outwardly from the row of exterior stringers shall be thoroughly washed down using high-pressure water.

The Contractor shall obtain approval of the source of water used. They shall use fresh water, which is free of sediments and salt contaminants, and be responsible for all expenses involved in securing the approved water.

### **3) Power block**

During this activity power block is mandatory and has to be carried in the presence of BRI.

## Annexure-1b: Repair methods

|                           |                             |
|---------------------------|-----------------------------|
| <b>Defects/Deficiency</b> | <b>Spalling, Honey comb</b> |
| <b>Remedial Measures</b>  | <b>Patching</b>             |

Spalling of concrete requiring patching, which is usually caused by corrosion of steel reinforcement. Honeycomb is the effect of inadequate compaction of concrete while being cast. Patching is a temporary repair measure unless all the chloride-contaminated concrete is removed before the concrete deck or stair case is patched. If only the spalled and delaminated concrete is removed, the corrosion process continues and additional spalling can soon appear.

Studies of deck-sealing practice suggest that while sealing or overlaying of chloride contaminated concrete cannot stop the process of corrosion and deterioration of steel and concrete, it can slow the process, which may be acceptable depending upon the schedule of future major rehabilitation. Further, moving passengers increases the impact loading, which can result in increased damage.

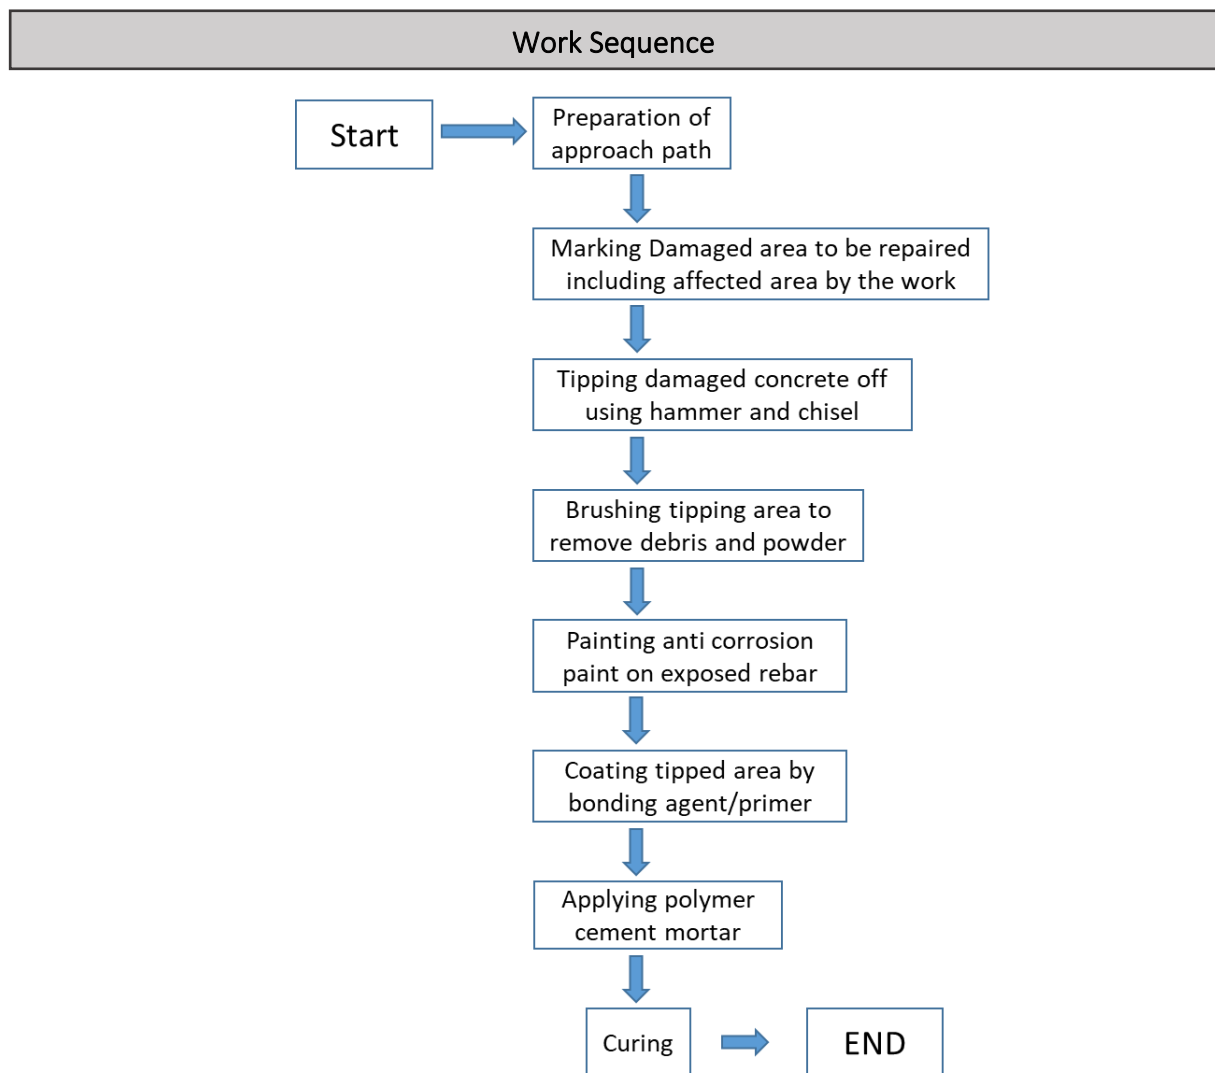


**Figure: 1.2** Work sequence of Epoxy Coating

## Required equipment / Tool and material

Material List –

- Polymer Cement Mortar
- Portland Cement
- Epoxy Bonding
- Zinc rich primer

Tool/Equipment List –

- Chisel
- Portable Generator
- Wire Brush

## Requirement and Specification

Material Specifications

### 1) Polymer Cement

Polymer cement mortar shall conform to the requirements of the specifications shown in Table 1.1 or equivalent ASTM Specifications.

Table:1.1 Specification of Polymer Cement for Patching

| Property                     | Test Method | Specification                               |
|------------------------------|-------------|---------------------------------------------|
| Initial setting time         | -           | above 60 minutes                            |
| Shrinkage                    | ASTM D2566  | below 0.05 %                                |
| Thermal expansion            | ASTM C531   | $2.0 \times 10^{-5}$ mm/mm/ ° C             |
| Slant shear bond to concrete | ASTM C882   | Concrete failure above 15 N/mm <sup>2</sup> |
| Compressive strength         | ASTM D695M  | above 20 N/mm <sup>2</sup>                  |

### 2) Epoxy bonding agent

The epoxy-bonding agent to concrete surface shall conform to the requirements of the specification indicated in Table 1.2 (Anti-corrosion zinc rich primer shall be applied to exposed rebar).

Table 1.2 Specification of Epoxy Bonding Agent to Concrete Surface

| Property                                          | Test Method | Specification        |
|---------------------------------------------------|-------------|----------------------|
| Compressive strength                              | ASTM D695M  | 70 N/mm <sup>2</sup> |
| Flexural strength                                 | ASTM D790M  | 40 N/mm <sup>2</sup> |
| Tensile strength                                  | ASTM D638M  | 30 N/mm <sup>2</sup> |
| Tensile shear bond to steel                       | ASTM 1002   | 15 N/mm <sup>2</sup> |
| Slant shear bond to mortar                        | ASTM C882   | 15 N/mm <sup>2</sup> |
| Bond Strength of Cured Concrete to Fresh Concrete | ASTM D7274  | 15 N/mm <sup>2</sup> |

- 3) **Zinc Rich Primer:** The zinc rich primer to rebar shall be in accordance with the requirements of the specifications in Table 1.3

Table 1.3 Specification of Zinc Rich Primer for Rebar

| Property                           | Test Method | Units | Specification |
|------------------------------------|-------------|-------|---------------|
| Gloss @ 60°Angle                   | ASTM D 523  | -     | Flat          |
| Adhesion                           | ASTM D 3359 | -     | Minimum 3A    |
| Salt Spray Resistance              | ASTM D3-37  | -     | Excellent     |
| %Zinc by Weight in Dried Film Test |             | %     | 87.5±2        |

### Work requirement

1) **General**

Patching repair works using Portland cement mortar shall be carried out in accordance with provisions of relevant standards and manufacturer's specifications. Patching, as a minor repair work, should be carried out using an appropriate means to access the repair area, before the defect worsens. Patching repair work method using polymer cement mortar shall be carried out as follows:

2) **Marking of patching area**

Evaluate surface area to be patched using hammer for hollow sounding delaminated area (or by using instruments to detect unsound concrete). Mark the area to be patch-repaired with paint or marker. Ensure complete coverage of the damage.

3) **Tipping damaged concrete off**

Using a small sledge hammer and chisel, remove all damaged concrete at the edges and corners of area to be repaired. Use a wire brush to remove loose debris. Care should be taken to ensure that no reinforcement is damaged. **Surface** shall be cut to expose the reinforcement and to reach the sound concrete substrate, without breaking the concrete behind the reinforcement. If rebar is exposed, anticorrosion agent coating should be applied on the bar surface prior to patching. All works shall be subjected to the approval of the designated Engineer. **Patch areas** that are within 600 mm of each other should be combined into a single large patch. If necessary, provide formwork around the damaged concrete to straighten the edges of the damaged section.

4) **Coating tipping area**

Concrete surfaces to receive repair mortar shall be prepared by mechanical scrubbing to remove loose materials, surface laitance, organic contaminants and moss. The clean and dust free surface shall then be coated by a bonding primer. Care shall be taken to ensure that vibration associated with the repair works does not cause delamination of existing adjacent plaster or concrete.

5) **Applying bonding agent and anti-corrosion paint**

Apply bonding agent to the damaged area in order for the patch material to adhere. Additionally, concrete nails/bids may be set to reinforce the repair. If rebar is

exposed, anticorrosion coating should be applied on the bar surface prior to patching.

6) **Patching mortar**

Prepare the mortar mix in a bucket using equipment approved by the Engineer. Use a trowel to spread fresh mortar over the area, covering the concrete nails driven halfway in the old concrete. Smoothen and level the mortar with a trowel. Polymer cement mortar is suitable for both vertical and horizontal surface applications, with a thin coating of up to 15 mm.

7) **Finishing**

As may be required, the mortar surface can be smoothened using a trowel or broom finished. The texture of the finish of the final repair mortar layer shall match the finish of the existing surface. The repair mortar application shall be built up to the original surface profile in layers not exceeding 20 mm with the final layer not exceeding 15 mm, unless otherwise recommended by the manufacturer and approved by the Engineer. The Engineer may approve repair mortar application thickness of up to 50 mm for lightweight mortars, provided the mortar manufacturer furnishes technical data to justify a layer thickness of greater than 20 mm.

8) **Curing**

All types of concrete repair with repair mortar need thorough and continuous curing to develop strength and impermeability. Curing also minimizes drying shrinkage while bond strength is developing. Curing of the repair mortar shall be in accordance with the manufacturer's instructions related to the polymer modified additive. Where curing agents are specified by the manufacturer, they shall be applied immediately after the surfaces have been scarified for the next repair mortar layer, or troweled to a finish.

### Annexure-1c: Repair methods

|                           |                                         |
|---------------------------|-----------------------------------------|
| <b>Defects/Deficiency</b> | <b>Minor corrosion of steel element</b> |
| <b>Remedial Measures</b>  | <b>Touchup painting</b>                 |

Due to thin paint coverage on steel surfaces or formation of pin-holes in paint, the steel surface may get exposed to atmosphere resulting in initiation of corrosion. Touch up painting at the early stages prevents progress of corrosion. Work included in this section comprises field touchup painting on steel members at localized areas including surface preparation and other associated works. This section covers only painting on relatively small affected areas which can be carried out with the use of small power tools / hand tools. Painting of larger areas requiring sand blast cleaning should be carried out in accordance with the specifications covered under major repairs.

#### Work Sequence

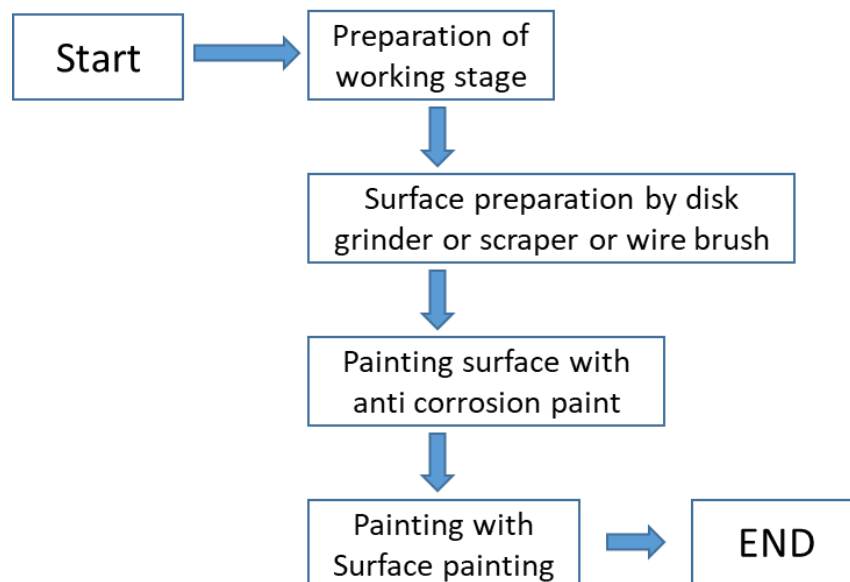


**Figure: 1.3** Work sequence of Painting with anti-corrosion paint

## Required Equipment / Tool and Material

### i. Materials

- Aluminum paint / special anticorrosion paint as required
- Thinner
- Epoxy resin filler

### ii. Tools/Equipment

- Scaffolding, inspection vehicle
- Portable generator (3 kVA)
- High pressure water blaster (8.0Mpa, 10.0 liters/min.)
- Sandpaper, portable power disk grinder
- Paint brush, roller

## Requirement and Specifications

### i. Material

Aluminum paint material shall be in accordance with the manufacturer's specifications and as approved by the Engineer.

For special anticorrosion paint, the materials shall satisfy the test requirements indicated in the relevant ASTM specifications as follows:

Table 1.4 Specification of Aluminum paint

| Test           | Test reference | Specification                                              |
|----------------|----------------|------------------------------------------------------------|
| Adhesive test  | ASTM D7234     | 7days 1.0 N/mm <sup>2</sup> , 28days 1.5 N/mm <sup>2</sup> |
| Elongation     | ASTM C190      | 7days 0.40 % , 28days 0.40 %                               |
| Saltwater test | ASTM D6943     | No defection                                               |

### ii. Work requirement

#### 1) Scaffolding

Scaffolding shall be installed for close access to the corrosion-affected surfaces of the steel members to be repaired. Standard scaffoldings may be used however mobile scaffolding/inspection vehicle may be found suitable as it allows for free movement in most cases and provides access with convenience to various parts of a bridge.

#### 2) Preparation of Steel Surface

Surface preparation shall conform to the paint manufacturer's specifications. Hand or power tools shall be applied for cleaning the surface. Groves and ridges formed on the affected surface shall be removed with power grinder. Where appropriate, as an alternative, epoxy resin filler may be used to fill the surface to a smooth and even finish. Where depth of roughness is within 0.5 mm, paint adequacy and durability can be achieved without application of multiple coats of surface leveling paints. Thickness of each coat shall not exceed the limiting value recommended in the paint

manufacturer's specifications. Application of aluminum paint material shall be in accordance with the manufacturer's specifications and as approved by the Engineer.

**3) Application of Touchup Paint**

Paint shall be applied with brush or roller. The paint shall be applied in such a way that a uniform and smooth surface is formed without wrinkles, runs, streaks, sags, or any other defects. Components of the paint shall be mixed in accordance with the manufacturer's instructions and the application shall also conform to such instructions and specifications. Paint shall be applied immediately after the surface preparation, preferably within 4 hours. Total dry film thickness for special anticorrosive paint shall be 500  $\mu\text{m}$  (equivalent 1.5kg/m<sup>2</sup>) consisting of two layers of coating as follows: -

*Layer-1: 250  $\mu\text{m}$  and Layer-2: 250  $\mu\text{m}$*

Anticorrosion paint shall be applied in accordance with the stipulations of paint manufacturer's specifications. Minimum total film thickness for aluminum paint shall be not less than 125  $\mu\text{m}$ . Roval paint is recommended for galvanized member touchup painting. Total dry film thickness for Roval paint shall be 80  $\mu\text{m}$  (equivalent 0.5kg/m<sup>2</sup>) consisting of two layers of coating as follows: -

*Layer-1: 40  $\mu\text{m}$  and Layer-2: 40  $\mu\text{m}$*

Roval paint shall be applied in accordance with the stipulations of paint manufacturer's specifications.

## Annexure-1d: Repair methods

|                           |                               |
|---------------------------|-------------------------------|
| <b>Defects/Deficiency</b> | Spalling, Abnormal Anchorage  |
| <b>Remedial Measures</b>  | Hand applied Mortar (A) & (B) |

Hand applied Mortar (Patching) repair is performed to restore small areas where sound concrete is damaged by spalling, scaling and/or impact. This method of repair is generally applied using trowel and require minimum or formworks. The patch thickness is limited to a maximum of 100 mm depth of hollow surface.

Hand applied Mortar repair is classified into two types considering defective area and surface. Hand applied Mortar (A) is for defects without exposed rebars while Hand applied Mortar (B) is applied to surfaces with exposed rebars. Hand applied Mortar repairs may be composed of Polymer cement mortars or non-shrinkage cement mortars depending on the type of patching, location and extent of damage.

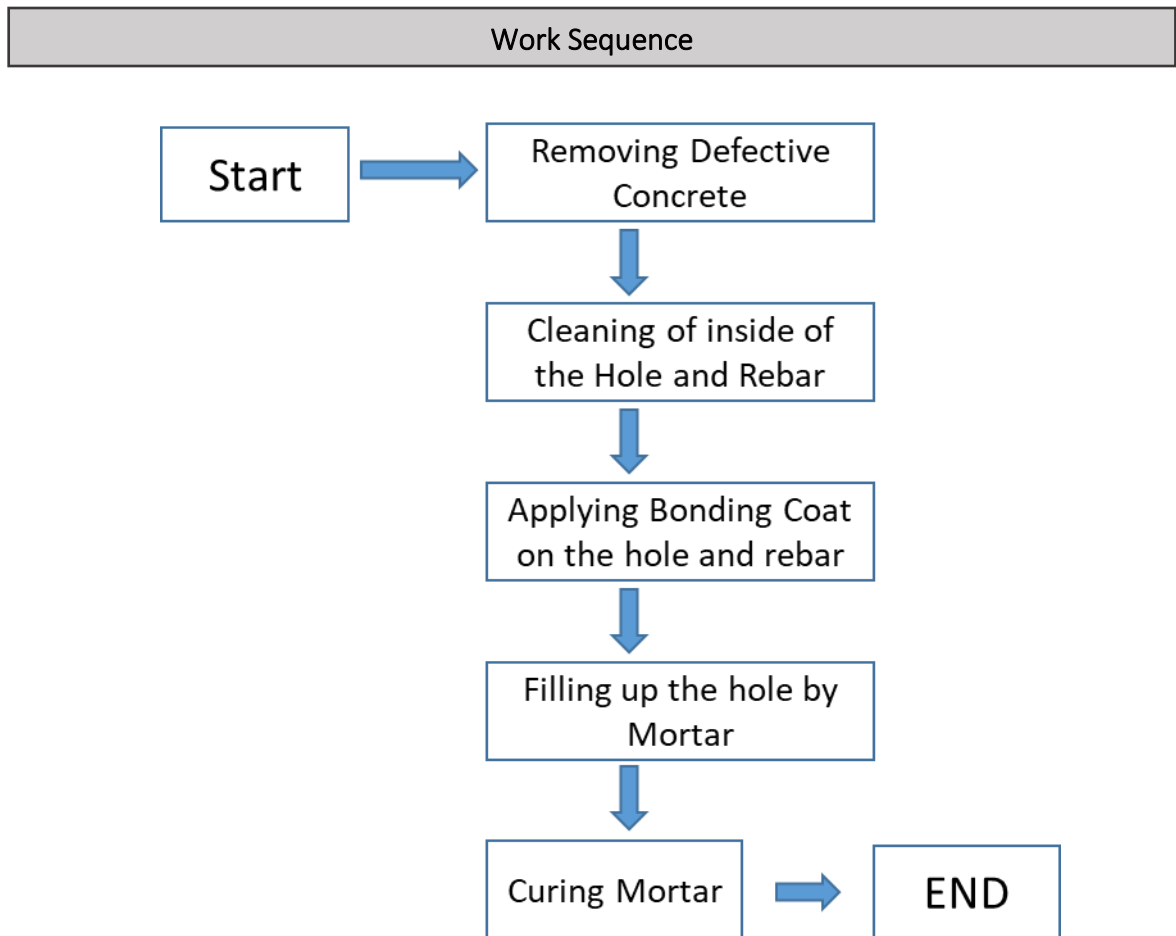


**Figure: 1.4** Work sequence of Hand applied mortar

### Required tools / Equipment and Material

#### 1) Tools/Equipment

For Hand applied Mortar (A) and Hand applied Mortar (B): -

- Power Disc Grinder
- Portable Generator
- Brush

## 2) Material

Hand applied Mortar (A): -

- Polymer Cement
- Epoxy Bonding Coat

Hand applied Mortar (B) –

- Polymer Cement
- Epoxy Bonding Coat
- Zinc Rich Primer

### Requirements and Specifications

#### i. Material

##### 1) Polymer Cement

Polymer cement mortar shall conform to the requirements of the specifications shown in Table 1.5 or equivalent ASTM Specifications.

Table 1.5 Specifications of Polymer Cement

| Property                             | Test Method | Units             | Specification        |
|--------------------------------------|-------------|-------------------|----------------------|
| Thermal Expansion                    | ASTM C531   | mm/mm°C           | $2.0 \times 10^{-5}$ |
| Slant Shear Bond to Concrete         | ASTM C882   | N/mm <sup>2</sup> | 1.5 /above           |
| Compressive Strength (7days x 20 )°C | ASTM C579   | N/mm <sup>2</sup> | 20 /above            |

##### 2) Corrosion Protective Coating

The Protective Coating of rebar shall conform with the requirements of the specifications in Table 1.6.

Table 1.6 Specifications of Corrosion Protective Coating to Rebar

| Property                    | Test Method | Units             | Specification |
|-----------------------------|-------------|-------------------|---------------|
| Compressive Strength        | ASTM D695M  | N/mm <sup>2</sup> | 75            |
| Flexural Strength           | ASTM D790M  | N/mm <sup>2</sup> | 40            |
| Tensile Strength            | ASTM D638M  | N/mm <sup>2</sup> | 30            |
| Tensile Shear Bond to Steel | ASTM D1002  | N/mm <sup>2</sup> | 10            |
| Slant Shear Bond to Mortar  | ASTM C882   | N/mm <sup>2</sup> | 15            |

##### 3) Zinc Rich Primer

The zinc rich primer to rebar shall be in accordance with the requirements of the specifications in Table 1.7.

Table 1.7 Specifications of Zinc Rich Primer to Rebar

| Property                           | Test Method | Units | Specification |
|------------------------------------|-------------|-------|---------------|
| Gloss @ 60 Angle                   | ASTM D 523  | -     | Flat          |
| Adhesion                           | ASTM D 3359 | -     | Minimum 3A    |
| Salt Spray Resistance              | ASTM D3-37  | -     | Excellent     |
| %Zinc by Weight in Dried Film Test | -           | %     | 87.5 ±2       |
|                                    |             |       |               |

**ii. Work requirement**

The Contractor shall submit the Methodology (Procedures) to the Engineer-in-Charge for his review and approval before commencement of the work.

**1) Remove of defective concrete**

Remove all defective, unsound and contaminated concrete and prepare the edges for the patch area based on the visual inspection. If local corrosion in reinforcement with section loss is found, which would require additional bars, remove only the damaged concrete including the length needed to bond the new reinforcement.

Concrete within marked out areas shall be removed using light mechanical breakers or hammer and chisel, the exposed reinforcement shall be cut and the sound of concrete substrate shall be determined to the satisfaction of the Engineer-in-Charge, without breaking out behind the reinforcement.

**2) Cleaning of Concrete and Rebar**

Remove loose particles and dust using high pressure water or vacuum cleaner. Concrete surfaces to be bonded must be free from dirt, oil, grease, asphalt etc. Corrosion must be removed before placing the new concrete. If deterioration is due to chloride contamination or if the reinforcement is covered with loose corrosion elements having pits, use water abrasive blasting until all the rust is removed

The concrete surfaces selected for repair shall be prepared by mechanical scrubbing to remove loose materials, surface laitance, organic contaminants and moss, and then coated by bonding primer. Utmost care shall be taken to ensure that vibration generated during the process does not cause delamination of adjacent render or concrete.

**3) Additional concrete breakout**

Where the breakout indicates that the exposed reinforcement is further corroded or the surrounding concrete is not sound, an enlarged area shall be agreed to be broken to the satisfaction of the Engineer-in-Charge. The Contractor shall test the concrete for extent of carbonation at the reinforcement depth. The depth of breakout in clearly defined areas can be increased based on written instructions from the Engineer-in-Charge, in order to remove all carbonated concrete. The additional concrete breakout shall not extend more than 20 mm behind the bottom layer main reinforcement. During breakout, utmost care shall be undertaken to minimize damage to the existing reinforcement.

**4) Additional or replacement rebar**

The Contractor shall report to the Engineer any rebar which has 10% or more section loss as a result of corrosion. Additional or replacement rebar shall be provided as instructed by the Engineer. Replacement rebar shall be cleaned to the same standard as the existing rebar. This replacement rebar shall be lapped on the side of the existing bars and be spot welded on one side. It shall be fixed along its length at suitable intervals to prevent sagging. The corroded rebars shall be cleaned and applied with zinc rich primer to prevent further corrosion. The Contractor shall obtain Engineer's approval for the rebar coating prior to proceeding with repair mortar application.

**5) Bonding coating to concrete and rebar**

Epoxy bonding coats are applied to dry and clean concrete surfaces in order to bond firmly. Specially formulated resins are also available for damp surfaces. Apply the selected bonding coat to steel bars as shown in the photo; with a brush working vigorously to ensure that they are evenly covered all around.

**6) Filling up repair material**

The mortar should be placed in layers of about 20 mm thickness. Compact each layer thoroughly over the entire surface using a wooden trowel or hammer. Generally, there should be no time delays between the placing and compacting of layers. The patching to the surrounding concrete is performed using a form material, and then hammered using a mallet, wood float or steel trowel. The mortar shall be mixed using equipment (normally a force action mixer) approved by the Engineer. The mixing liquid shall be added to the dry components and thoroughly mixed to achieve a uniform consistency, unless otherwise approved by the Engineer. The mortar shall then be applied to the bonding agent using hand packing and trowel to the satisfaction of the Engineer-in-Charge. The textured finish of the final repair mortar layer shall match the finish on the existing interior surface. The repair mortar application shall be built up to the original surface profile in layers not exceeding 20 mm and the final layer shall not exceed 15 mm, unless otherwise recommended by the manufacturer and approved by the Engineer-in-Charge. The Engineer may approve repair mortar application thickness of up to 50 mm for lightweight mortars, provided the repair mortar manufacturer can furnish a technical data to justify a layer thickness of greater than 20 mm.

**7) Curing**

All types of cement repairs need thorough and continuous curing to develop strength and impermeability, and to minimize drying shrinkage while bond strength is developing. Curing of the repair mortar shall be in accordance with the polymer modified additive manufacturer's instructions. Where curing agents are specified by the manufacturer, they shall be applied immediately after the surfaces have been scarified for the next repair mortar layer or troweled to a finish.

## Summary

- **Visual inspection of Raghavapuram railway station fob has been conducted on 26<sup>th</sup> October 2019, following observations were made**
  - i. Corrosion is observed between the main chord member (Double angle section) and gusset plate joints connecting floor beam.
  - ii. Corrosion observed in floor beams and bottom main chord members at 3rd, 4th and 5th span of FOB.
  - iii. Vegetation is also observed along the span of FOB apart from moderate corrosion.
  - iv. Accidental damage of stanchions at the bottom.
  
- **Based on visual inspections and its interpretations following recommendations were made:**
  - a) Cleaning of debris and vegetation immediately to avoid deterioration of concrete and steel members.
  - b) Anti-corrosion treatment for Grade-1 and Grade-2 highlighted corrosive members.
  - c) Replacement of damaged members or severely corroded members of span 2, span 3.
  - d) Patch work for exposed reinforcement in main landing at staircase 2 and staircase 3.

**Note: Provided step wise procedure for each recommendation are detailed out in annexure based on requirements**