

Third Party Audit of ROB's and FOB's Of SCR



INSPECTION OF ROB NO. 660A NEAR TENALI RAILWAY STATION

Final Report
SEPTEMBER | 2020

CONTENTS

Page no

1. Visual Inspection.....	04
1.1 General Information and Observation	
1.2 Structural System of the Bridge	
1.3 Survey of Signs of Distress, Deformation in Bridges	
2. Non-Destructive Testing.....	15
3. Repair and Retrofitting Recommendations.....	21
4. ANNEXURE A.....	24
5. Summary.....	34
6. Reference.....	35

List of figures

Fig: 1 View of ROB	07
Fig: 2 Bottom view of Bridge	08
Fig: 3 Top view of the Bridge / Condition of Wearing coat	08
Fig: 4 Condition of parapet wall / Railing	09
Fig 5: Shotcreting observed in pier-1 columns & Girders	09
Fig 6: Reinforcement exposure observed in pier-1 columns	10
Fig 7: Reinforcement exposure & Spalling observed on Longitudinal & Cross girders of Span-1	10
Fig 8&9: Severe cracks & Vegetation observed in end of the cross girders	11
Fig 10: Severe Spalling & Reinforcement exposure observed at over hanging portion of cross girder in pier 2	12
Fig 11: Spalling & Reinforcement exposure observed at over hanging portion of slab in Span-2	12
Fig 12: Reinforcement exposure observed at Slab of Span-3	13
Fig 13: Reinforcement exposure & Spalling observed at columns of Pier-3	13
Fig 14: Leaching observed at Pier-3 cap	14
Fig 15: Debris accumulated at bearings of Span-2 and filled with Mortar at Span-3	14
Fig 16: Bottom view of ROB with NDT Test Location	19
Fig 17: Rebound hammer test at site	20
Fig 18: UPV test at Site	20
Fig:19 Bottom view of ROB with damaged locations	21
Fig: 20 Deterioration of Reinforcement and Major spalling of Deck slab.	23

Annexure Repair Methodologies

Annexure-1a	Debris Accumulation: Cleaning	25
Annexure-1b	Spalling, Honeycomb: Patching	27
Annexure-1c	Reinforcement Exposure Spalling and Cracking: Shotcrete	31

1. VISUAL INSPECTION

Name of the Project : VISUAL INSPECTION OF ROB 660A
Location : NEAR TENALI RAILWAY STATION (396/12-15)
Location Co-ordinates : 16°14'18.0"N 80°38'29.3"E
Date of Inspection : 29th NOVEMBER, 2019
Date of NDT : 31st Aug 2020




Summary:

- a) Severe cracks are observed at ends of the cross girders in Span-2.
- b) Spalling is observed at span-1 Slab and at overhang portions of Pier-3.
- c) Severe Spalling & Reinforcement exposure observed at over hanging portion of cross girder in pier-2 and at end girders of Span-2.
- d) Reinforcement exposure is observed at Slab of Span-1, overhang portions of Span-2, Pier-2 & Pier-3.
- e) Shotcreting observed at Pier-1 cap and at Slab of Span-1.
- f) Leaching observed at Slab and Piers of the Bridge.

PART 1.1 GENERAL INFORMATION AND OBSERVATION

a.	Name of the Bridge	ROB 660A
b.	Location Location co-ordinates	Near Tenali Railway station (396/12-15) 16°14'18.0"N 80°38'29.3"E
c.	Type of Bridge	RCC Girder Bridge
d.	Year of Construction	Data Not Available
e.	Grade of Concrete (Slab)	Data Not Available
f.	Design Load	Data Not Available
g.	Carriageway Width	7.3 m
h.	Overall Deck Width	11.5m
i.	Average Skew	25°
j.	Span arrangement (no x Span in meters)	1 x 22 + 1 x 5.6 + 1 x 10.5
k.	No of Railway Lines Crossings	04 tracks
l.	Vertical Clearance (from rail top to girder bottom)	5.52 m
m.	History of Repair/ maintenance	Yes, Patch work done
n.	Existing structural drawings	Not available

Key Plan

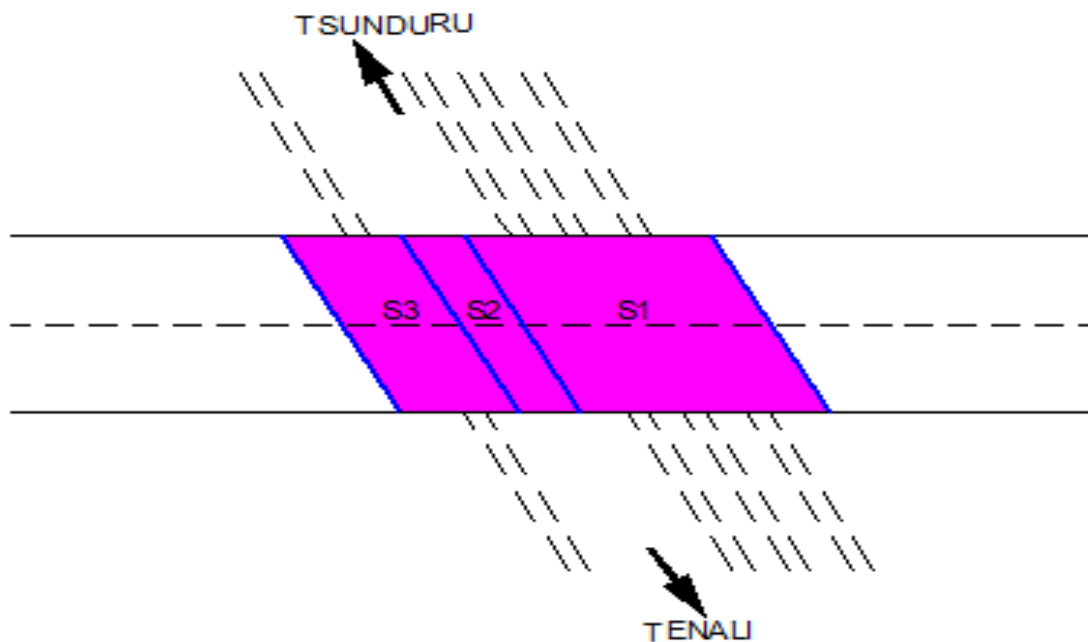

PART 2 STRUCTURAL SYSTEM OF THE BRIDGE			
			Notes
a.	Foundation details		Not visible at site
	Type of foundation		
	Foundation Details (if available...)		
	Foundation Status (Check Settlement, abnormal Scour and Tilting, if any etc....)		
	Type of Damage (Check cracking, disintegration, decay, erosion, Cavitation's etc.,)		
b.	Abutment (A1 & A2)		
	Type	- NA-	
	Maximum height of Abutment	- NA-	
	Abutment width along the Track	- NA-	
	Abutment thickness	- NA-	
	Condition (Crack, Settlement, Scour, Tilting, Steel Corrosion, Strains and other damages etc...)	- NA-	
	Efficiency of drainage of backfill Behind Abutments (Check functioning of weep holes, evidence of moisture on Abutment faces, etc.)	- NA-	
c.	Pier		
	Type (Shape)	Portal Type	Cracks & Spalling has been observed on Pier. Patching done. ... (Refer Fig: 5, 6 & 13)
	Material	RCC	
	No. of Piers in a row/column	05	
	Maximum Height of Pier	4.5 m	
	Pier Diameter/Dimension		
	Pier Cap Material	RCC	
	Pier Cap Condition	Distresses Found	
	Pier Condition (Crack, Settlement, Scour, Tilting, Steel Corrosion, Strains, and other Damages etc...)	Distresses Found	

d.	Bearing & Pedestal		
	Type of Bearings	Metal plate	
	General condition (Check Corrosion, cleanliness, seizing of plates silting, accumulations of dirt in case of submersible bridges)		Debris accumulated at all bearings and filled with Mortar. (Refer Fig: 15)
	Type/ shape of Pedestal		There is no Pedestal
	General condition (Check Corrosion, cleanliness, seizing of plates silting)		
e.	Super Structure (Concrete Girder)		
	Type/Shape of Girder (I-beam, box- Girder etc.)	T-Girder	
	Material of Girder	RCC	
	No of Girder	05 Nos.	
	Dimensions of Girder		Girder Depth = 1.25 m Width of the Girder = 0.6 m for Span-1
	Structural System of Girder	Simply Supported	
	Condition of Girder	Distresses Found	Spalling, Patching, Repairing has been observed (Refer Fig: 7)
	Type/Shape of Secondary Girder	Rectangular	
	Material of Secondary Girder	RCC	
	No of Secondary Girders	7 Nos.	
	Condition of Secondary Girder	Distresses Found	Repair works done. (Refer Fig: 8, 9 & 10)
f.	Slab		
	Material of Slab	RCC	
	Thickness of Slab	0.4m	
	Condition of Slab from Bottom	Distresses Found	Leaching has been Observed.
	Condition of Slab from Top		Not visible, as covered with wearing coat
	Condition of Flooring/Wearing Coat	Fair	(Refer Fig: 3)
	Parapet wall/Railing		
	Type of Parapet wall/Railing	RCC Railing	
	Height	1 m	
	Condition of Wall/Railing		Spalling, Reinforcement exposure, cracks has been observed (Refer Fig:4)

PART 1.3 SURVEY OF SIGNS OF DISTRESS, DEFORMATION IN BRIDGES

	Defects	Location	Notes
	Cracking in RCC components	Slabs & Piers	Cracks are observed at ends of the Cross Girders.
	Water seepage		No Water seepage is observed.
	Spalling	Slabs & Girders	Spalling is observed on Slabs & Girders.
	Reinforcement Exposure	Girders	Reinforcement Exposure is observed on Slabs & Piers.



Fig: 1 View of ROB



Fig: 2 Bottom view of Bridge



Fig: 3 Top view of the Bridge / Condition of Wearing coat



Fig: 4 Condition of parapet wall / Railing



Fig 5: Shotcreting observed in pier-1 columns & Girders



Fig 6: Reinforcement exposure observed in pier-1 columns



Fig 7: Reinforcement exposure & Spalling observed on Longitudinal & Cross girders of Span-1

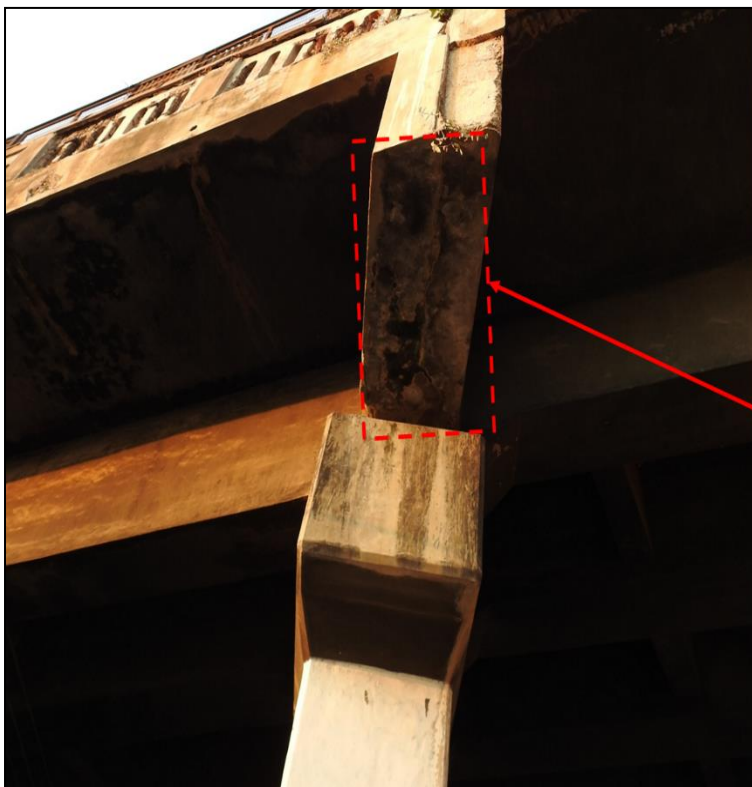


Fig 8&9: Severe cracks & Vegetation observed in end of the cross girders



Fig 10: Severe Spalling & Reinforcement exposure observed at over hanging portion of cross girder in pier 2



Fig 11: Spalling & Reinforcement exposure observed at over hanging portion of slab in Span-2



Fig 12: Reinforcement exposure observed at Slab of Span-3



Fig 13: Reinforcement exposure & Spalling observed at columns of Pier-3



Fig 14: Leaching observed at Pier-3 cap



Fig 15: Debris accumulated at bearings of Span-2 and filled with Mortar at Span-3

2. NON-DESTRUCTIVE TESTING

The following tests were carried out to investigate strength and quality of “**Tenali ROB (660A)**” elements such as piers, girder and slab as specified:

- Rebound Hammer test by Schmidt Rebound Hammer as per IS: 13311 part 2
- Ultrasonic Pulse velocity test, as per IS:516 part 5
- Observation of Crack width and Depth
- Carbonation test
- Half-cell Potential Test

A. RESULTS AND OBSERVATIONS OF REBOUND HAMMER TEST:

The test results of rebound hammer test carried out on Main girders, cross girder, piers and Slab are presented in the Table1.

Table 1: Shows Observations of Rebound hammer test

Sl. No	Member	Location ID	Method	Rebound Numbers	Corrected Rebound Number	Estimated Compressive Strength (N/mm ²)
1	Column-1, PIER-2	1.2m from ground level	Horizontal	48.8,40.5,50.5, 57,53.5,60.5	51.8	46.12
2	Column-3, PIER-2	1.2m from ground level	Horizontal	44.5,47.5,38,45 .5,47,36.5	43.2	34.04
3	Column-3, PIER-2	1.4m from ground level	Horizontal	55.5,65.5,55,72 ,58.5,55.5,	60.3	62.50
4	Span-1, Girder-2, MG-2	2m from L/S	Horizontal	42.5,45.5,37,31 ,45,44	40.8	31.34
5	Span-1, Slab in b/w MG2-MG3	0.8m from MG-2	Vertical	67,65,34,61,56, 55,	56.3	54.25
6	Span-1, Slab in b/w MG2-MG3	2m from MG-2	Vertical	49.5,41.5,36,37 ,33,31.	38.0	28.35
7	Span-1, Cross Girder in b/w G3-G4	0.7m from G4	Horizontal	35,34,38,38.5,3 5,38.5	36.5	26.88
8	Slab in b/w G3-G4	2m from G3	Vertical	39,36.5,42,32,3 5.5,36.5	36.9	27.28
9	Girder-3	2m from A1	Horizontal	39,40,47,46,47, 53.5	45.4	36.86

Note: Estimated compressive strength is referred from the standard charts developed for particular strength. Probable accuracy is $\pm 25\%$

B. RESULTS AND OBSERVATIONS OF ULTRASONIC PULSE VELOCITY TEST (UPV Test):

The test results of UPV test carried out on Main girders, cross girder, Piers and Slab are presented in the Table2.

Table 2: Shows Observations of Ultrasonic Pulse Velocity test

Sl. No	Member Id*	Location	Test Method	Path Thickness (mm)	Pulse Velocity (km/sec)	Corrected Pulse Velocity (km/sec)	Concrete Quality As per Referred Table - II
1	Column-1, PIER-2	1.2m from ground level	In-Direct	400	4.577	5.077	Excellent
2	Column-3, PIER-2	1.2m from ground level	In-Direct	400	2.585	2.585	Poor
3	Column-3, PIER-2	1.4m from ground level	In-Direct	400	2.307	2.307	Poor
4	Girder-2, MG-2	2m from L/S	In-Direct	400	2.963	2.963	Poor
5	Slab in b/w MG2-MG3	0.8m from MG-2	In-Direct	400	4.032	4.532	Excellent
6	Slab in b/w MG2-MG3	2m from MG-2	In-Direct	400	1.596	1.596	Poor
7	Cross Girder in b/w G3-G4	0.7m from G4	In-Direct	400	1.010	1.010	Poor
8	Slab in b/w G3-G4	2m from G3	In-Direct	400	2.227	2.227	Poor
9	Girder-3	2m from A1	In-Direct	400	1.355	1.355	Poor

CONCRETE QUALITY GRADE CHART FOR ULTRASONIC PULSE VELOCITY TEST (As per IS: 516 Part 5, Clause 2.5.2, Table -I)

PULSE VELOCITY(Km/Sec)	CONCRETE QUALITY
Above 4.40	Excellent
3.75 to 4.40	Good
3.0 to 3.75	Doubtful
Below 3.0	Poor

Note:

1. In the case of “doubtful “quality, it may be necessary to carry out the further test.
2. As per IS: 516 (Part 5) Clause 2.4.3.2.5, Surface probing, in general, gives lower pulse velocity than in case of cross-probing and depending on a number of parameters, the difference could be of the order of about 0.5 km/sec.

C. OBSERVATIONS OF CRACK WIDTH AND DEPTH:

Table 3: Shows Observations of Crack width and depth

Sl. No	Member	Location ID	Width (mm)	Depth (m)
1	Pier-2 Column-1	1.2m from Ground Level	0.40	0.032

D. OBSEVATIONS OF CARBOANTION TEST

Table 4: Shows Observations of Carbonation test

S. No.	Member	Location ID	Observations	Remarks
1	Pier-2	Over along the portion of slab	No color change	Carbonated

E. OBSEVATIONS OF HALF CELL POTENTIAL TEST

Table 5: Shows Observations of Half-cell potential test

S. No.	Member	Location ID	Measured Potential (mV)	Avg. Potential Value(mV)	Probability of Corrosion
1	Pier-2, 1 st column	1.2m from Ground level	-610, -609, -620, -612, -585, -697	-622	Severe Corrosion
2	Pier-2, 1 st column	1.1m from Ground Level	-650, -670, -655, -629	-651	Severe Corrosion
3	Pier-2	Over along the portion of slab	-367, -302, -430, -396, -430	-385	High (<90% of risk Corrosion
4	Pier-2	Over along the portion of slab	-546, -604, -601, -588, -781	-624	Severe Corrosion

Half Cell Potential Test Chart of Uncoated Reinforcing steel in Concrete

(Criteria of corrosion according to ASTM C876-91)

Average Potential Value (mV)	Corrosion Condition
<-500	Severe Corrosion
<-350	High (90% of risk corrosion)
-350 to -200	Intermediate corrosion risk
>-200	Low (10% of risk corrosion)

NDT Summary:

- i. Estimated strength as per rebound hammer test indicated that concrete strength is >26MPa.
- ii. Ultrasonic Pulse Velocity test indicates that the quality of concrete varies from Poor to Excellent.
- iii. Half-cell potential test shows that the Rebar is in high risk of Corrosion.
- iv. Crack width test shows that the observed cracks at Pier columns are major structural cracks (>0.3mm)

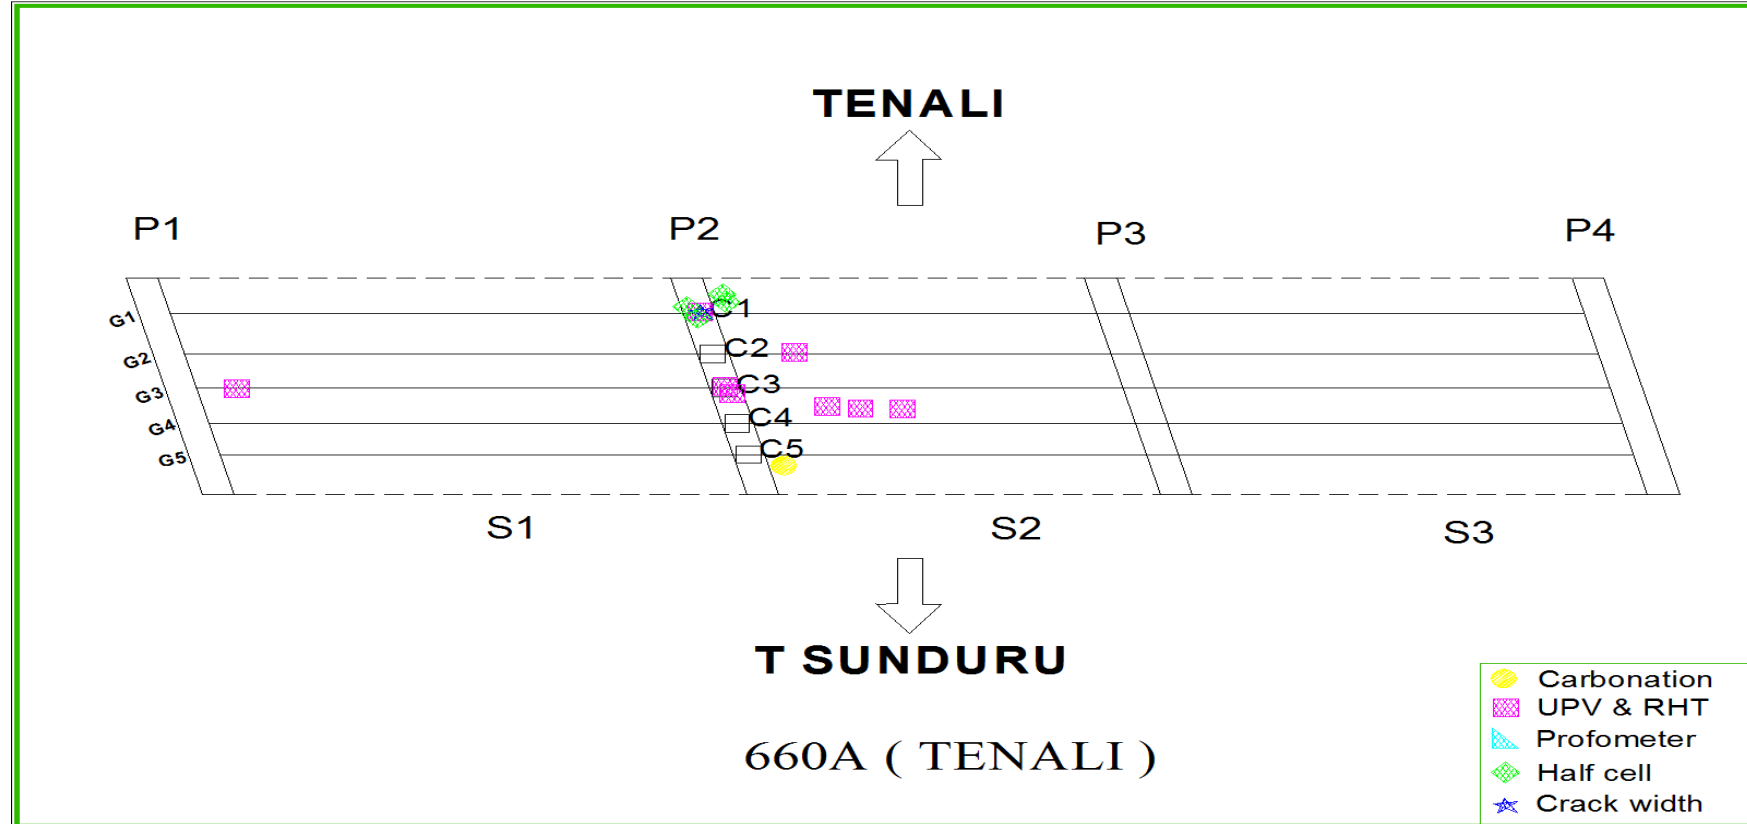


Fig 16: Bottom view of ROB with NDT Test Location

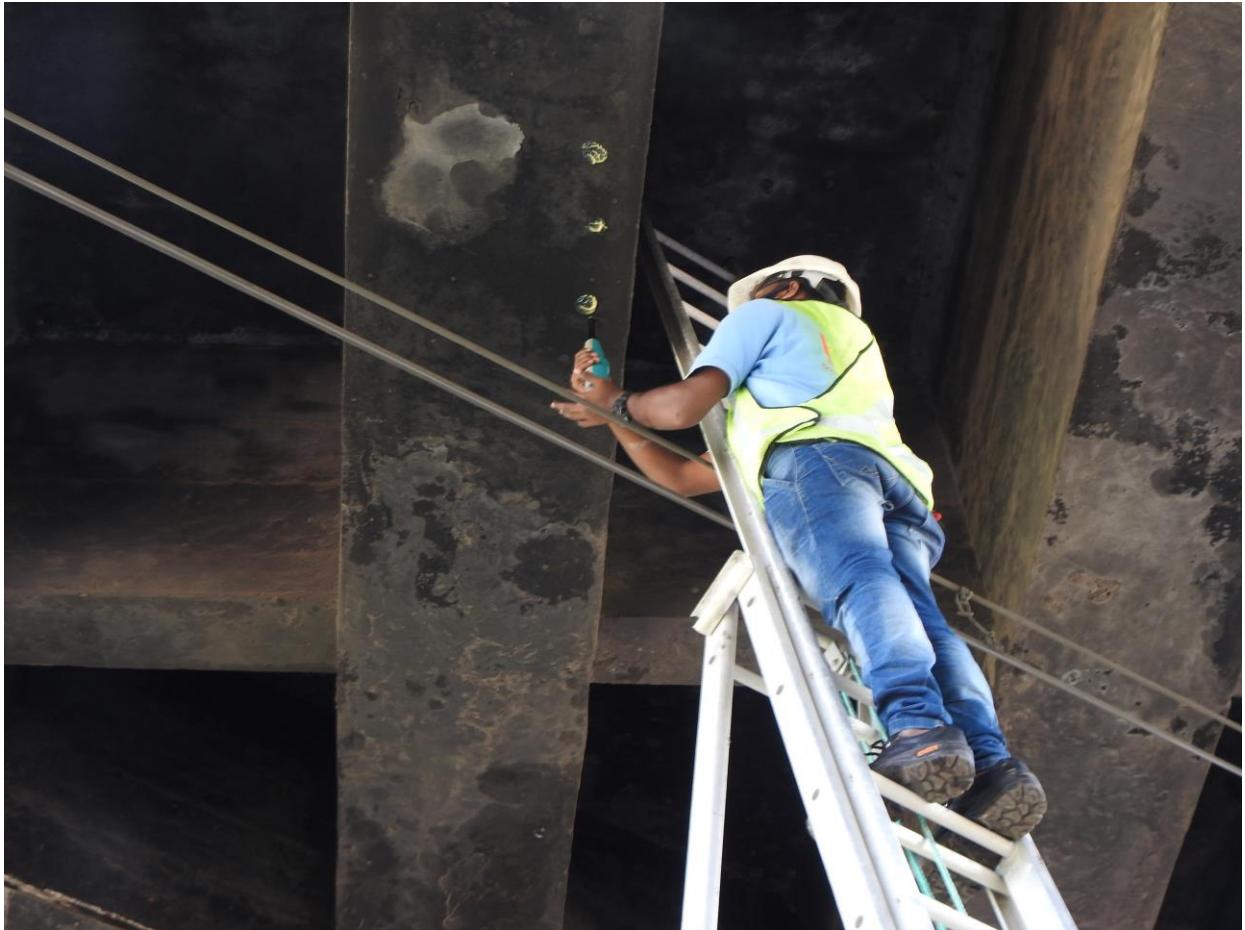


Fig 17: Rebound hammer test at site



Fig 18 UPV test at site

3. Repair and Retrofitting Recommendations

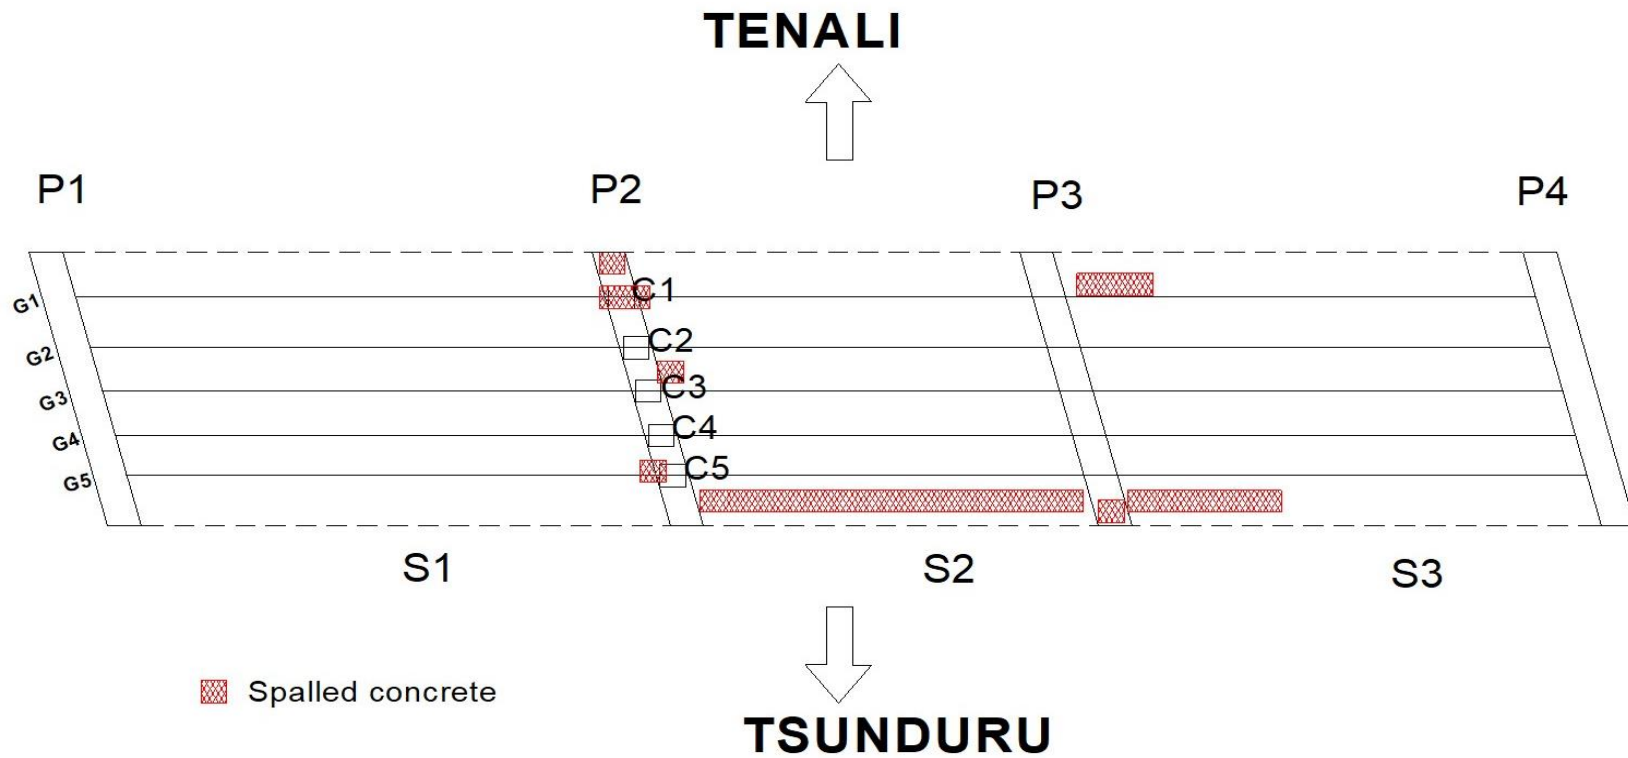


Fig: 19Bottom view of ROB with damaged locations

The detailed visual observation of ROB, the following observations are made. Major Spalling and Reinforcement exposure are observed at Deck slab, overhang portions and piers as shown in the below figure, Corrosion is seen in the exposed rebars of the Slab.





Fig: 20 Deterioration of Reinforcement and Major spalling of Deck slab.

ANNEXURE

Annexure-1a: Repair methods

Defects/Deficiency	Debris accumulation
Remedial Measures	Cleaning

Work sequence

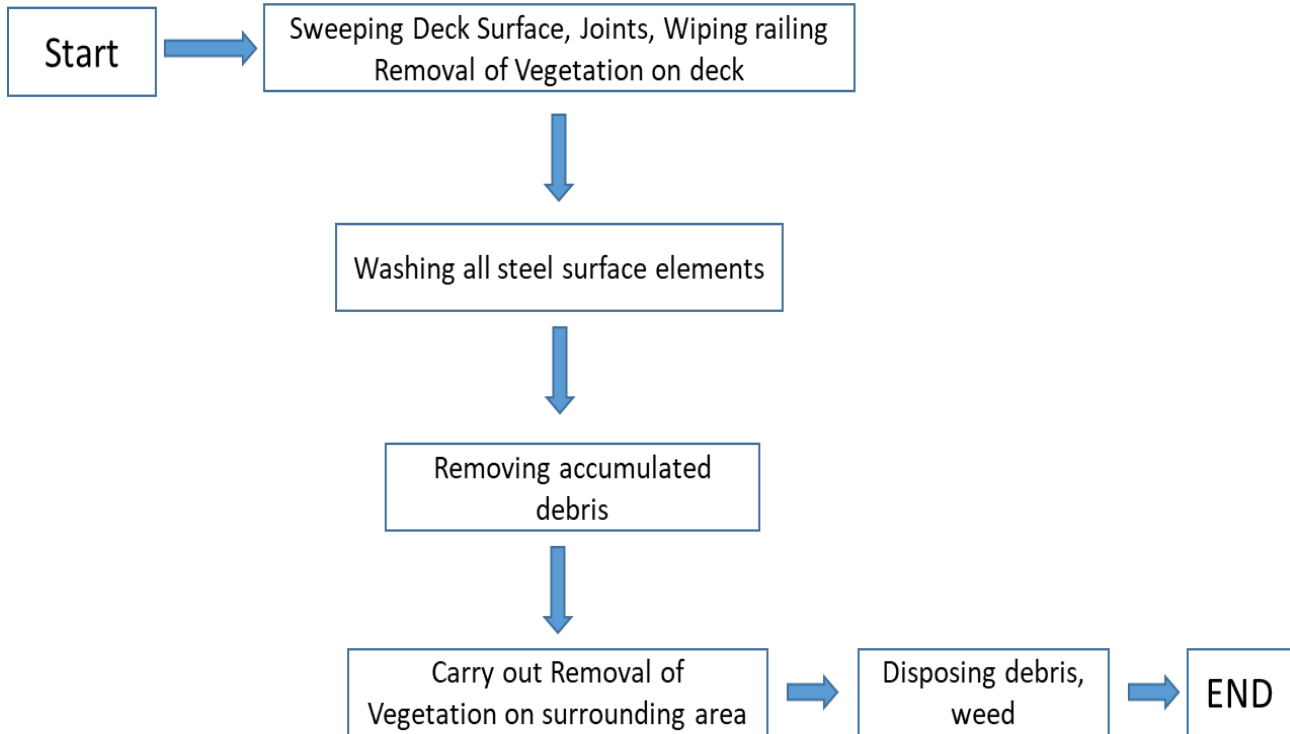


Figure:1.1 Work sequence of removal of vegetation and accumulated debris

REQUIREMENT, SPECIFICATION

Material Requirement

Water to be used for cleaning of the bridge components shall be clean and free from unwanted foreign materials such as sediments, salt contaminants, chemicals, grease, oil, rubbish, and other substances which are harmful to the bridge components.

The contractor shall obtain necessary approvals of the source of water to be used for cleaning. Engineer's approval shall be taken on the source and quality of water. All necessary tests shall be performed on water samples at laboratories to be specified by the Engineer, and test certificates shall be provided as required.

Work Requirement

1. General

All accumulated foreign materials shall be removed from bridge sidewalks, bridge decks, top of curbs, beam flanges, gusset plates, abutment bridge seats, and other locations specified and as directed by the Engineer, prior to cleaning with water pressure. Removal shall be performed using hand brooms, hand shovels, scrapers, vacuum cleaners, or other methods acceptable to the Engineer. The removed materials shall be collected and disposed at an approved waste area in accordance with governing local regulations. At no time shall these materials be allowed to be disposed into the river or on dry land portions below the bridge.

2. High pressure water

Salt contaminants, dirt, and other detrimental foreign matters shall be removed without damaging the structure. If high-pressure water is used, the maximum water pressure shall not be so high that may cause damage. The cleaning operation shall be discontinued if the foreign materials have not been easily removed or if cleaning operation is causing damage to existing structure.

All deck drains and its accessories shall be flushed with high-pressure water after the accumulated foreign material has been carefully removed. Drain systems may have to be disassembled to remove large blockages of accumulated foreign material. Should this be necessary, these shall be returned to their original configuration immediately after cleaning. Drainage systems shall drain properly after cleaning.

Annexure-1b: Repair methods

Defects/Deficiency	Spalling, Honeycomb
Remedial Measures	Patching

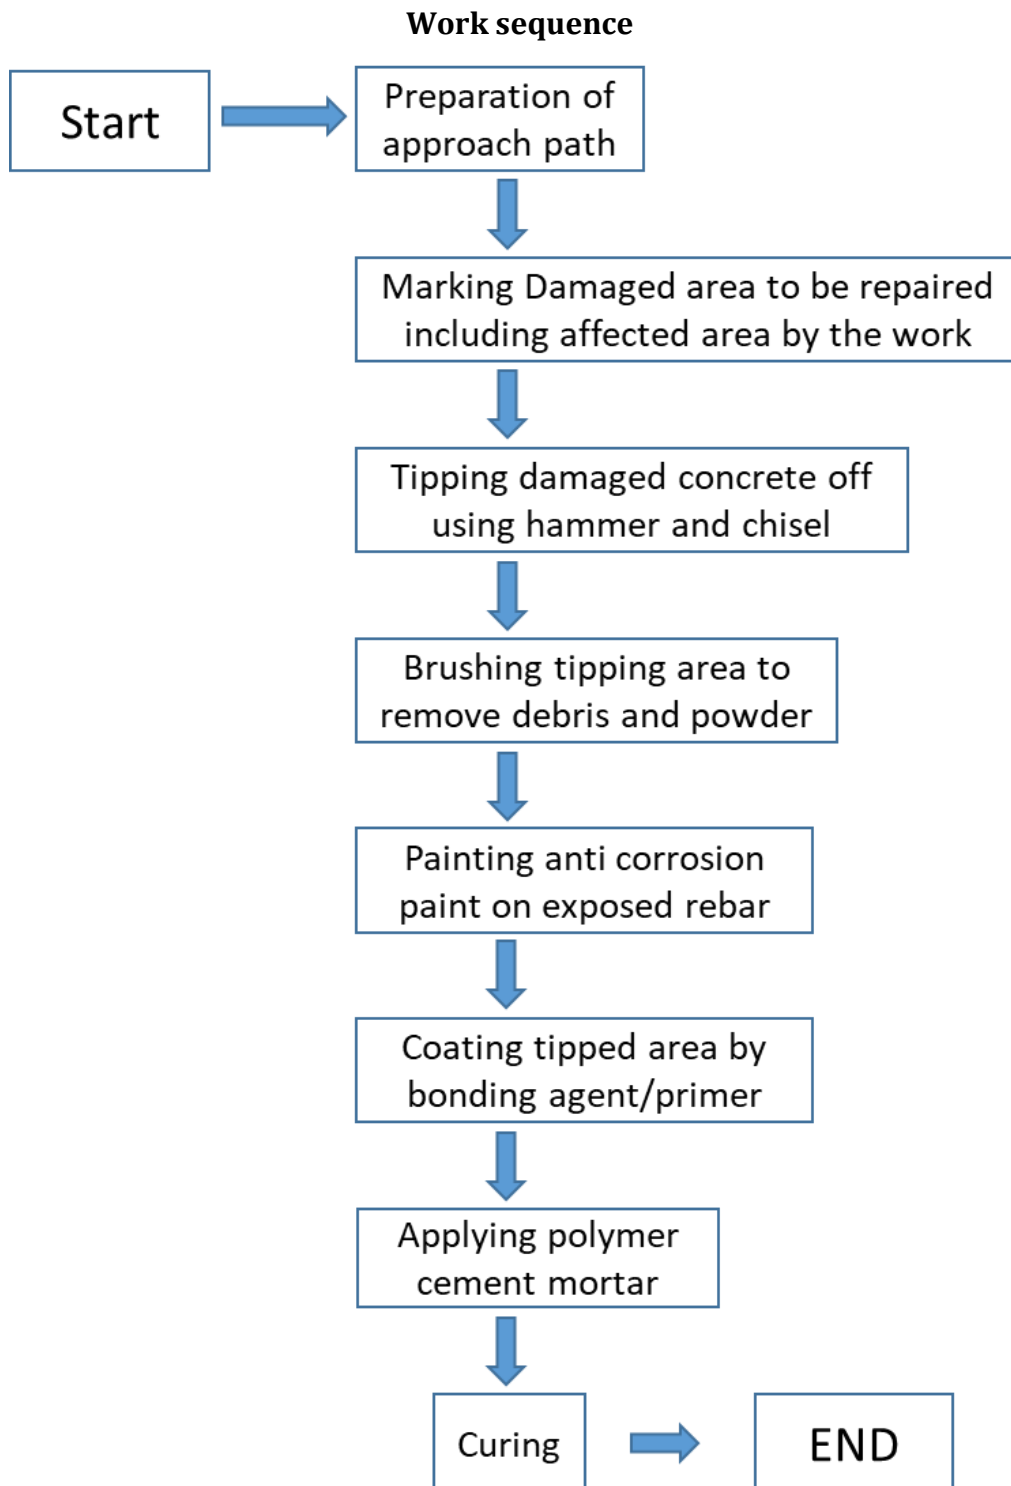


Figure: 1.2 Work sequence of Epoxy Coating

Required Equipment/Tool and Material

Material List –

- Polymer Cement Mortar
- Portland Cement
- Epoxy Bonding
- Zinc rich primer

Tool/Equipment List –

- Chisel
- Portable Generator
- Wire Brush

Requirement, Specification

Material Specifications

The Engineer through mill certificate of the supplier shall approve the material.

1) Polymer Cement

Polymer cement mortar shall conform to the requirements of the specifications shown in Table 1.1 or equivalent ASTM Specifications.

Table:1.1 Specification of Polymer Cement for Patching

Property	Test Method	Specification
Initial setting time	-	above 60 minutes
Shrinkage	ASTM D2566	below 0.05 %
Thermal expansion	ASTM C531	2.0×10^{-5} mm/mm/ ° C
Slant shear bond to concrete	ASTM C882	Concrete failure above 15 N/mm ²
Compressive strength	ASTM D695M	above 20 N/mm ²

2) Epoxy bonding agent

The epoxy-bonding agent to concrete surface shall conform to the requirements of the specification indicated in Table 1.2 (Anti-corrosion zinc rich primer shall be applied to exposed rebar).

Table 1.2 Specification of Epoxy Bonding Agent to Concrete Surface

Property	Test Method	Specification
Compressive strength	ASTM D695M	70 N/mm ²
Flexural strength	ASTM D790M	40 N/mm ²
Tensile strength	ASTM D638M	30 N/mm ²
Tensile shear bond to steel	ASTM 1002	15 N/mm ²
Slant shear bond to mortar	ASTM C882	15 N/mm ²
Bond Strength of Cured Concrete to Fresh Concrete	ASTM D7274	15 N/mm ²

- 3) Zinc Rich Primer The zinc rich primer to rebar shall be in accordance with the requirements of the specifications in Table 1.3

Table 1.3 Specification of Zinc Rich Primer for Rebar

Property	Test Method	Units	Specification
Gloss @ 60°Angle	ASTM D 523	-	Flat
Adhesion	ASTM D 3359	-	Minimum 3A
Salt Spray Resistance	ASTM D3-37	-	Excellent
%Zinc by Weight in Dried Film Test		%	87.5±2

Work requirement

1) General

Patching repair works using Portland cement mortar shall be carried out in accordance with provisions of relevant standards and manufacturer's specifications. Patching, as a minor repair work, should be carried out using an appropriate means to access the repair area, before the defect worsens. Patching repair work method using polymer cement mortar shall be carried out as follows:

2) Marking of patching area

Evaluate surface area to be patched using hammer for hollow sounding delaminated area (or by using instruments to detect unsound concrete).

Mark the area to be patch-repaired with paint or marker. Ensure complete coverage of the damage.

- 3) Tipping damaged concrete off Using a small sledgehammer and chisel, remove all damaged concrete at the edges and corners of area to be repaired. Use a wire brush to remove loose debris. Care should be taken to ensure that no reinforcement is damaged.

Surface shall be cut to expose the reinforcement and to reach the sound concrete substrate, without breaking the concrete behind the reinforcement. If rebar is exposed, anticorrosion agent coating should be applied on the bar surface prior to patching. All works shall be subjected to the approval of the designated Engineer.

Patch areas that are within 600 mm of each other should be combined into a single large patch. If necessary, provide formwork around the damaged concrete to straighten the edges of the damaged section.

- 4) Coating tipping area Concrete surfaces to receive repair mortar shall be prepared by mechanical scrubbing to remove loose materials, surface laitance, organic contaminants and moss. The clean and dust free surface shall then be coated by a bonding primer.

Care shall be taken to ensure that vibration associated with the repair works does not cause delamination of existing adjacent plaster or concrete.

5) Applying bonding agent and anti-corrosion paint

Apply bonding agent to the damaged area for the patch material to adhere. Additionally, concrete nails/bids may be set to reinforce the repair.

If rebar is exposed, anticorrosion coating should be applied on the bar surface prior to patching.

6) Patching

mortal Prepare the mortar mix in a bucket using equipment approved by the Engineer. Use a trowel to spread fresh mortar over the area, covering the concrete nails driven halfway in the old concrete. Smoothen and level the mortar with a trowel. Polymer cement mortar is suitable for both vertical and horizontal surface applications, with a thin coating of up to 15 mm.

7) Finishing

As may be required, the mortar surface can be smoothed using a trowel or broom finished. The texture of the finish of the final repair mortar layer shall match the finish of the existing surface. The repair mortar application shall be built up to the original surface profile in layers not exceeding 20 mm with the final layer not exceeding 15 mm, unless otherwise recommended by the manufacturer and approved by the Engineer.

The Engineer may approve repair mortar application thickness of up to 50 mm for lightweight mortars, provided the mortar manufacturer furnishes technical data to justify a layer thickness of greater than 20 mm.

8) Curing All types of concrete repair with repair mortar need thorough and continuous curing to develop strength and impermeability. Curing also minimizes drying shrinkage while bond strength is developing. Curing of the repair mortar shall be in accordance with the manufacturer's instructions related to the polymer modified additive. Where curing agents are specified by the manufacturer, they shall be applied immediately after the surfaces have been scarified for the next repair mortar layer or troweled to a finish.

Annexure-1c: Repair methods

Defects/Deficiency	Reinforcement Exposure, Spalling and Cracking
Remedial Measures	Shotcrete

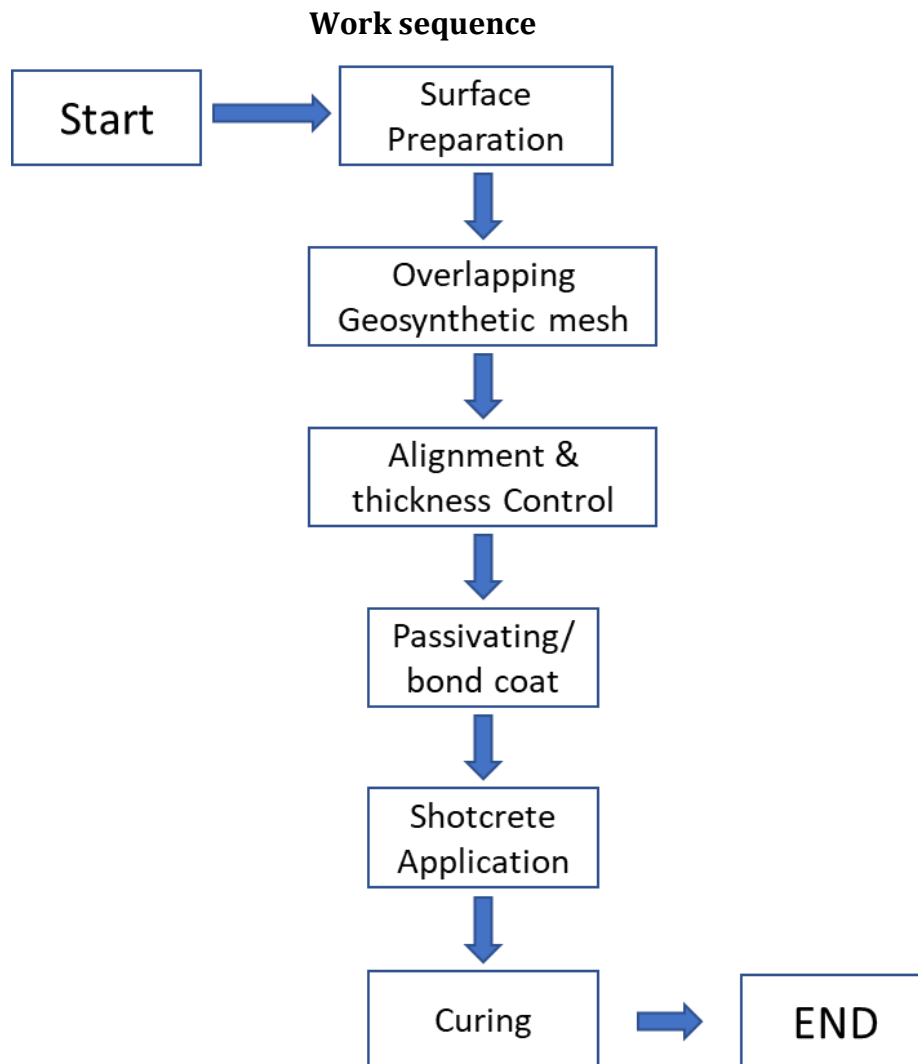


Figure: 1.4 Work sequence of Shotcrete

Required Equipment/Tool and Material

Materials

- Cement
- Fine Aggregate
- Coarse Aggregate
- Admixture
- Water

Tools/Equipment

- Batching and mixer
- Guniting equipment
- Compressor

Requirement, Specification

Materials

Cement: The cement shall be ordinary Portland cement of 43 grade conforming to relevant B.I.S. Code of Practice

Aggregates:

Sand for shotcrete shall comply with the requirements given in IS 383 and graded evenly from fine to coarse as per Zone-II and Zone III grading. Sand failing to satisfy this grading may, however, be used only if pre-construction testing establishes that it gives good results.

Coarse aggregate when used shall comply with the requirements of IS 383. It shall, generally conform to the grading given below:

Table 1.5 Gradation of the coarse aggregate

GRADING OF COARSE AGGREGATES	
IS Sieve Designation, mm	Percentage Passing by mass for aggregate of nominal maximum size
10	100
4.75	10 – 30
2.36	0 – 10
1.18	0 - 5

All over sized pieces of aggregate shall be rejected by screening. Gradation of the combined coarse and fine aggregate mixture used for shotcrete shall generally lie between the following limits.

Table 1.6 Gradation of the combined coarse and fine aggregate mixture

I.S Sieve	Percent passing by Weight Gradation
10 mm	100
4.75 mm	72 - 85
2.36 mm	52 - 73
1.18 mm	36 - 55
600 microns	28 - 38
300 microns	7 - 20
150 microns	0 - 8

Water used for shotcrete shall conform to the requirement of I.S. 456-2000

Admixture: Guniting admixtures & quick setting agents may be used to minimize the rebound loss and increase the bond & enable thicker layers per coat. The admixture shall meet the requirement of I.S. 456 and I.S. 9103

Concrete: The grade of concrete shall be as specified i.e. the characteristic compressive strength of 15 cm cube at 28 days should be as specified. The water cement ratio for shotcrete shall be within the range 0.45- 0.50 by mass.

Work requirement

- 1) This specification covers only to the extent of restoring the concrete slab by way of short creating. The specification excludes bearing replacement, expansion joint treatment etc.
- 2) Remove all loose and spalling concrete and expose the corroded reinforcement wherever possible by careful chipping.
- 3) Carryout thorough sand blasting using dry coarse sand or by grinding.
- 4) Fix 8 mm dia PVC nozzles at all honey combed areas and wherever cavities exist. At all other vulnerable areas drill 12/14 mm dia hole to a depth of 50 to 75 mm and fix 8 mm PVC nozzles.
- 5) Now drill 12/14 mm dia holes at a spacing of 500 mm c/c to a depth of 50 mm and fix 8 mm dia shear connectors using polyester resin grout.
- 6) Fix 50 mm x 50 mm x 4 mm Geo grid tied to the exposed reinforcement / shear connectors.
- 7) Carryout 40 to 50 mm thick short - creating to underside of slab etc., using a mix proportion of 1: 2: 2 (cement: sand: aggregate).
- 8) Now carryout cement injection grouting through the nozzles in sequential manner until rejection.
- 9) Carryout curing for 7 days.
- 10) Note: Grouting is done only after shotcrete to fill any leftover voids in the concrete slab.

Summary

- Visual inspection of Tenali ROB (660A) has been conducted on 29th Nov 2019, following observations were made
 - a) Severe cracks are observed at ends of the cross girders in Span-2.
 - b) Spalling has been observed at span-1 Slab and at overhang portions of Pier-3.
 - c) Severe Spalling & Reinforcement exposure observed at over hanging portion of cross girder in pier-2 and at end girders of Span-2.
 - d) Reinforcement exposure is observed at Slab of Span-1, overhang portions of Span-2, Pier-2 & Pier-3.
 - e) Shotcreting observed at Pier-1 cap and at Slab of Span-1.
 - f) Leaching observed at Slab and Piers of the Bridge.
- Non-Destructive Testing of Tenali ROB (660 A) has been conducted on 31st Aug 2020, following observations were made
 - a) Estimated strength as per rebound hammer test indicated that concrete strength is >26MPa.
 - b) Ultrasonic Pulse Velocity test indicates that the quality of concrete varies from Poor to Excellent.
 - c) Half-cell potential test shows that the Rebar is in high risk of Corrosion.
 - d) Crack width test shows that the observed cracks at Pier columns are major structural cracks (>0.3mm)
- Based on visual inspections and NDT Testing and its interpretations following recommendations were made:
 - a) Epoxy Grouting of cracks observed at Slab, piers, and cross girders.
 - b) Application of Anti corrosive paint for exposed rebars with Minimal deterioration
 - c) Replacement of severely Corroded bars in slab and Shotcreting of the deteriorated concrete
 - d) Shotctreting should be done at the spalled concrete locations

REFERENCE:

- *Das, J., & Sil, A. (2020). Condition assessment of superstructure component of reinforced concrete bridges through visual inspection in the Assam, India. Bridge Structures, 16(1), 39-57.*
- *Bridge inspection and maintenance, Indian railways institute of civil engineering,*
- *Central Public Works Department (CPWD). "Handbook on repair and rehabilitation of RCC buildings." (2002).*
- *Bridge Rehabilitation and strengthening manual has been developed by the consultants under the bridge management capacity development project of RHD with the cooperation of JICA.*
- *Weyers, R.E., Prowell, B.D., Sprinkel, M.M. and Vorster, M., 1993. Concrete bridge protection, repair, and rehabilitation relative to reinforcement corrosion: A methods application manual. Contract, 100, p.103.*
- *Tabatabai, Habib, and Amy Turnquist-Nass. Rehabilitation techniques for concrete bridges. Wisconsin Highway Research Program, 2005.*
- *Furlanetto, Guido, Lucio Ferretti Torricelli, and Alessandra Marchiondelli. "Structural assessment and rehabilitation of concrete bridges." IABSE Symposium Report. Vol. 93. No. 22. International Association for Bridge and Structural Engineering, 2007.*